

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/GRB23000893/UYA3E2**Date:** 04/04/2023REFERENCE

Handling Insurer: India International Insurance Pte Ltd Policy No: D21MFL0000447_02
Claimant Vehicle No : SKV6969U **Insured Vehicle No :** SLQ3760M
 Date of Loss: 23/01/2023 Nature of Claim: TP Claim No: MFL2023D0001668

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SKV6969U**
 Make & Model: TOYOTA SIENTA, 1.5 X CVT (A) Engine No: 2NR8630550
 Reg. Date: 30/11/2017 (Man. Year: 2016) Chassis No: NSP1707037303
 Colour: Black Odometer: 61096 km
 Engine Capacity: 1496 cc
 Market Value/New Car Price: N/A
 Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 185/60 R15 Rear Tyre Size: 185/60 R15
 Front Left Side: Michelin 7 mm Rear Left Side: Michelin 7 mm
 Front Right Side: Michelin 7 mm Rear Right Side: Michelin 7 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 30/01/2023
 Date Inspected: 30/01/2023 Inspected At: Hock Wah Motor Workshop Pte Ltd (Bedok)
 2008/2010/2012
 Singapore 489977
 Estimated Period of Repair: 0.0 days

Adjuster: MARCUS CHUA**Manager:** Ezlyna

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 04 Apr 2023)
Parts:	M1-MPV	TOYOTA SIENTA 1.5 X CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKV6969U)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >