



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC23001037/Kpa3q2 Date: 09/05/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJQ 9746P	Veh. Inspected	SBR 8008H	
Policy No.	Z21VP05029321	Coverage (\$)	0.00	
Claim No.	22/23/23/VP05/026915	Excess (\$)	0.00	
Assign From		Assign Date	01/02/2023	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA HARRIER (A)	c.c	1986	
Engine No.	HIDDEN	Year of Reg.	2014	
Chassis No.	ZSU600022502	Colour	METALLIC PEARL WHITE	
Odometer	162834 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	235/55 R18	PIRELLI	6 mm	
L/H Front Tyre	235/55 R18	PIRELLI	6 mm	
R/H Rear Tyre	235/55 R18	CONTINENTAL	5 mm	
L/H Rear Tyre	235/55 R18	CONTINENTAL	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	31/01/2023	Inspection Date	03/02/2023	
Survey held at	TSR AUTOMOTIVE PTE LTD 160 SIN MING DRIVE #06-01 SIN MING AUTOCITY SINGAPORE 575722			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SBR 8008H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET (NPA)	TO REPAIR SEE LABOUR	-	-
1	FRONT BUMPER	BUCKLED / CRACKED	785.00	785.00
1	FRONT BUMPER RETAINERS (O/S)	DISTORTED	442.00	68.00
1	FRONT BUMPER REINFORCEMENT	TO REPAIR SEE LABOUR	620.00	-
1	FRONT BUMPER CENTER SPONGE	CRACKED	580.00	125.00
1	FRONT BUMPER SIDE SPONGE LH	SERVICEABLE	298.00	-
1	FRONT BUMPER CENTER BRACKET	TO REPAIR SEE LABOUR	350.00	-
3	FRONT BUMPER SENSORS	SHORTED (1 PCS ONLY)	660.00	284.00
1	SET FRONT BUMPER SENSOR CABLE	SERVICEABLE	385.00	-
1	FRONT BUMPER LOWER GRILLE	CRACKED	428.50	284.00
1	FRONT BUMPER LOWER GARNISH	SERVICEABLE	519.60	-
1	FRONT TOW COVER RH	SERVICEABLE	220.00	-
1	FRONT CENTER GRILLE	CRACKED	785.90	598.50
2	HEADLAMPS	O/S MTG CRACKED	5,712.00	2,856.00
2	HEADLAMP LOWER BRACKETS	TO REPAIR SEE LABOUR	440.00	-
1	FRONT SUPPORT PANEL (NPA)	TO REPAIR SEE LABOUR	-	-
2	FRONT FENDER (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 25% DISCOUNT		-3,056.50	-1,250.13
			9,169.50	3,750.37
	<u>SPECIAL NETT ITEMS</u>			
10	FRONT BUMPER CLIPS (SN)	NECESSARY	45.00	45.00
1	SET FRONT NO PLATE WITH FRAME (SN)	DENTED	60.00	45.00
			105.00	90.00
	<u>LABOUR</u>			
	LABOUR CHARGES TO REPLACE ,REPAIR ,REMOVE REFIX ON FRONT ACCIDENT AFFECTED AREA .INCLUSIVE OF THE REPAIR OF BONNET,FRONT BUMPER REINFORCEMENT ,FRONT BUMPER CENTER BRACKET,HEADLAMP LOWER BRACKETS ,FRONT SUPPORT PANEL AND FRONT FENDER .		800.00	300.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO DO ANTI RUST .	NOT NECESSARY	90.00	-
	TO DO SPRAY PAINTING ON ACCIDENT AFFECTED AREA .		1,000.00	220.00
	TO CHECK WIRING SYSTEM ,FORCUS HRADLAMPS .		120.00	20.00
	TO DIGNOSE ,DELETE FAULT CODE,RESET DECODE AFTER REPAIR .	NOT NECESSARY	280.00	-
			2,290.00	540.00
GRAND TOTAL			11,564.50	4,380.37
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,400.00

Report Ref No. CC4/LPC23001037/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SBR 8008H

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SBR 8008H

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SBR 8008H

RE-INSPECTION

