

PAR Automotive Consultancy

Regn. No: 52986974L

Mailing Address : Blk 310 Shunfu Road #07-213, Singapore 570310. Tel : 645 3117

Report No: 0001-23-HL

09 January 2022

ACCIDENT VEHICLE SURVEY REPORT

Neo Eng Huat
c/o Hiap Lek Automobile Trading
160 Sin Ming Drive #05-17
Sin Ming Autocity
Singapore 575722

VEHICLE INFORMATION:

Vehicle Reg No.:	SKA9372G	Odometer:	161046km
Make & Model:	Mercedes Benz C180K	Colour:	Black
Chassis number:	WDD2040452A519810	Date of accident:	12/09/2022
Year of Regn.:	15/04/2011	Date inspected:	12/09/2022
Repairer at:	Hiap Lek Automobile Trading 160 Sin Ming Drive #05-17 Sin Ming Autocity Singapore 575722	Date inspected (After Repair):	21/09/2022

STATIC CHECKS, where applicable:

Steering :	serviceable
Footbrake :	serviceable
Handbrake :	serviceable
Paintwork :	Good
General condition :	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
Front:	6mm/Westlake	6mm/Westlake	225/45R17
Rear:	5mm/Hankook	5mm/Hankook	225/45R17

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the rear RH portion.

Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

Report No: 0001-23-HL

Vehicle No: SKA9372G

Description of part	Qty	Condition as inspected	Repairer's estimate	Our adjustment	
Rear boot lid	1	buckled	1,232.00	1,232.00	BUC
Rear boot lid emblem 'Mercedes' logo	1	necessary	38.00	38.00	NEC
Rear boot lid emblem 'C180'	1	necessary	59.00	59.00	NEC
Rear boot lid outer chrome moulding	1	reuse	144.00	0.00	
Rear boot lid number plate lamp RH/LH	2	re-use	30.00	0.00	
Rear boot lid inner lock	1	bent	212.00	212.00	NN
Rear boot weatherstrip	1	deformed	132.00	132.00	DM
Rear tail lamp RH/LH	2	fractured	898.00	440 898.00	CRA
Rear bumper	1	deformed	1,125.00	1,125.00	CRA
Rear bumper chrome moulding RH/LH	2	necessary	164.00	164.00	NEC
Rear bumper chrome moulding centre	1	deformed	89.00	89.00	DM
Rear bumper bracket RH/LH	2	bent	60.00	60.00	BT
Rear bumper retainer centre	1	bent	115.00	115.00	BT
Rear bumper side retainer RH/LH	2	necessary	56.00	25 56.00	NEC
Rear bumper reinforcement	1	bent	523.00	523.00	BT
Rear fender drain garnish RH/LH	2	deformed	270.00	270.00	NN
Rear fender drain garnish clip set RH/LH	2	deformed/necessary	102.00	102.00	NN
Rear fender air vent RH	1	deformed	38.00	25 38.00	BUC
Rear end panel	1	bent	891.00	891.00	BT
Rear end panel inner garnish	1	deformed	95.00	95.00	NN
Rear end panel inner garnish clip set	1	necessary	21.00	21.00	NEC
Subtotal before discount			6,294.00	6,120.00	493.90
Percentage discount 0% and 10%			0.00	612.00	493.90
Sub-total 1			6,294.00	5,508.00	4445.10
Reverse sensor (4 pcs)	1	shorted	550.00	250 550.00	
Subtotal before discount			550.00	250 550.00	SC
Percentage discount 0% and 0%			0.00	0.00	
Sub-total 2			550.00	550.00	
Parts-total			6,844.00	6,058.00	4695.10

LABOUR

1. To straighten and panel beating rear fender RH/LH, rear boot floor panel and rear frame members. To cut/weld rear end panel. To remove and refit above parts.
2. To putty, re-spray painting and polish affected areas.
3. To check and rectify wiring system.
4. To rust proof affected areas.


	2,000.00	1,500.00 700
	1,800.00	1,500.00 300
	80.00	50.00 30
	90.00	60.00
Labour total	3,970.00	3,110.00 1590
Parts & Labour total	10,814.00	9,168.00 4695.00
		6285.10

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on LUMP SUM repairs is :
and the recommended number of working days for the repairs is :

LS 5,028.08
LS (20%)
\$7,300.00 5000
6 days


B J Loi (1 Eng. MIMI, AIRTE)
Automotive Appraiser