



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

OPINION ON REPAIR COST FOR VEHICLE NO. SLR 5892Y

Qty	Description of Parts	Condition	Recommended (\$)
	<u>REPLACEMENT OF PARTS</u>		
1	BONNET	DENTED	430.00
1	BONNET LOCK	BENT	50.00
1	BONNET INSULATION	DEFORMED	60.00
2	BONNET HINGES (LH & RH)	BENT	80.00
1	BONNET STAND (NPA)	REFIT	-
1	BONNET STAND CLIP (NPA)	NOT NECESSARY	-
1	BONNET RUBBERSTRIP	TORN	20.00
1	FRONT GRILLE	CRACKED	160.00
2	HEADLAMP (LH & RH)	N/S BROKEN	440.00
2	HEADLAMP LOWER BRACKET (LH & RH)	N/S CRACKED	20.00
1	FRONT BUMPER	DENTED / CRACKED	470.00
2	FRONT BUMPER RETAINER (LH & RH)	N/S CRACKED	20.00
1	FRONT BUMPER REINFORCEMENT	BENT	220.00
1	FRONT BUMPER LOWER GRILLE	CRACKED	45.00
1	FRONT BUMPER LOWER GRILLE CHROME MOULDING	CRACKED	130.00
2	FOG LAMP (LH & RH) (NPA)	REFIT	-
2	FOG LAMP COVER (LH & RH)	N/S GRAZED	50.00
2	FRONT FENDER (LH & RH)	N/S BUCKLED / DENTED / O/S TO REPAIR SEE LABOUR	310.00
2	FRONT SPLASH SHIELD (LH & RH)	N/S TORN	75.00
1	WIPER GARNISH (NPA)	REFIT	-
1	A/C CONDENSER	BENT	630.00
1	RADIATOR	BENT	600.00
1	FAN BLADE (NPA)	REFIT	-
1	FAN MOTOR (NPA)	REFIT	-
1	FAN COWLING (NPA)	REFIT	-
1	A/C LIQUID PIPE (NPA)	REFIT	-
1	A/C DISCHARGE PIPE (NPA)	REFIT	-
1	A/C SUCTION PIPE (NPA)	REFIT	-
1	SUPPORT PANEL	DENTED	460.00
1	SUPPORT PANEL UPPER GARNISH	DEFORMED	30.00
1	TOWING CAP (NPA)	REFIT	-

Report Ref No. CS1/SPF23001421/Tny3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Recommended (\$)
1	SUPPORT TOP PANEL (ADDITIONAL)	DENTED	220.00
2	HEADLAMP PANEL (LH & RH) (ADDITIONAL)	N/S DENTED	60.00
1	FRONT BUMPER UNDER COVER (ADDITIONAL)	TORN	150.00
1	RHS DAY LIGHT (ADDITIONAL)	GRAZED	380.00
1	FRONT BUMPER LOWER GRILLE COVER (LHS) (ADDITIONAL)	DISLODGE / MISSING	15.00
1	FRONT BUMPER SUPPORT (ADDITIONAL)	BENT	120.00
	COST PLUS 10%		524.50
			5,769.50
	<u>SPECIAL NETT ITEMS</u>		
15	BONNET INSULATION CLIPS (SN)	NECESSARY	30.00
10	FRONT BUMPER CLIPS (SN)	NECESSARY	30.00
10	FRONT SPLASH SHIELD CLIPS (SN)	NECESSARY	30.00
1	SUPPORT PANEL UPPER GARNISH CLIPS (SN)	NECESSARY	25.00
1	FRONT NUMBER PLATE WITH HOLDER (SN)	BENT	35.00
			150.00
	<u>LABOUR</u>		
	LABOUR CHARGES TO REMOVE DAMAGED PARTS & FITTINGS TO ENABLE REPAIRS; TO CUT & WELD WHERE NECESSARY; TO REPLACE DAMAGED PARTS AS LISTED ABOVE. INCLUSIVE OF THE REPAIR OF FRONT FENDER (RH).		800.00
	TO SPRAY PAINTING ON: BONNET, SUPPORT PANEL, FRONT BUMPER, A PILLAR (LH & RH), FRONT BOTH FENDER, FRONT BOTH DOOR.		1,000.00
	TO REMOVE & INSTALL A/C CONDENSER & RECEIVER DRYER, TO ENABLE REPAIRS; TO VACUUM & CHARGE UP GAS.		120.00
	TO REMOVE & INSTALL RADIATOR & HOSES TO ENABLE REPAIRS, INCLUDING PRESSURIZE COOLING SYSTEM. -INCLUDED IN ITEM 3 (NPA)	NOT NECESSARY	-
	TO CHECK ELECTRICAL WIRINGS & LIGHTS FUNCTION, INCLUSIVE FOCUS HEADLIGHTS.		30.00
	CHECK & CLEAR FAULT CODES AFTER NECESSARY ACCIDENT REPAIRS. (NPA)	NOT NECESSARY	-
			1,950.00
	GRAND TOTAL		7,869.50

Report Ref No. CS1/SPF23001421/Tny3e2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)	6,250.00
---	-----------------

Report Ref No. CS1/SPF23001421/Tny3e2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.