



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2304675
3 ANSON ROAD #16-00	INV Date	20/07/2023
SPRINGLEAF TOWER	Reference	CC6/CTI23001432/Apa3q2
SINGAPORE 079909	Code	CTI

### PROFESSIONAL SERVICE FEE

Vehicle No.	SLF 7601X
Insured Veh.	YQ 2920X
Claim No.	SNM23D200849/C02
Policy No.	DMCVSNW00114892202
Accident Date	31/01/2023
Inspection Date	01/02/2023

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (8%)</b>	<b>32.00</b>
<b>Grand Total</b>	<b>432.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI23001432/Apa3q2 Date: 20/07/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	YQ 2920X	Veh. Inspected	SLF 7601X
Policy No.	DMCVSNW00114892202	Coverage (\$)	0.00
Claim No.	SNM23D200849/C02	Excess (\$)	0.00
Assign From		Assign Date	01/02/2023
2. Vehicle Particulars & Condition			
Make & Model	HONDA VEZEL HYBRID	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	RU31208683	Colour	WHITE
Odometer	66775 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	215/60 R16	DUNLOP	6 mm
L/H Front Tyre	215/60 R16	DUNLOP	6 mm
R/H Rear Tyre	215/60 R16	DUNLOP	6 mm
L/H Rear Tyre	215/60 R16	DUNLOP	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	31/01/2023	Inspection Date	01/02/2023
Survey held at	ADVANCE AUTO GARAGE 23 KAKI BUKIT AVENUE 4, #04-01 VICOM KAKI BUKIT INSPECTION CENTER, SINGAPORE 415933.		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLF 7601X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
2	REAR NUMBER PLATE LAMP @\$38.50	NOT NECESSARY	77.00	-
1	REAR BUMPER	DEFORMED	880.00	745.00
2	REAR BUMPER SIDE HOLDER @\$23.50	NOT NECESSARY	47.00	-
2	REAR BUMPER REFLECTOR @\$141.10	NOT NECESSARY	282.20	-
2	REAR SIDE BUMPER @\$195.00	TO REPAIR SEE LABOUR	390.00	-
1	REAR END PANEL	DENTED	585.00	585.00
1	REAR END PANEL TOP GARNISH	DEFORMED	98.40	98.40
2	TAILLAMP @\$474.60	O/S CUT	949.20	474.60
2	TAILLAMP PANEL @\$135.50	NOT NECESSARY	271.00	-
1	TAILGATE	DISTORTED	1,100.00	1,100.00
1	TAILGATE LOCK	DAMAGED	182.50	182.50
1	TAILGATE LOCK STRIKER	NOT NECESSARY	24.70	-
2	TAILGATE LAMP @\$413.20	O/S CUT	826.40	413.20
2	TAILGATE LAMP RUBBER GASKET @\$38.50	O/S NECESSARY	77.00	38.50
2	TAILGATE DAMPER @\$182.70	NOT NECESSARY	365.40	-
2	TAILGATE HINGE @\$58.00	NOT NECESSARY	116.00	-
1	TAILGATE OUTER GARNISH	NOT NECESSARY	325.00	-
1	TAILGATE INNER TRIM BOARD	CRACKED	285.60	285.60
1	TAILGATE BUZZER SENSOR	NOT NECESSARY	85.20	-
1	TAILGATE ANTENNA SENSOR	NOT NECESSARY	60.10	-
1	TAILGATE WEATHERSTRIP	CUT	185.00	185.00
1	TAILGATE INNER HANDLE POCKET	NOT NECESSARY	27.50	-
1	TAILGATE GLASS MOULDING	NECESSARY	120.00	120.00
1	HONDA LOGO	NOT NECESSARY	30.40	-
1	VEZEL EMBLEM	NECESSARY	45.90	45.90
1	SPARE TYRE PANEL	TO REPAIR SEE LABOUR	1,130.00	-
1	SPARE TYRE PANEL TOP COVER	DEFORMED	306.60	306.60
1	SPARE TYRE PANEL TOOLS TRAY SPONGE	NOT NECESSARY	285.40	-
1	SPARE TYRE PANEL UNDERCOVER	NOT NECESSARY	225.10	-

Report Ref No. CC6/CTI23001432/Apa3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR FENDER ARC GARNISH @\$196.00	NOT NECESSARY	392.00	-
2	REAR FENDER INNER SHIELD @\$147.50	NOT NECESSARY	295.00	-
2	REAR FENDER INNER TRIM BOARD @\$305.20	O/S CRACKED	610.40	305.20
1	HYBRID EMBLEM	NECESSARY	58.00	58.00
	LESS 20% DISCOUNT		-2,147.80	-988.70
			8,591.20	3,954.80
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	30.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET REVERSE SENSOR (SN)	DAMAGED	280.00	200.00
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	20.00	10.00
1	SET TAILGATE OUTER GARNISH CLIPS (SN)	NOT NECESSARY	25.00	-
1	SET TAILGATE TRIM BOARD CLIPS (SN)	NECESSARY	30.00	30.00
1	TAILGATE GLASS SEALANT (SN)	NECESSARY	60.00	60.00
1	SET SPARE TYRE PANEL UNDERCOVER CLIPS (SN)	NOT NECESSARY	30.00	-
1	SPARE TYRE PANEL INSULATION PAD (SN)	NOT NECESSARY	250.00	-
2	SET REAR FENDER ARC GARNISH CLIPS @\$30.00 (SN)	NOT NECESSARY	60.00	-
2	SET REAR FENDER INNER SHIELD CLIPS @\$30.00(SN)	NOT NECESSARY	60.00	-
2	SET REAR FENDER INNER TRIM BOARD CLIPS @\$30.00 (SN)	NECESSARY	60.00	30.00
1	REAR CAMERA (SN)	NOT NECESSARY	480.00	-
			1,415.00	360.00
	<b><u>LABOUR</u></b>			
	PANEL BEATING REMOVE AND REFFIT PARTS .INCLUSIVE OF THE REPAIR OF REAR SIDE BUMPER AND SPARE TYRE PANEL .		1,600.00	850.00
	SPRAY PAINTING TO AFFECTED AREA .		1,400.00	800.00
	WIRING CHECK.		100.00	30.00
	TO REMOVE REVERSE SENSOR .		100.00	50.00
	TO REMOVE REAR CAMERA.		100.00	50.00
	TO REMOVE VIDEO RECORDER .		100.00	50.00
	TO REMOVE UPHOLSTERY AND REAR SEAT .		380.00	80.00
	TO SPRAY TUFF COAT.		150.00	80.00

Report Ref No. CC6/CTI23001432/Apa3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER TAILGATE FITTINGS.		150.00	80.00
	TO REPLACE TAILGATE GLASS .		180.00	120.00
			4,260.00	2,190.00
<b>GRAND TOTAL</b>			<b>14,266.20</b>	<b>6,504.80</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>5,200.00</b>

Report Ref No. CC6/CTI23001432/Apa3q2

**ADRIAN LING WAI PING**

**B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI**

**Licensed Appraiser**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.**

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SLF 7601X

## INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SLF 7601X

## RE-INSPECTION

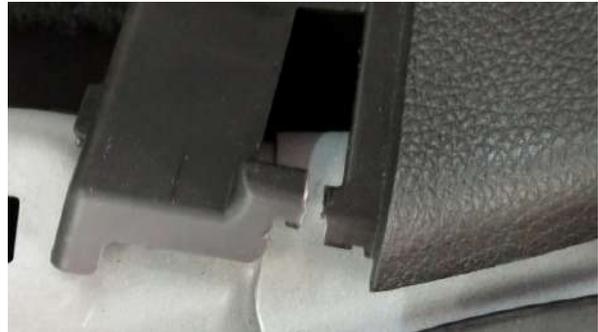



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**PHOTOGRAPHS FOR VEHICLE NO. SLF 7601X**

**RE-INSPECTION**

