

ASS. REC. BY:

REF:

AIG /

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

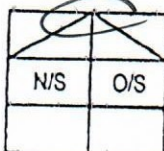

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

03

days

Res.: Yes or No

Lum Sum:

1-B1

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

9/12 8 40/7.52

Veh No:

PKS 9683P Yr Regn: 05, 15

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy AIAIS c.c 1598

Colour

M. Gray

A/C: Insured / Std / NI / NA

Sp. Reading

160711

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

NR053RE11104531858

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rlm / STD / Rlm or

Tyre Size:

F:

205/55R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Nexen

Front

Rear

R/Bal.

7

mm

R/Bal.

7

mm

L/Bal.

7

mm

L/Bal.

7

mm

D.O.A.

20/1/23

D.O.I.

8/2/2023

Survey held at

Des. of Damages: Pnt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation

S - RS - SI

P. R. S.

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

TOTAL

源摩哆廠 GUAN MOTOR WORKS

Business Regn. No: 081026001

176 Sin Ming Drive #02-03 Sin Ming Autocare Singapore 575721 Tel: 6453 6111 Fax: 6453 8292 H/P: 9742 6003

REPAIR ESTIMATE SKS9683P

No.	Qty	List Items	
1	1	Front bumper	\$ Bu 639.80 ✓
2	1	Front bumper RH side retainer	\$ D/I 102.60 ✓
3	1 set	Front bumper clips	\$ M 40.00 ✓
4	1	Front bumper RH fog lamp cover	\$ P 140.20 X
5	1	RH headlamp LED	my \$ 3,614.30 ✓
6	1	Front RH fender	\$ A 1,091.70 X
			\$ 5,628.60
Less 25%			\$ 1,407.15
Total :			\$ 4,221.45

	Labour	
1	Labour Charges for remove/refit, cutting/welding and replacement of damages.	\$ 500.00 300l
2	To putty and spray Spray Paintings charges.	\$ 600.00 400l
3	To check wirings and lighhtings.	\$ 40.00 20l
4	To supply and apply anti rust treatment	\$ 40.00 X
Total :		\$ 1,180.00

Total Parts and Labour : \$ 5,401.45

NOT Authorised
Repairer Again 3 days
84017.52

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: