



# PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Mobile: 9061 0543, Email: [mirage119@gmail.com](mailto:mirage119@gmail.com)

## **ACCIDENT VEHICLE INSPECTION REPORT**

Report no : 60M0223.ZAW

Vehicle no : SKK4175P

### **1 REFERENCE**

Date of inspection : 13 February 2023  
Requested by : Isyrafz Mcqueen  
Blk 495B Tampines Street 43  
#07-392  
Singapore 521495  
Type of survey : Independent  
Repairer : Zoom AutoWerks Pte Ltd  
130 Bedok Reservoir Road, #08-1339, Singapore 470130  
Date of accident : 5 February 2023

### **2 VEHICLE DATA**

Make/model : **VOLKSWAGEN JETTA 1.4 TSI AT 1622G5**  
Chassis no : WVWZZZ16ZDM084060  
Engine no : CAXD42596  
Date of registration : 11 July 2013 *COE Expiry Date:* 29 February 2028  
Engine capacity : 1390 cc  
Colour : Black

### **3 STATIC CONDITION CHECK**

Steering : Affected  
Foot brakes : Serviceable  
Hand brakes : Serviceable  
Paintwork : Good  
General Condition : Good

### **4 TIRE CONDITION CHECK**

	<u>RH/MAKE</u>	<u>LH/MAKE</u>	<u>SIZE</u>
Front tread	: 7 mm/Michelin	7 mm/Michelin	225/40ZR18
Rear tread	: 7 mm/Michelin	7 mm/Michelin	225/40ZR18

### **5 BRIEF DESCRIPTION OF DAMAGE**

Rear bumper dented/buckled/cut, rear bumper reinforcement dented/bent, LH taillamp scraped, rear boot lid bent, rear boot lid LH side reflector lamp scraped, front bumper dislodged/missing, LH & RH front fender dented/buckled/distorted, front LH & RH chassis frames bent/scraped, front suspension parts damaged, front bonnet bent/edge scraped, RH front door edge scraped, etc. Please see para. 8 of this report for more details.

### **6 REMARKS**

This inspection is carried out on a "WITHOUT PREJUDICE" basis and I have not authorized any repairs.

### **7 RECOMMENDATION**

Cost of repairs : **\$16,800.00** (lump sum)  
Estimated no of days : **Fifteen (15)**

## 8 ASSESSMENT OF DAMAGE AND COSTS

Report no: 60M0223.ZAW  
Vehicle no: SKK4175P

### A SPARE PARTS

SPARE PARTS			Assessed	Repairer's	Revised
Description	Qty	Condition	Amount	Amount	Amount
Rear bumper	1	dented/buckled/cut	2,780.00		2,780.00
Rear bumper side reflector lamp LH	1	to reuse	198.00		0.00
Rear bumper side retainer LH/RH	2	necessary	196.00		196.00
Rear bumper retaining clip	10	necessary	108.00		108.00
Rear bumper reinforcement	1	dented/bent	680.00		680.00
Rear lamp assy LH	1	scraped	870.00		870.00
Rear boot lid	1	to repair	3,200.00		0.00
Rear boot lid Volkswagen logo	1	necessary	190.00		190.00
Rear boot lid side reflector lamp assy LH	1	scraped	360.00		360.00
Front bumper	1	dislodged/missing	2,970.00		2,970.00
Front bumper centre sponge	1	cracked	205.00		205.00
Front bumper side sponge LH/RH	2	cracked/squashed	196.00		196.00
Front bumper side retainer LH/RH	2	broken	160.00		160.00
Front bumper retaining clip	10	missing	120.00		120.00
Front wiper washer tank assy	1	squashed	170.00		170.00
Front number plate moulding	1	dislodged/missing	78.00		78.00
Front bumper centre grille	1	dislodged/missing	210.00		210.00
Front bumper side vent grille	2	dislodged/missing	340.00		340.00
Radiator grille	1	logo support tabs broken	970.00		970.00
Radiator grille Volkswagen logo	1	dislodged/missing	180.00		180.00
Front bonnet	1	to repair	2,770.00		0.00
LH front fender	1	buckled/distorted	680.00		680.00
LH front fender splash shield	1	squashed/distorted/torn	290.00		290.00
LH front fender splash shield clip	8	necessary	96.00		96.00
RH front fender	1	dented/buckled/distorted	680.00		680.00
RH front fender splash shield	1	dislodged/missing	290.00		290.00
RH front fender splash shield clip	8	missing	96.00		96.00
RH/LH front fender front support panel	2	bent/distorted	90.00		90.00
LH headlamp assy	1	leg broken	1,990.00		1,990.00
RH headlamp assy	1	broken/casing cracked	1,990.00		1,990.00
RH front door assy	1	to repair	1,385.00		0.00
RH front suspension lower arm	1	bent	582.00		582.00
LH front suspension lower arm	1	bent	582.00		582.00
RH stabiliser bar link	1	bent	46.00		46.00
Subtotal of the above			25,748.00		18,195.00
Discount			10% / 10%	2,574.80	1,819.50
(Special Nett Item)			Subtotal 1:	23,173.20	16,375.50
Rear bumper diffuser	1	broken	1,150.00		1,150.00
LH front sport rim	1	dented/scraped	950.00		950.00
RH front sport rim	1	edge dented/bent	950.00		950.00
Front number plate c/frame set	1	dislodged/missing	70.00		70.00
Subtotal 2:			3,120.00		3,120.00
Total cost of parts:			23,173.20		16,375.50

### B LABOUR

To check wiring.	60.00	45.00
To apply anti-rust undercoat.	150.00	90.00

Report no: 60M0223.ZAW  
Vehicle no: SKK4175P

To align headlamp and refocus headlamp beams.	90.00	60.00
Labour charges to remove and replace, to cut and weld, to panel beating affected and damaged parts. To jack, straighten and align both the affected front chassis frames.	2,500.00	2,000.00
Spray painting charges to paint the affected areas – front bonnet, front RH door, front bumper, front LH fender, front RH fender, rear bumper, rear boot lid, etc.	2,000.00	1,750.00
To remove and replace the damaged LH & RH front suspension parts.	500.00	400.00
To realign wheels by 4-wheel computerised alignment.	90.00	90.00
Towing fee.	120.00	120.00
Total cost of labour:	5,510.00	4,555.00
Total cost of repair:	28,683.20	20,930.50

## 9 CONCLUSION

The revised or adjusted cost of repairs to restore the vehicle is \$20,930.50


- (a) The recommended cost of repair based on lump sum repairs would be **\$16,800.00**
- (b) The estimated number of days for the repairs would be **Fifteen (15)**  
(1<sup>st</sup> Re-inspection conducted on 17 February 2023)  
(2<sup>nd</sup> Inspection conducted on 22 February 2023)  
(Post-Repair inspection conducted on 28 February 2023)

*The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.*

### Note: Lump Sum Repair Basis

*This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.*

Prepared by:

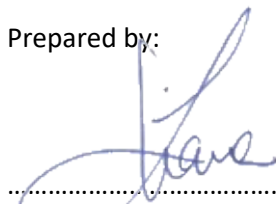  
.....  
Liaw Leong San

Licensed Automotive Appraiser

Dated: 11 April 2023



# PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Mobile: 9061 0543, Email: mirage1195@gmail.com

Isyrafz Mcqueen  
Blk 495B Tampines Street 43  
#07-392  
Singapore 521495

Invoice no:	POS060/23
Date:	11 April 2023
Report no:	60M0223.ZAW
Vehicle :	SKK4175P

## INVOICE

No	Item Description	Qty	Unit Price	Total Amount(\$)
01	Being charges for the inspection of the accident vehicle, transport and photographs.			1,207.00
SGD(\$): One Thousand Two Hundred and Seven only			<b>Payable Amount:</b>	<b>1,207.00</b>

"Cheque should be crossed and made payable to "Pro-Option Services"

PRO-OPTION SERVICES

.....  
Authorised Signature



Report no: 60M0223.ZAW

Vehicle no: SKK4175P





Report no: 60M0223.ZAW

Vehicle no: SKK4175P



Report no: 60M0223.ZAW

Vehicle no: SKK4175P





Report no: 60M0223.ZAW

Vehicle no: SKK4175P



Report no: 60M0223.ZAW

Vehicle no: SKK4175P



Report no: 60M0223.ZAW

Vehicle no: SKK4175P



Report no: 60M0223.ZAW

Vehicle no: SKK4175P




Report no: 60M0223.ZAW

Vehicle no: SKK4175P



Report no: 60M0223.ZAW

Vehicle no: SKK4175P

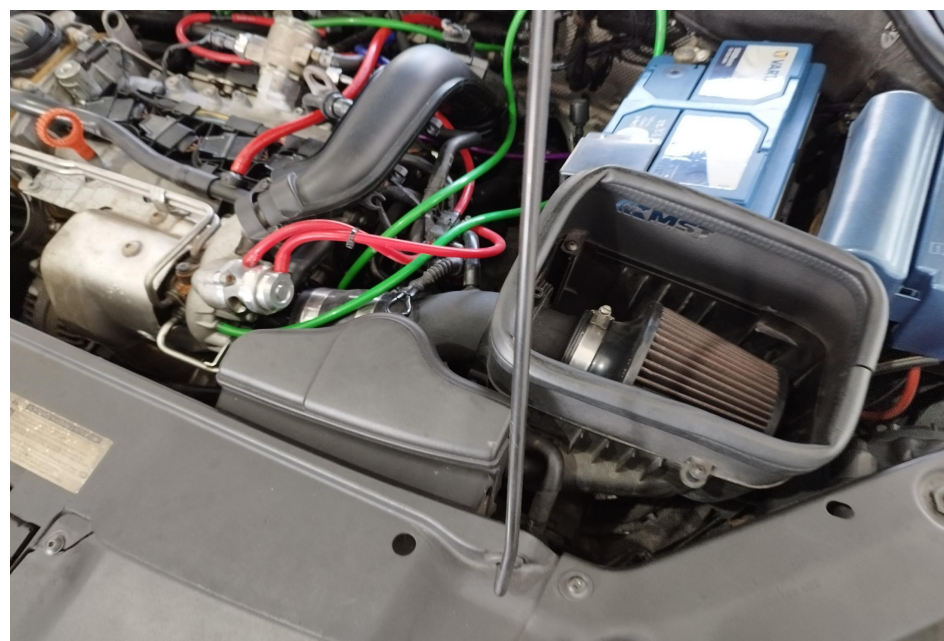



Report no: 60M0223.ZAW

Vehicle no: SKK4175P







Report no: 60M0223.ZAW

Vehicle no: SKK4175P





Report no: 60M0223.ZAW

Vehicle no: SKK4175P



Report no: 60M0223.ZAW

Vehicle no: SKK4175P









Report no: 60M0223.ZAW

Vehicle no: SKK4175P












Report no: 60M0223.ZAW

Vehicle no: SKK4175P

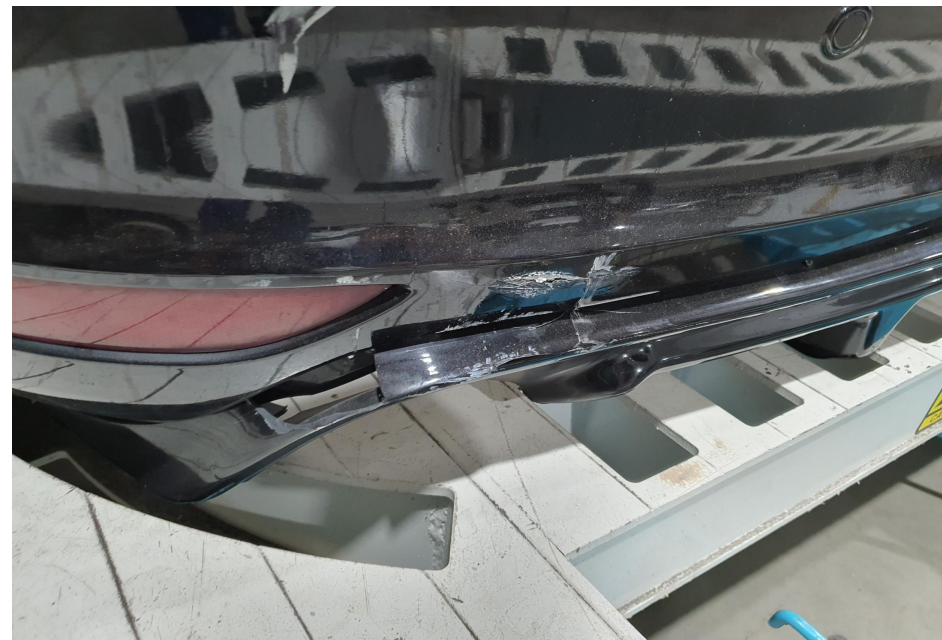

Report no: 60M0223.ZAW

Vehicle no: SKK4175P



**POST REPAIR**

Report no: 60M0223.ZAW

Vehicle no: SKK4175P



**POST REPAIR**

Report no: 60M0223.ZAW

Vehicle no: SKK4175P



**POST REPAIR**

Report no: 60M0223.ZAW

Vehicle no: SKK4175P

