

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/CTI21011210/T1UY3N2
Date: 10/11/2021

REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMPCSNW00123152103

Claimant Vehicle No : FBK401U Insured Vehicle No : SLK8793S

Date of Loss: 30/09/2021 Nature of Claim: TP Claim No: SNM21D205594/C2/IRENE

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **FBK401U**

Make & Model: HONDA CB400X, 399cc Engine No: NC47E5000166

Reg. Date: 10/02/2015 (Man. Year: 2014) Chassis No: JH2NC4791EK000164

Colour: White Odometer: 0 km

Engine Capacity: 399 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 120/70R17 Rear Tyre Size: 160/60R17

Front Left Side: Pirelli 5 mm Rear Left Side: Pirelli 5 mm

Front Right Side: 0 mm Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 02/11/2021

Date Inspected: 03/11/2021 Inspected At: H L Cycle Pte Ltd (HQ)
1 Kaki Bukit Avenue 6, #02-58 Autobay
Singapore 417883

Estimated Period of Repair: 7.0 days

Adjuster: MOHD TAUFIKH BIN HAMID

Manager: Tan Hui Zhen

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

A)THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000.00 -\$5,000.00

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 08 Nov 2021)	
Parts:	N/A	HONDA CB400X 399cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	LKK Auto Consultants Pte Ltd/FBK401U/10/11/2021 09:59	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

LKK Auto Consultants Pte Ltd/FBK401U/10/11/2021 09:59. Not valid without Reference section.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

LKK Auto Consultants Pte Ltd/FBK401U/10/11/2021 09:59. Not valid without Reference section.
--

< END OF ESTIMATES >