

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/AIG23001864/KWY3E2**Date:** 01/03/2023REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.

Policy No:

Claimant Vehicle No : SKH6013B**Insured Vehicle No :** SKX3366T

Date of Loss: 21/01/2023

Nature of Claim: TP

Claim No: 5845305067SG

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SKH6013B**

Make & Model: VOLKSWAGEN TOURAN, 1.4 TSI 1T32B4 (A)

Engine No: CAV253568

Reg. Date: 20/01/2011 (Man. Year: 2010)

Chassis No: WVGZZZ1TZW045078

Colour: Metallic Grey

Odometer: 221179 km

Engine Capacity: 1390 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R16

Rear Tyre Size: 205/55 R16

Front Left Side: Tourador 8 mm

Rear Left Side: Tourador 8 mm

Front Right Side: Tourador 8 mm

Rear Right Side: Tourador 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 20/02/2023

Date Inspected: 23/02/2023 Inspected At:

Tropical Tech Automobile Services (HQ)
BLK 5032 ANG MO KIO AVENUE 3, #01-303
INDUSTRIAL PARK 2
Singapore 569535

Estimated Period of Repair: 4.0 days

Adjuster: KENNETH KONG**Manager:** XinYu*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

MARKET VALUE: \$32,000.00 (EST)

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT FENDER LH	Buckled	0.00 F	*- F
2	1		*FRT DOOR MIRROR LH	Cracked	0.00 F	*- F
3	1		*FRT BUMPER	Repair	0.00 F	*- F
4	1		*FRT DOOR	Repair	0.00 F	*- F
5	1		*FRT DOOR OUTER HANDLE KNOB	Missing	0.00 F	*- F
F=Franchise part.						
Total Parts (S\$)					0.00	0.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >