

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS3/AIS23001934/UVY3M4**Date:** 17/03/2023**REFERENCE**

Handling Insurer:	Allianz Insurance Singapore Pte. Ltd.	Policy No:	SP2002847623-01
<b>Claimant Vehicle No :</b>	GBD6589J	<b>Insured Vehicle No :</b>	SNK5973K
Date of Loss:	18/02/2023	Nature of Claim:	TP
		Claim No:	SNK5973K

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No:	<b>GBD6589J</b>	Engine No:	1KD2439483
Make & Model:	TOYOTA DYNA, 3.0 D (M)	Chassis No:	KDY2318017003
Reg. Date:	06/03/2015 (Man. Year: 2014)	Odometer:	251548 km
Colour:	Silver		
Engine Capacity:	2982 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

**CONDITION OF TYRES**

Front Tyre Size:	195 R15	Rear Tyre Size:	155 R13 (D)
Front Left Side:	Royal 7 mm	Rear Left Side:	RIVO 6/6 mm
Front Right Side:	Royal 7 mm	Rear Right Side:	RIVO 6/6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	
<b>Global Sum Settlement (S\$)</b>		<b>0.00</b>		

**INSPECTION**

Date of Assignment:	21/02/2023		
Date Inspected:	21/02/2023	Inspected At:	Fastech Auto Pte Ltd (HQ) 1 Kaki Bukit Ave 6, #01-46/48/50 Autobay Singapore 417883
Estimated Period of Repair:	7.0 days		

**Adjuster:** MARCUS CHUA**Manager:** VERON CHEN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$8,000.00  
-\$9,000.00

## REPAIR DETAILS

### Reference

**Part Source:** (Last Synchronised: 17 Mar 2023)

**Parts:** N/A TOYOTA DYNA 3.0 D (M) (Model not available in database)

**Labour:** Repairer's (Price-denominated Standard List)

**Print Code:** (Unsubmitted, no print-code for GBD6589J)

**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk \*.

### Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >