

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/AIS23002175/TQY3E2**Date:** 23/03/2023REFERENCE

Handling Insurer: Allianz Insurance Singapore Pte. Ltd.

Policy No:

Claimant Vehicle No : FBN5597P**Insured Vehicle No :** GBL8137A

Date of Loss: 25/02/2023

Nature of Claim: TP

Claim No: 2023 32005784

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **FBN5597P**

Make & Model: HONDA CB150R, 149cc

Engine No: KC32E0024438

Reg. Date: 25/10/2018 (Man. Year: 2018)

Chassis No: MLHKC2886J5024438

Colour: Blue

Odometer: 0 km

Engine Capacity: 149 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 110/70 R17

Rear Tyre Size: 150/60 R17

Front Left Side: Bridgestone 5 mm

Rear Left Side: Bridgestone 5 mm

Front Right Side: 0 mm

Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	
Global Sum Settlement (S\$)		0.00		

INSPECTION

Date of Assignment: 28/02/2023

Date Inspected: 01/03/2023 Inspected At:

Brother Motors (HQ)
BLK 1016 YISHUN INDUSTRIAL PARK A, #01-218
Singapore 768758

Estimated Period of Repair: 3.0 days

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.

THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$2,500.00
-\$3,500.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 23 Mar 2023)	
Parts:	N/A	HONDA CB150R 149cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBN5597P)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >