

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIS23002313/UYA3Q2**Date:** 18/05/2023REFERENCE

Handling Insurer:	Allianz Insurance Singapore Pte. Ltd.	Policy No:	SP2002381055-01
Claimant Vehicle No :	SLR7986Y	Insured Vehicle No :	SJP6115K
Date of Loss:	28/02/2023	Nature of Claim:	TP
		Claim No:	N/A

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLR7986Y		
Make & Model:	BMW 216D, 1.5 D Active Tourer (F45) D/AB LED (A)	Engine No:	37845028B37C15A
Reg. Date:	29/08/2017 (Man. Year: 2017)	Chassis No:	WBA2B32030V926040
Colour:	White	Odometer:	121092 km
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	Yokohama 7 mm	Rear Left Side:	Yokohama 7 mm
Front Right Side:	Yokohama 7 mm	Rear Right Side:	Yokohama 7 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	750.00	280.00	470.00	62.67
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	750.00	280.00	470.00	62.67
+ GST 8.00/8.00% (S\$)	60.00	22.40	37.60	62.67
Nett Amount (S\$)	810.00	302.40	507.60	62.67
+ Loss of Use (1.0 x S\$100.00/day) (S\$)		100.00		
Nett Liability (S\$)		402.40		

INSPECTION

Date of Assignment:	02/03/2023		
Date Inspected:	22/03/2023	Inspected At:	Jin Auto Services Pte Ltd (Defu) Blk 14 Defu Lane 10, #01-410/412 Singapore 539195
Estimated Period of Repair:	1.0 days		

Adjuster: MARCUS CHUA**Manager:** Ezlyna*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 18 May 2023)
Parts:	M1-MPV	BMW 216D 1.5 D Active Tourer (F45) D/AB LED (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLR7986Y)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER (NPA)	Repair	0.00 FL	*- FL
2	2		*REAR BUMPER REVERSE SENSOR (NPA)	Not Necessary	0.00 FL	*- FL
3	1		*REAR BUMPER REINFORCEMENT (NPA)	Not Necessary	0.00 FL	*- FL
						F=Franchise part. L=ListItemDisc.
					Sub Total (S\$)	0.00 0.00
					- List Item Discount on L Items 10.00/10.00% (S\$)	0.00 0.00
					Total Parts (S\$)	0.00 0.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	SPRAY PAINTING (PEARL WHITE) }	New	250.00	280.00
2	LABOUR CHARGE }	New	450.00	0.00
3	WIRING	New	50.00	0.00
Gross Labour Cost (S\$)			750.00	280.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >