



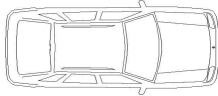
LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

| PRE-REPAIR INSPECTION REPORT | | | | |
|--|--|--|--|---|
| HSBC LIFE (SINGAPORE) PTE LTD 10 MARINA BOULEVARD #48-01 MARINA BAY FINANCIAL CENTRE TOWER 2SINGAPORE 018983 ATTN: TEO KITTY | | | Ref: CS3/HSB23002316/Tqp3e2 Date: 10/03/2023 Code: HSB | |
| 1. Policy Particulars :- (THIRD PARTY CLAIM) | | | | |
| | Insured Veh. | SHC 2312B | Veh. Inspected | SLE 4206D |
| | Policy No. | VFX/P2419138 | Coverage (\$) | 0.00 |
| | Claim No. | S3M04JZN | Excess (\$) | 0.00 |
| | Assign From | TEO KITTY | Assign Date | 03/03/2023 |
| 2. Vehicle Particulars & Condition | | | | |
| | Make & Model | TOYOTA WISH | c.c | 1794 |
| | Engine No. | HIDDEN | Year of Reg. | 2009 |
| | Chassis No. | JTDER12W603003180 | Colour | SILVER |
| | Odometer | - | Steering | IN ORDER |
| | Brakes | IN ORDER | Modification | SPORTS RIM |
| | General | GOOD | | |
| 3. Conditions of Tyres | | | | |
| | | Size | Make | Balance |
| | R/H Front Tyre | 195/65 R15 | FALKEN | 6 mm |
| | L/H Front Tyre | 195/65 R15 | FALKEN | 6 mm |
| | R/H Rear Tyre | 195/65 R15 | FALKEN | 6 mm |
| | L/H Rear Tyre | 195/65 R15 | FALKEN | 6 mm |
| 4. Description of Damages | | | | |
| | THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION AND UNDERCARRIAGE. | | |  |
| 5. General Information | | | | |
| | Accident Date | 28/02/2023 | Inspect Date / Time | 03/03/2023 (04:00 PM) |
| | Survey held at | A AUTO SERVICES 5 SOON LEE STREET #06-31 PIONEER POINT SINGAPORE 627607 | | |
| 5a. Remarks | | | | |
| | A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$7,000-\$9,000 | | | |
| 5b. Estimate Days of Repair | | | | |
| | ESTIMATED NORMAL PERIOD FOR REPAIR: | | 10 Working Days | |

Report Ref No. CS3/HSB23002316/Tqp3e2

Inspected By



MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor



K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE, MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.
No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.