

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG23002460/UYA3Q2**Date:** 18/07/2023REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	7220122529
Claimant Vehicle No :	SGX846S	Insured Vehicle No :	SNJ8018D
Date of Loss:	07/03/2023	Nature of Claim:	TP
		Claim No:	3608927872SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SGX846S	Engine No:	2NR8609856
Make & Model:	TOYOTA SIENTA, 1.5 G (A)	Chassis No:	NSP1707030093
Reg. Date:	31/08/2016 (Man. Year: 2016)	Odometer:	98061 km
Colour:	Brown		
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/55 R16	Rear Tyre Size:	195/55 R16
Front Left Side:	Falken 6 mm	Rear Left Side:	Falken 6 mm
Front Right Side:	Falken 6 mm	Rear Right Side:	Falken 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	21,860.60	6,596.17	15,264.43	69.83
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,650.00	1,450.00	2,200.00	60.27
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	25,510.60	8,046.17	17,464.43	68.46
Approved Total (Overridden) (S\$)		6,400.00		
(S\$)	25,510.60	6,400.00	19,110.60	74.91
+ GST 8.00/8.00% (S\$)	2,040.85	512.00	1,528.85	74.91
Nett Amount (S\$)	27,551.45	6,912.00	20,639.45	74.91
+ Car Rental (4.0 x S\$100.00/day) (S\$)		400.00		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		7,314.00		
Global Sum Settlement (S\$)		7,300.00		

INSPECTION

Date of Assignment:	08/03/2023		Fastech Auto Pte Ltd (HQ)
Date Inspected:	08/03/2023	Inspected At:	1 Kaki Bukit Ave 6, #01-46/48/50 Autobay
Estimated Period of Repair:	4.0 days		Singapore 417883

Adjuster: MARCUS CHUA**Manager:** Ezlyna

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed / Torn	1,150.10 F	*581.10 FL
2	1		*FRONT BUMPER RETAINER N/S	Cracked	85.10 F	*85.10 FL
3	1		*SET FRONT BUMPER CLIPS	Necessary	40.00 F	*40.00 FL
4	1		*FRONT BUMPER REINFORCEMENT	Repair	450.10 F	*- FL
5	1		*FRONT BUMPER SPONGE	Torn	165.80 F	*142.80 FL
6	1		*FRONT BUMPER REINFORCEMENT	Not Necessary	345.60 F	*- FL
7	1		*FRONT BUMPER FOG LAMP N/S	Cracked	485.20 F	*335.60 FL
8	1		*FRONT BUMPER FOG LAMP BLACK GARNISH N/S	Grazed	245.20 F	*182.30 FL
9	1		*HEADLAMP N/S	Cracked	4,550.10 F	*3,450.00 FL
10	1		*FRONT DOOR N/S	Repair	1,355.10 F	*- FL
11	1		*SET FRONT DOOR FRAME BLACK STICKER N/S	Not Necessary	85.00 F	*- FL
12	1		*FRONT DOOR GLASS OUTER CHROME N/S	Not Necessary	168.10 F	*- FL
13	1		*FRONT DOOR GLASS REGULATOR N/S	Not Necessary	355.00 F	*- FL
14	1		*FRONT DOOR GLASS REGULATOR MOTOR N/S	Not Necessary	650.00 F	*- FL
15	1		*FRONT DOOR INNER LOCK N/S	Not Necessary	392.20 F	*- FL
16	1		*FRONT DOOR INNER TRIM BOARD N/S	Not Necessary	950.10 F	*- FL
17	1		*FRONT DOOR INNER RUBBER N/S	Not Necessary	195.10 F	*- FL
18	2		*FRONT DOOR HINGES N/S	Not Necessary	160.00 F	*- FL
19	1		*FRONT DOOR CHECKER N/S	Not Necessary	121.00 F	*- FL
20	1		*FRONT DOOR OUTER PROTECTOR N/S	Not Necessary	255.30 F	*- FL
21	1		*FRONT DOOR GLASS N/S	Not Necessary	520.10 F	*- FL
22	1		*FRONT DOOR MIRROR ASSY N/S	Not Necessary	980.10 F	*- FL
23	1		*FRONT FENDER N/S	Bent / Warped	655.10 F	*655.10 FL
24	1		*FRONT FENDER VVTI EMBLEM N/S	Not fitted	85.00 F	*- FL
25	1		*FRONT FENDER INNER SHIELD N/S	Torn	198.10 F	*198.10 FL
26	1		*FRONT FENDER INNER SHIELD CLIPS N/S	Necessary	50.00 F	*50.00 FL
27	1		*FRONT SHOCK ABSORBER N/S	Serviceable	725.20 F	*- FL
28	1		*FRONT LOWER ARM N/S	Bent	755.60 F	*755.60 FL
29	1		*FRONT KNUCKLE ARM N/S	Bent	554.20 F	*554.20 FL
30	1		*FRONT KNUCKLE ARM BEARING N/S	Necessary	368.00 F	*165.00 FL
31	1		*FRONT DRIVE SHAFT N/S	Not Necessary	1,415.10 F	*- FL
32	1		*FRONT SPORT RIM N/S	Repair	850.00 FS	*- FS
33	1		*SET FRONT BUMPER LOWER SKIRTING	Cracked	1,500.00 FS	*800.00 FS
34	1		*SET FRONT STICKER	Necessary	1,000.00 FS	*400.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	21,860.60	8,394.90
- List Item Discount on L Items 0.00/25.00% (\$)	0.00	1,798.73
Total Parts (\$)	21,860.60	6,596.17

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING	New	50.00	20.00
2	TO SPRAY RUST PROOFING	New	80.00	30.00
3	TO REFILL AIR CON GAS	New	120.00	0.00
4	TO DISMANTLE & REPLACED FRONT UNDER CARRIAGE	New	250.00	120.00
5	TO TRANSFER BOTH N/S DOOR MECHANISM	New	150.00	0.00
6	TO CONDUCT WHEEL ALIGNMENT	New	120.00	80.00
7	LABOUR FOR PANEL BEATING & REPLACED PARTS	New	1,200.00	500.00
8	TO PUTTY & SPRAY PAINTING	New	1,680.00	700.00
Gross Labour Cost (S\$)			3,650.00	1,450.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >