

Motor Appraiser and Insurance Loss Adjustor Blk 361 Yung An Road #12-105 Singapore 610361 Mobile: +65 9232 0012 Email: iconappraiser@gmail.com UEN.: 202006885Z

#### INSPECTION REPORT

To : SLEHRIA SUKRITI

Our ref.

: 20221021/00181/CCE

Date

: 21 Oct 2022

#### REFERENCE

Assign by

: SLEHRIA SUKRITI

3rd party Veh.

: **GBJ372A** 

Inspection on

: 21 Sep 2022

Accident on

: 19 Sep 2022

Workshop name

: Cheng Chuan Enterprise Pte Ltd

Inspection at

: 2 Kaki Bukit Avenue 2 #02-20/26/30/31

Kaki Bukit Autohub Singapore 417921

#### PARTICULARS OF DAMAGED VEHICLE

Registration no.

: SLK5356R

Odometer

: 105538 km

Make / Model

: RENAULT KADJAR 1.5 DCI

Chassis no.

: VF1RFE00X54931364

wheel

Regn. date

: 2016

Engine no.

: K9KF647D026067

Body colour

: Brown

Engine cap.

: 1461 cc

#### PRE-ACCIDENT CONDITION OF VEHICLE (STATIC CHECK ONLY)

Steering

: In order

Paintwork

: Fair

Footbrake

: In order

Undercarriage

: Serviceable

Handbrake

: In order

Gen. condition

: Fair

#### TYRE CONDITION ON VEHICLE

		Make	Size	Tread depth	Type of road
Front N/S	:	Yokohama	225/45R19	70%	Alloy
Front O/S	:	Yokohama	225/45R19	70%	Alloy
Rear N/S	:	Yokohama	225/45R19	70%	Alloy
Rear O/S	:	Yokohama	225/45R19	70%	Alloy

 
NOTE: Tread depth percentages represents the visually estimated remaining life of tyre treads.

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

20221021/00181/CCE Page 1 of 2

#### POINT OF IMPACT

The damages was found on the rear left portion.



#### RECOMMENDATION

The estimated cost of repair submitted by the repairer <u>Cheng Chuan Enterprise Pte Ltd</u> as per schedule attached has been revised and scrutinised, and in our opinion, we consider it to be fair and reasonable. The repairer have agreed to undertake the repairs at our recommendation.

Our adjusted cost of repair is SGD 9,900.00 to carry out the repairs. Kindly refer to parts and labour portion for a detailed account of the cost estimates.

#### REMARKS

However, for your information, under normal circumstances, the repair normally would take approximately 6 (Six) working days to complete.

We have **NOT AUTHORISED** the repair to the damaged vehicle. The survey was conducted strictly on a "WITHOUT PREJUDICE" basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our final report, which includes material damages photographs.

Yours faithfully, ICON Motor Appraiser Pte Ltd

Patrick Ng

Motor Vehicle Appraiser

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

S/N	N Parts description QTY		Condition	Repairer's Estimate		Our Recommendation	
1	Tailgate	1	Damaged	\$	1,680.00	\$	1,680.00
2	Tailgate inner lock	1	Jammed	\$	336.00	\$	336.00
3	Tailgate inner lock striker	1	Re-use				
4	Tailgate hinge	2	Re-use			_	
5	Tailgate absorber	2	Re-use				
6	Tailgate inner trim	1	Damaged	\$	475.00	\$	475.00
7	Tailgate 'RENAULT' logo	1	Necessary	\$	96.00	\$	96.00
8	Tailgate 'RENAULT' emblem	1	Necessary	\$	89.00	\$	89.00
9	Tailgate 'KADJAR' emblem	1	Necessary	\$	108.00	\$	108.00
10	Rear windscreen moulding	1	Necessary	\$	135.00	\$	135.00
11	Rear weatherstrip	1	Deformed	\$	289.00	\$	289.00
12	Rear bumper upper	1	Damaged	\$	1,193.00	\$	1,193.00
13	Rear bumper lower	1	Damaged	\$	752.00	\$	752.00
14	Rear bumper lower cowling	1	Re-use	-		-	
15	End panel	1	Damaged	\$	986.00	\$	986.00
16	End panel top garnish	1	Damaged	\$	266.00	\$	266.00
17	Taillamp n/s	1	Damaged	\$	685.00	\$	685.00
18	Taillamp panel n/s	1	Repair	-			N. P. STOP
19	Rear fender n/s	1	Repair				
20	Rear bumper reinforcement	1	Damaged	\$	552.00	\$	552.00
21	Rear bumper reinforcement bracket	2	Distorted	\$	286.00	\$	286.00
22	Rear bumper foglamp n/s	1	Damaged	\$	337.00	\$	337.00
23	Rear bumper center support holder	2	Damaged	\$	88.00	\$	88.00
24	Tailgate lamp n/s	1	Damaged	\$	498.00	\$	498.00
25	Rear bumper sensor wire harness	1	Cut	\$	395.00	\$	395.00
26	Rear bumper side retainer	2	Damaged	\$	148.00	\$	148.00
27	Rear bumper top bracket	2	Bent	\$	96.00	\$	96.0
28	Rear licence plate lamp n/s	1	Cracked	\$	129.00	\$	129.00
29	Rear licence plate lamp holder	1	Cracked	\$	85.00	\$	85.00
		*	Subtotal	\$	9,704.00	\$	9,704.00
		10.00%	\$	-	\$	970.40	
		•	Total	\$	9,704.00	\$	8,733.60

Special nett items									
No.	Parts description	QTY	Condition	Repairer's Estimate		Our Recommendation			
1	Tailgate inner trim clips	8	Necessary	\$	60.00	\$	40.00		
2	Rear windscreen sealant	1	Necessary	\$	100.00	\$	60.00		

			Total	\$ 1,445.00	\$ 1,135.00
10	Sundries	1	Necessary	\$ 60.00	\$ 50.00
9	Rear licence plate & frame	1	Damaged	\$ 65.00	\$ 55.00
8	Reverse camera	1	Malfunction	\$ 450.00	\$ 350.00
7	Reverse sensor	2	Damaged	\$ 480.00	\$ 400.00
6	End panel top garnish clips	6	Necessary	\$ 50.00	\$ 40.00
5	End panel sealant	1	Necessary	\$ 100.00	\$ 80.00
4	Rear bumper clips	12	Necessary	\$ 80.00	\$ 60.00
3	Rear fender inner trim clips	12	Not necessary		

Labo	our					
No.	Description	QTY	Repairer's Estimate		Our Recommendation	
1	To dismantle / renew accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	1	\$	1,400.00	\$	1,200.00
2	To disconnect rear wire harness of electrical components to facilitate repairs, reconnect and check functions including taillamp lightings.	1	\$	80.00	\$	60.00
3	To remove, refit tailgate components to replace tailgate, check and re-adjust close gap, alignment and water seepage.	1	\$	100.00	\$	80.00
4	To rust proof all affected portions after repair.	1	\$	100.00	\$	50.00
5	To remove and refit rear windscreen to facilitate repair work.	1	\$	150.00	\$	120.00
6	Supply spray paint material and necessary items to respray affected area / panel.	1	\$	1,200.00	\$	1,000.00
		Total labour	\$	3,030.00	\$	2,510.00

<b>Estimate Grand Total</b>	\$	14,179.00	\$	12,378.60
	100	The second little second littl	Annual Property lies	


Our Ref:

20221021/00181/CCE

Your Ref:





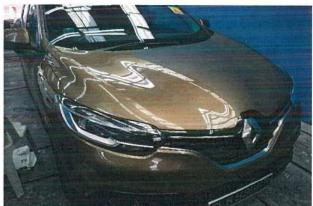







Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

Our Ref:

20221021/00181/CCE

Your Ref:













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

Our Ref:

20221021/00181/CCE

Your Ref:













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

Our Ref:

20221021/00181/CCE

Your Ref:













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

Our Ref:

20221021/00181/CCE

Your Ref:













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.


Our Ref: 20221021/00181/CCE

Your Ref: GBJ372A







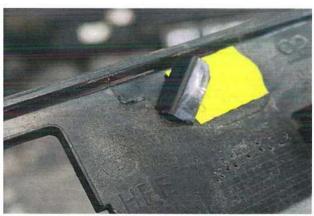






Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

Our Ref:

20221021/00181/CCE

Your Ref:

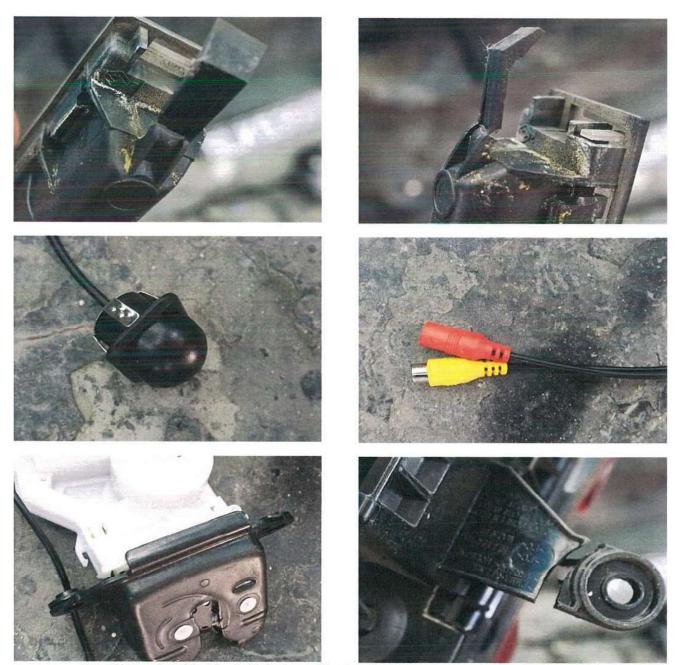

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

Our Ref:

20221021/00181/CCE

Your Ref:













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

Our Ref:


20221021/00181/CCE

Your Ref:







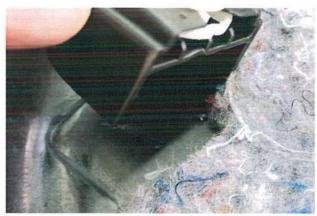





Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

Our Ref: 20221021/00181/CCE

Your Ref: GBJ372A













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

Our Ref:

20221021/00181/CCE

Your Ref:













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

Our Ref: 20221021/00181/CCE

Your Ref: GBJ372A





