

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Allianz Insurance Singapore Pte. Ltd.
79 Robinson Road #09-01 (Claims & Performance Management)
Singapore 068897

Our File No: CS/AIS23002528/KQY3M4**Date:** 02/08/2023**REFERENCE**

Insured/Claimant:	J AUTO LEASING PTE LTD	Policy No:	SP2003972742	
Date of Loss:	25/02/2023	Nature of Claim:	OD	Claim No: 202332006019

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMS3706Z		
Make & Model:	HONDA FIT, 1.3 GF CVT (A)	Engine No:	L13B1461641
Reg. Date:	24/02/2020 (Man. Year: 2019)	Chassis No:	GK31351532
Colour:	Metallic Dark Blue	Odometer:	0 km
Engine Capacity:	1317 cc		
Market Value/New Car Price:	S\$79,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	175/70R14	Rear Tyre Size:	175/70R14
Front Left Side:	Bridgestone 4 mm	Rear Left Side:	West Lake 8 mm
Front Right Side:	Bridgestone 4 mm	Rear Right Side:	West Lake 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	61,941.00	48,622.00	13,319.00	21.50
Miscellaneous Items	1,085.00	155.00	930.00	85.71
Labour	7,210.00	6,310.00	900.00	12.48
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	70,236.00	55,087.00	15,149.00	21.57
- Excess (S\$)	0.00	2,000.00	-2,000.00	
(S\$)	70,236.00	53,087.00	17,149.00	24.42
+ GST 8.00/8.00% (S\$)	5,618.88	4,246.96	1,371.92	24.42
Nett Amount (S\$)	75,854.88	57,333.96	18,520.92	24.42

INSPECTION

Date of Assignment:	09/03/2023	Present Location:	Ding Auto Pte Ltd (HQ)
Date Inspected:	10/03/2023	Inspected At:	Ding Auto Pte Ltd (HQ) 176 Sin Ming Drive #04-06, Sin Ming Autocare Singapore 575721
Estimated Period of Repair:	28.0 days		

Adjuster: KENNETH KONG**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

(REPAIR COST NOT CONCLUDE)

(EXCLUDE CHECK ITEMS S\$12,315.00 NETT)

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 02 Aug 2023)
Parts:	143	HONDA FIT 1.3 GF CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMS3706Z)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER (WCP)	Missing	560.00 F	*560.00 F
2	1		*FRONT BUMPER RETAINER RH (WCP)	Cracked	20.00 F	*20.00 F
3	1		*FRONT BUMPER RETAINER LH (WCP)	Cracked	20.00 F	*20.00 F
4	1		*FRONT BUMPER SUPPORT (WCP)	Missing	225.00 F	*225.00 F
5	1		*FRONT BUMPER SIDE COVER RH (WCP)	Missing	35.00 F	*35.00 F
6	1		*FRONT BUMPER SIDE COVER LH (WCP)	Missing	35.00 F	*35.00 F
7	1		*FRONT BUMPER LOWER GARNISH (WCP)	Missing	185.00 F	*185.00 F
8	1		*BONNET (WCP)	Bent	320.00 F	*320.00 F
9	1		*BONNET HINGE RH (WCP)	Bent	30.00 F	*30.00 F
10	1		*BONNET HINGE LH (WCP)	Bent	30.00 F	*30.00 F
11	1		*BONNET LOCK (WCP)	Bent	100.00 F	*100.00 F
12	1		*BONNET INSULATOR (WCP)	Torn	110.00 F	*110.00 F
13	1		*BONNET STAND (WCP)	Missing	35.00 F	*35.00 F
14	1		*BONNET STAND HOOK (WCP)	Missing	15.00 F	*15.00 F
15	1		*BONNET FRONT SEAL (WCP)	Torn	40.00 F	*40.00 F
16	1		*BONNET RUBBER STOPPER RH (WCP)	Missing	20.00 F	*20.00 F
17	1		*BONNET RUBBER STOPPER LH (WCP)	Missing	20.00 F	*20.00 F
18	1		*FRONT GRILLE BASE (WCP)	Missing	270.00 F	*270.00 F
19	1		*FRONT GRILLE UPPER CHROME MLDG (WCP)	Missing	155.00 F	*155.00 F
20	1		*FRONT GRILLE CTR LOWER CHROME TRIM (WCP)	Missing	170.00 F	*170.00 F
21	1		*FRONT LOWER GRILLE (WCP)	Missing	145.00 F	*145.00 F
22	1		*FRONT GRILLE CTR BRACKET (WCP)	Missing	25.00 F	*25.00 F
23	1		*FRONT GRILLE BADGE (WCP)	Missing	20.00 F	*20.00 F
24	1		*FRONT SUPPORT PANEL CPL (WCP)	Bent	450.00 F	*450.00 F
25	1		*FRONT SUPPORT PANEL UPPER GARNISH (WCP)	Missing	40.00 F	*40.00 F
26	1		*FRONT FENDER RH (WCP)	Bent	185.00 F	*185.00 F
27	1		*FRONT FENDER LH (WCP)	Bent	185.00 F	*185.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
28	1		*FRONT FENDER INNER COVER RH (WCP)	Torn	75.00 F	*75.00 F
29	1		*FRONT FENDER INNER COVER LH (WCP)	Torn	75.00 F	*75.00 F
30	1		*FRONT FENDER - WHEELHOUSE REINF RH (WCP)	Bent	390.00 F	*390.00 F
31	1		*FRONT FENDER - WHEELHOUSE REINF LH (WCP)	Bent	390.00 F	*390.00 F
32	1		*FRONT SIDE PILLAR LH (WCP)	Bent	680.00 F	*680.00 F
33	1		*WIPER PANEL (WCP)	Repair	205.00 F	*- F
34	1		*WIPER PANEL END GARNISH RH (WCP)	Cracked	30.00 F	*30.00 F
35	1		*WIPER PANEL END GARNISH LH (WCP)	Dented	30.00 F	*30.00 F
36	1		*HEADLAMP ASSY RH (WCP)	Missing	580.00 F	*580.00 F
37	1		*HEADLAMP ASSY LH (WCP)	Missing	580.00 F	*580.00 F
38	1		*HEADLAMP BRACKET RH (WCP)	Missing	35.00 F	*35.00 F
39	1		*HEADLAMP BRACKET LH (WCP)	Missing	35.00 F	*35.00 F
40	1		*FRONT LOWER SIDE GARNISH RH (WCP)	Missing	25.00 F	*25.00 F
41	1		*FRONT LOWER SIDE GARNISH LH (WCP)	Missing	25.00 F	*25.00 F
42	1		*RADIATOR ASSY (WCP)	Broken	1,180.00 F	*1,180.00 F
43	1		*RADIATOR AIR GUIDE RH (WCP)	Missing	30.00 F	*30.00 F
44	1		*RADIATOR AIR GUIDE LH (WCP)	Missing	30.00 F	*30.00 F
45	1		*CONDENSOR ASSY (WCP)	Bent	540.00 F	*540.00 F
46	1		*FAN SHOUD (WCP)	Broken	120.00 F	*120.00 F
47	1		*FAN BLADE (WCP)	Cracked	60.00 F	*60.00 F
48	1		*FAN MOTOR (WCP)	Jammed	230.00 F	*230.00 F
49	1		*A/C SUCTION HOSE (WCP)	Bent	130.00 F	*130.00 F
50	1		*A/C DISCHARGE HOSE (WCP)	Bent	155.00 F	*155.00 F
51	1		*WASHER TANK (WCP)	Dented	75.00 F	*75.00 F
52	1		*WASHER TANK PUMP (WCP)	Missing	120.00 F	*120.00 F
53	1		*AIR FILTER HOUSING CPL (WCP)	Cracked	285.00 F	*285.00 F
54	1		*AIR FILTER HOSE (WCP)	Cracked	45.00 F	*45.00 F
55	1		*AIR FILTER DUCT (WCP)	Cracked	40.00 F	*40.00 F
56	1		*HORN - LOW PITCH (WCP)	Missing	45.00 F	*45.00 F
57	1		*WIPER MOTOR (WCP)	* Check	240.00 F	*- F
58	1		*WIPER LINKAGE (WCP)	* Check	180.00 F	*- F
59	1		*FUSE BOX CPL (WCP)	Cracked	100.00 F	*100.00 F
60	1		*FRONT WINDSCREEN - GLASS (WCP)	Cracked	1,100.00 F	*1,100.00 F
61	1		*FRONT WINDSCREEN - MLDG (WCP)	Necessary	80.00 F	*80.00 F
62	1		*REAR BUMPER (WCP)	Bent	250.00 F	*250.00 F
63	1		*REAR BUMPER RETAINER RH (WCP)	Serviceable	15.00 F	*- F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
64	1		*REAR BUMPER RETAINER LH (WCP)	Cracked	15.00 F	*15.00 F
65	1		*REAR BUMPER TOW CAP (WCP)	Serviceable	20.00 F	*- F
66	1		*REAR BUMPER SIDE GARNISH LH (WCP)	* Check	30.00 F	*- F
67	1		*REAR BUMPER SIDE REFLECTOR LH (WCP)	* Check	50.00 F	*- F
68	1		*REAR BUMPER REVERSE PARKING LH (WCP)	* Check	95.00 F	*- F
69	1		*BOOTLID (WCP)	Bent	580.00 F	*580.00 F
70	1		*BOOTLID HINGE RH (WCP)	Repair	35.00 F	*- F
71	1		*BOOTLID HINGE LH (WCP)	Repair	35.00 F	*- F
72	1		*BOOTLID LOCK (WCP)	* Check	105.00 F	*- F
73	1		*BOOTLID DAMPER RH (WCP)	Serviceable	100.00 F	*- F
74	1		*BOOTLID DAMPER LH (WCP)	Serviceable	100.00 F	*- F
75	1		*BOOTLID LOCK HANDLE (WCP)	* Check	115.00 F	*- F
76	1		*BOOTLID TAIL LAMP ASSY LH (WCP)	Cracked	110.00 F	*110.00 F
77	1		*BOOTLID CTR GARNISH (WCP)	Cracked	140.00 F	*140.00 F
78	1		*BOOTLID INNER TRIM (WCP)	* Check	90.00 F	*- F
79	1		*BOOTLID BADGE (WCP)	Necessary	20.00 F	*20.00 F
80	1		*REAR FENDER LH (WCP)	Bent	620.00 F	*620.00 F
81	1		*FENDER TAIL LAMP ASSY LH (WCP)	Broken	245.00 F	*245.00 F
82	1		*FENDER SIDE INNER TRIM LH (WCP)	* Check	160.00 F	*- F
83	1		*FENDER AIR VENT LH (WCP)	* Check	30.00 F	*- F
84	1		*FENDER SIDE BRACKET LH (WCP)	* Check	75.00 F	*- F
85	1		*REAR WINDSCREEN GLASS - MLDG (WCP)	Necessary	120.00 F	*120.00 F
86	1		*REAR TRUNK COMPARTMENT BOARD (WCP)	Serviceable	190.00 F	*- F
87	1		*REAR TRUNK RUBBER MLDG (WCP)	* Check	70.00 F	*- F
88	1		*REAR END PANEL (WCP)	* Check	290.00 F	*- F
89	1		*REAR END PANEL UPPER GARNISH (WCP)	Serviceable	50.00 F	*- F
90	1		*LOWER SIDE SILL PANEL LH (WCP)	* Check	280.00 F	*- F
91	1		*FRONT DOOR LH (WCP)	Bent	570.00 F	*570.00 F
92	1		*DOOR GLASS (WCP)	* Check	290.00 F	*- F
93	1		*DOOR UPPER HINGE LH (WCP)	* Check	45.00 F	*- F
94	1		*DOOR LOWER HINGE LH (WCP)	* Check	45.00 F	*- F
95	1		*DOOR CATCH LH (WCP)	* Check	50.00 F	*- F
96	1		*DOOR HANDLE LH (WCP)	Serviceable	205.00 F	*- F
97	1		*DOOR REGULATOR LH (WCP)	* Check	275.00 F	*- F
98	1		*DOOR INNER TRIM LH (WCP)	* Check	390.00 F	*- F
99	1		*REAR DOOR LH (WCP)	Bent	570.00 F	*570.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
100	1		*REAR DOOR GLASS LH (WCP)	Broken	290.00 F	*290.00 F
101	1		*REAR DOOR UPPER HINGE LH (WCP)	* Check	45.00 F	*- F
102	1		*REAR DOOR LOWER HINGE LH (WCP)	* Check	45.00 F	*- F
103	1		*REAR DOOR CATCH LH (WCP)	Repair	50.00 F	*- F
104	1		*REAR DOOR HANDLE LH (WCP)	Serviceable	205.00 F	*- F
105	1		*REAR DOOR REGULATOR LH (WCP)	* Check	275.00 F	*- F
106	1		*REAR DOOR INNER TRIM LH (WCP)	Cracked	390.00 F	*390.00 F
107	1		*REAR FENDER SIDE GLASS LH (WCP)	Cracked	350.00 F	*350.00 F
108	1		*REAR FENDER SIDE GLASS - MLDG LH (WCP)	Necessary	40.00 F	*40.00 F
109	1		*FRONT FENDER SIDE GLASS RH (WCP)	Cracked	350.00 F	*350.00 F
110	1		*FRONT FENDER SIDE GLASS LH (WCP)	Cracked	350.00 F	*350.00 F
111	1		*FRONT FENDER SIDE GLASS - MLDG RH (WCP)	Necessary	40.00 F	*40.00 F
112	1		*FRONT FENDER SIDE GLASS - MLDG LH (WCP)	Necessary	40.00 F	*40.00 F
113	1		*DASHBOARD CPL (WCP)	Torn	680.00 F	*680.00 F
114	1		*AIRBAG - DRIVER (WCP)	Burst	1,250.00 F	*1,250.00 F
115	1		*AIRBAG - PASSENGER (WCP)	Burst	1,300.00 F	*1,300.00 F
116	1		*AIRBAG - ECU (WCP)	Necessary	720.00 F	*720.00 F
117	1		*SEAT BELT ASSY RH (WCP)	Jammed	485.00 F	*485.00 F
118	1		*SEAT BELT ASSY LH (WCP)	Jammed	485.00 F	*485.00 F
119	1		*SEAT BELT PILLAR CTR GARNISH RH (WCP)	Distorted	90.00 F	*90.00 F
120	1		*SEAT BELT PILLAR CTR GARNISH LH (WCP)	Distorted	90.00 F	*90.00 F
121	1		*FRONT SIDE PILLAR UPPER GARNISH RH (WCP)	Distorted	110.00 F	*110.00 F
122	1		*FRONT SIDE PILLAR UPPER GARNISH LH (WCP)	* Check	110.00 F	*- F
123	1		*FRONT SHOCK ABSORBER RH (WCP)	* Check	260.00 F	*- F
124	1		*FRONT SHOCK ABSORBER LH (WCP)	Bent	260.00 F	*260.00 F
125	1		*FRONT ABSORBER MTG RH (WCP)	* Check	30.00 F	*- F
126	1		*FRONT ABSORBER MTG LH (WCP)	* Check	30.00 F	*- F
127	1		*FRONT LOWER ARM RH (WCP)	* Check	140.00 F	*- F
128	1		*FRONT LOWER ARM LH (WCP)	Distorted	140.00 F	*140.00 F
129	1		*FRONT WHEEL HUB RH (WCP)	* Check	105.00 F	*- F
130	1		*FRONT WHEEL HUB LH (WCP)	Bent	105.00 F	*105.00 F
131	1		*FRONT KNUCKLE RH (WCP)	* Check	295.00 F	*- F
132	1		*FRONT KNUCKLE LH (WCP)	Bent	295.00 F	*295.00 F
133	1		*FRONT DRIVE SHAFT CPL RH (WCP)	* Check	950.00 F	*- F
134	1		*FRONT DRIVE SHAFT CPL LH (WCP)	* Check	950.00 F	*- F
135	1		*STEERING RACK CPL (WCP)	Jammed	1,200.00 F	*1,200.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
136	1		*FRONT CROSSMEMBER - SUBFRAME (WCP)	* Check	700.00 F	*- F
137	1		*FRONT TIE ROD RH (WCP)	* Check	85.00 F	*- F
138	1		*FRONT TIE ROD LH (WCP)	* Check	85.00 F	*- F
139	1		*FRONT TIE ROD JOINT RH (WCP)	* Check	55.00 F	*- F
140	1		*FRONT TIE ROD JOINT LH (WCP)	* Check	55.00 F	*- F
141	1		*FRONT STABILIZER (WCP)	Distorted	180.00 F	*180.00 F
142	1		*FRONT ENGINE LOWER COVER (WCP)	Missing	120.00 F	*120.00 F
143	1		*FRONT ENGINE LOWER SIDE COVER RH (WCP)	Missing	90.00 F	*90.00 F
144	1		*FRONT ENGINE LOWER SIDE COVER LH (WCP)	Missing	90.00 F	*90.00 F
145	1		*ENGINE MOUNTING RH (WCP)	Cracked	155.00 F	*155.00 F
146	1		*ENGINE MOUNTING LH (WCP)	Cracked	175.00 F	*175.00 F
147	1		*ENGINE MOUNTING BRACKET RH (WCP)	Cracked	100.00 F	*100.00 F
148	1		*ENGINE MOUNTING BRACKET LH (WCP)	* Check	150.00 F	*- F
149	1		*REAR AXLE - SUBFRAME (WCP)	* Check	880.00 F	*- F
150	1		*REAR SHOCK ABSORBER LH (WCP)	* Check	220.00 F	*- F
151	1		*REAR ABSORBER MTG LH (WCP)	* Check	40.00 F	*- F
152	1		*FRONT WHEEL LH (LOCAL PURCHASE) (50%)	Dented	250.00 F	*125.00 FS
153	1		*FRONT WHEEL CAP LH (WCP)	Missing	100.00 F	*100.00 F
154	1		*FRONT TYRE LH (30%)	Buckled	250.00 F	*75.00 FS
155	1		*FRONT ROTOR DISC LH (WCP)	* Check	220.00 F	*- F
156	1		*FRONT BRAKE CALIPER ASSY LH (WCP)	Serviceable	350.00 F	*- F
157	1		*FRONT BRAKE PAD LH (WCP)	Serviceable	80.00 F	*- F
158	1		*FRONT BRAKE HOSE LH (WCP)	* Check	90.00 F	*- F
159	1		*FRONT ABS SENSOR LH (WCP)	* Check	180.00 F	*- F
160	1		*ENGINE ECU ASSY CPL (WCP)	Cracked	1,450.00 F	*1,450.00 F
161	1		*ENGINE HARNESS WIRE CPL (WCP)	* Check	1,250.00 F	*- F
162	1		*ENGINE - GEARBOX ASSY CPL (WCP)	Cracked	18,500.00 F	*18,500.00 F
163	1		*BRAKE MASTER PUMP ASSY (NPA)	Bent	-	*- F
164	1		*DOOR SIDE MIRROR LH (NPA)	Broken	-	*- F
165	1		*A/C SUCTION HOSE (NPA)	Punctured	-	*- F
166	1		*A/C DISCHARGE HOSE (NPA)	Punctured	-	*- F
167	1		*BRAKE BOOSTER (NPA)	Bent	-	*- F
					Sub Total (\$\$)	56,310.00 44,220.00
					+ Margin on L,N Items 10.00/10.00% (\$\$)	5,631.00 4,402.00
					Total Parts (\$\$)	61,941.00 48,622.00

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	ENGINE - FITTING & ACCESSORIES * Check	250.00	0.00
2	1	ENGINE ECU - DIAGNOSIS & RE-SETTING * Check	550.00	0.00
3	1	FRONT GRILLE, BUMPER, INNER COVER, SIDE PANEL & INNER GARNISH - CLIPS Necessary	250.00	120.00
4	1	FRONT NUMBER PLATE & FRAME Missing	35.00	35.00
Sub Total (\$\$)			1,085.00	155.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	BODY REPAIR, PANEL BEAT & STRAIGHTEN/ALIGN - ACCIDENT AREA	New	2,500.00	2,400.00
2	SPRAY PAINT - FRT BUMPER, BONNET, FRT FENDER X2, FRT DOOR X2, REAR BUMPER, BOOTLID, REAR DOOR LH, REAR FENDER LH, SIDE PILLAR, CTR PILLAR & SUPPORT PANEL	New	2,500.00	2,400.00
3	REMOVE & REFIT - FRT WINDSCREEN GLASS	New	150.00	120.00
4	REMOVE & REFIT - REAR WINDSCREEN GLASS	New	120.00	120.00
5	REMOVE & REFIT - REAR FENDER SIDE GLASS LH	New	120.00	60.00
6	REMOVE & REFIT - FRT PILLAR SIDE GLASS RH & LH (2 SIDES)	New	120.00	120.00
7	REMOVE & REFIT - FRT DOOR COMPONENTS	New	120.00	60.00
8	REMOVE & REFIT - REAR DOOR COMPONENTS	New	120.00	60.00
9	REMOVE & REFIT - FRONT UNDERCARRIAGE COMPONENTS	New	350.00	320.00
10	REMOVE & REFIT - REAR UNDERCARRIAGE COMPONENTS * Check	New	350.00	0.00
11	REMOVE & REFIT - DASHBOARD COMPONENTS	New	250.00	250.00
12	REFILL - ENGINE OIL, BRAKE OIL, STEERING OIL & AUTO TRANSMISSION OIL	New	350.00	280.00
13	REFILL - RADIATOR COOLANT	New	80.00	40.00
14	REFILL - AIR COND GAS	New	80.00	80.00
Gross Labour Cost (\$\$)			7,210.00	6,310.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >