



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJK 7970C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	REAR BOOT COVER CHEVROLET EMBLEM	NECESSARY	79.00	60.00
1	REAR BOOT COVER	BUCKLED	2,004.00	1,415.00
1	REAR BOOT COVER INNER LOCK	BENT	315.00	165.00
1	REAR BOOT COVER INNER BOARD	SERVICEABLE	936.00	-
2	REAR BOOT COVER ABSORBER HOLDER @\$216.00	NOT NECESSARY	432.00	-
1	REAR BOOT COVER CENTRE GARNISH	CRACKED	336.00	180.00
1	REAR BOOT COVER LOGO	NECESSARY	102.00	90.00
1	REAR BOOT COVER EMBLEM MAGNUM	NECESSARY	78.00	62.00
1	REAR BOOT COVER OPTRA EMBLEM	NECESSARY	78.00	62.00
2	REAR FENDER @\$2004.00	TO REPAIR SEE LABOUR	4,008.00	-
2	REAR FENDER COWLING @\$102.00	NOT NECESSARY	204.00	-
2	REAR FENDER INNER TRIM @\$114.00	NOT NECESSARY	228.00	-
2	TAIL LAMP @\$365.00	CRACKED	730.00	730.00
2	TAIL LAMP PANEL @\$198.00	BENT	396.00	396.00
1	REAR BUMPER }	DISTORTED	1,512.00	1,365.00
1	REAR BUMPER REINFORCEMENT }		672.00	-
1	REAR BUMPER SPOUNGE	NOT FITTED	90.00	-
2	REAR BUMPER RETAINER @\$66.00	BENT	132.00	132.00
1	REAR BUMPER CENTRE RETAINER	NOT FITTED	162.00	-
2	REAR BUMPER REFLECTOR @\$150.00	NOT FITTED	300.00	-
2	REAR BUMPER PLATE LAMP @\$78.00	NOT FITTED	156.00	-
1	END PANEL	BADLY DENTED	552.00	552.00
1	END PANEL GARNISH	DISTORTED	384.00	160.00
1	SPARE TYRE PANEL	CRUMPLED / BUCKLED	2,220.00	1,615.00
1	SPARE TYRE PANEL COVER BOARD	SERVICEABLE	420.00	-
1	SPARE TYRE PANEL INSULATOR SHEET	TO REPAIR SEE LABOUR	180.00	-
1	REAR EXHAUST PIPE	TO REPAIR SEE LABOUR	576.00	-
2	REAR EXHAUST PIPE MOUNTING @\$54.00	NOT NECESSARY	108.00	-

Report Ref No. CS/AGI23002664/Uvy3e2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-1,739.00	-698.40
			15,651.00	6,285.60
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	REAR TAIL GATE GLASS SEALANT (SN)	NOT NECESSARY	100.00	-
1	REAR NUMBER PLATE (SN)	CRACKED	45.00	40.00
10	REAR FENDER INNER TRIM CLIP (SN)	NOT NECESSARY	50.00	-
10	REAR FENDER COWLING CLIP (SN)	NOT NECESSARY	50.00	-
1	REAR BOOT COVER TOP SPOILER (SN)	TO REPAIR SEE LABOUR	650.00	-
			895.00	40.00
	<b><u>LABOUR</u></b>			
	TO CHECK WIRING.		100.00	20.00
	TUFF KOTE.		200.00	80.00
	REMOVE AND REFIX UPHOLSTERY.		100.00	80.00
	REMOVE AND REPLACE EXHAUST.	NOT NECESSARY	160.00	-
	REMOVE AND REPLACE REAR WINDSCREEN.	NOT NECESSARY	160.00	-
	TRANSFER OF BOOTLID MECHANISM.		160.00	60.00
	TO REMOVE AND REPLACE SPARE PARTS AND PANEL BEATING. INCLUSIVE OF THE REPAIR OF REAR FENDER, SPARE TYRE PANEL INSULATOR SHEET, REAR EXHAUST PIPE AND REAR BOOT COVER TOP SPOILER.		1,500.00	1,200.00
	TO SPRAY PAINT EFFECTED PORTION.		1,500.00	1,000.00
			3,880.00	2,440.00
<b>GRAND TOTAL</b>			<b>20,426.00</b>	<b>8,765.60</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>4,600.00</b>

Report Ref No. CS/AGI23002664/Uvy3e2

CHUA KANG SENG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.