

Our Reference : 2022/11065

Your Reference:

Vehicle Number : SKZ7360Y

S/N	Qty	Description	Condition	Repairer Estimate (\$\$)	Our Assessment (\$\$)	
		Parts				
1	1pcs	Font bumper	Distorted	705.24	705.24	648 ✓
2	2pcs	Front bumper side retainer @74.96/pcs	Torn	149.92	149.92	✓
3	1pcs	Front bumper sponge	Serviceable	120.00	-	× nn
4	1pcs	Front bumper re enforcement	Serviceable	427.20	-	× nn
5	1pcs	Front grille	Serviceable	477.60	-	× nn
6	1pcs	Headlamp LH	Serviceable	1,150.86	-	× nn
7	1pcs	Headlamp RH	Grazed	1,150.86	1,150.86	✓
8	1pcs	Bonnet	Dented	972.00	972.00	✓
9	1pcs	Bonnet logo	Necessary	65.00	65.00	✓
10	1pcs	Bonnet inner lock	Serviceable	114.00	-	× nn
11	1pcs	Bonnet inner seal	Serviceable	48.00	-	× nn
12	1pcs	Support panel	Repair	1,547.88	-	× nn
Total				6,928.56	3,043.02	2985.78
Less 25%				1,732.14	760.76	-25%
Parts Sub Total				5,196.42	2,282.27	2239.33

Special Nett

13	1Set	Front bumper clip	Necessary	80.00	50.00	30
14	1set	Front grille clips	Necessary	80.00	50.00	× nn
Total				160.00	100.00	30

Labour					
1	To check wiring sytsem	80.00	50.00	30	
2	To reprogram and reset after repair.	200.00	200.00	×	
3	To cut & weild on support panel. To panel beat and straighten on front wheel hosuing and To r&r front bumper, headlamp, bonnet and other attachments.	1,000.00	800.00	400	
4	To putty and respray front bumper,bonnet, front both fenders, support panel and accident affected area.	1,500.00	1,000.00	400	
5	Rustproofing	200.00	150.00	30	
Labour Total		2,980.00	2,200.00		
Sub Total (labour and parts)		8,336.42	4,582.27		

Adjustment / Recommendations

Note: For Lump Sum Repair

The workshop has agreed to undertake the repair on a Lump Sum Basis, and/or use of ex-stock/reconditioned parts whichever is possible (having taken into consideration to repair instead of replacements).

The final adjusted Lump Sum contract amount is **\$53,650.00**.

Under normal circumstances, the repair period would be about 5 working days.

3129.33

L/S - 2503.46
= 2500

4 days

Precise Appraiser Pte Ltd

Reg no. 201924041Z

VEHICLE DAMAGE ASSESSMENT REPORT

To: Chi Jun Car Rental

CC: Astute Autoworks Pte Ltd
60 Jalan Lam Huat, #02-16/17
Carros Centre
Singapore 737869

REFERENCES

Ref No	: 2022/11065	Date of Report	: 3/12/2022
Claim Type	: Third Party	Date of Request	: 21/11/2022
Third party vehicle	: SKZ7360Y	Date of Accident	: 22/10/2022
Insured Vehicle	:	Date of Inspection	: 21/11/2022
Your Reference No	:		

DAMAGED VEHICAL PARTICULARS

Registration Plate No	: SKZ7360Y	Engine Modification	: NIL
Model / Make	: Toyota Wish	Pre-accident damage	: NIL
Colour	: Grey	General Condition	: Good
Manufacturing Year	: 2015	General Paint Work	: Good
Engine No	: 2ZR1685027	Steering	: Serviceable
Engine Capacity	: 1800cc	Handbrake	: Serviceable
Chassis No	: JTDGG20W80J003460	Footbrake	: Serviceable
Odometer No	: 205887		
Transmission	: Auto		

TYRES CONDITION

Front Right			Rear Left		
Make	: Road X		Make	: Road X	
Size	: 185/60 r15	5	Size	: 185/60 r15	5
Front Left			Rear Right		
Make	: Road X		Make	: Road X	
Size	: 185/60 r15	5	Size	: 185/60 r15	5

The above millimetres represent the remaining life of tyre treads

VEHICAL REPAIR COST

<u>Descriptions</u>	<u>Repairer (\$\$)</u>	<u>Difference (\$\$)</u>	<u>Adjuster (\$\$)</u>
Parts	5,356.42		2,382.27
Labour	2,980.00		2,200.00
Calculated Cost (\$\$) :	8,336.42	3,754.16	4,582.27


Recommended Lump Sum Repair Cost (\$\$)	: 3,650.00
Estimate Repair Duration	: 5
Survey Inspection At	: Astute Autoworks Pte Ltd
Survey Inspection Address	: 60 Jalan Lam Huat, #02-16/17 Carros Centre Singapore 737869

DESCRIPTION OF DAMAGE

At the time of inspection, this vehicle sustained damages to the **Front Portion**.

Front bumper distorted, bonnet dented, support panel pish in, rh headlamp grazed etc.

Please see attached scheduled details.

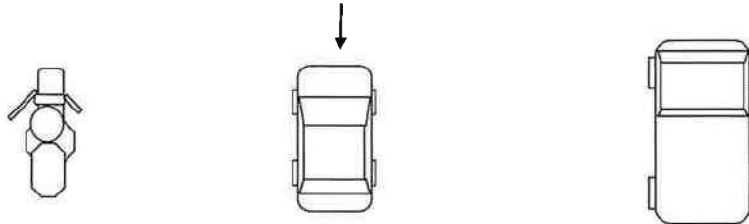

SPECIAL REMARKS

We have not authorised repair. Under normal circumstances, estimated **5** working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.

Handwritten signature of Anthony and the Precise Appraiser Pte Ltd logo, which is a circular seal with the company name and a star.

Anthony
Automotive Appraiser
MSAAA

Disclaimer:

This survey was conducted by Precise Appraiser Pte Ltd without prejudice basis and we do not authorized repair. Report by Precise Appraiser Pte Ltd is deemed as confidential and provided for the use of clients and appointed agent. *We have inspected thoroughly each and every item on the repairer's estimate against the actual damages found on the vehicle.* All findings and recommendations are listed accordingly and final decision of settlement to your good selves parts thereof accordingly and final. No liability shall be attached to Precise Appraiser Pte Ltd therefore.