

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI23002715/UQP3E2
Date: 10/04/2023REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSNW00018502305
Claimant Vehicle No :	YN2936S	Insured Vehicle No :	GBH1851M
Date of Loss:	14/03/2023	Nature of Claim:	TP
		Claim No:	SNM23D201939/C02/TAYHP

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	YN2936S	Engine No:	N04CUV10823
Make & Model:	HINO XZU700R, 4.0 D (M)	Chassis No:	JHHTCP3H80K001199
Reg. Date:	08/03/2012 (Man. Year: 2011)	Odometer:	348783 km
Colour:	White		
Engine Capacity:	4009 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/75 R17.5	Rear Tyre Size:	7.00 R16 (D)
Front Left Side:	GTRadial 6 mm	Rear Left Side:	Triangle 6/6 mm
Front Right Side:	GTRadial 6 mm	Rear Right Side:	Triangle 6/6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,505.09	9,753.20	4,751.89	32.76
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,990.00	2,750.00	1,240.00	31.08
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	18,495.09	12,503.20	5,991.89	32.40
Approved Total (Overridden) (S\$)		10,000.00		
	(S\$)	18,495.09	10,000.00	8,495.09
	+ GST 8.00/8.00% (S\$)	1,479.61	800.00	679.61
	Nett Amount (S\$)	19,974.70	10,800.00	9,174.70

INSPECTION

Date of Assignment:	05/04/2023	Bluwel Automotive Service Pte Ltd (HQ)
Date Inspected:	16/03/2023 Inspected At:	1 Kaki Bukit Avenue 6, #01-28/37/53/55/56
		Autobay@Kaki Bukit
		Singapore 417883
Estimated Period of Repair:	8.0 days	

Adjuster: MARCUS CHUA**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 10 Apr 2023)	
Parts:	N/A	HINO XZU700R 4.0 D (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for YN2936S)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT WINDSCREEN	Cracked	1,265.00 FL	*1,265.00 FL
2	1		*FRONT WINDSCREEN RUBBER	Necessary	268.00 FL	*268.00 FL
3	1		*FRONT PANEL	Badly Dented	1,324.70 FL	*1,324.70 FL
4	1		*FRONT GRILLE	Cracked	1,045.00 FL	*1,045.00 FL
5	1		*FRONT GRILLE LOGO	Necessary	108.00 FL	*108.00 FL
6	1		*FRONT BUMPER	Distorted	1,005.20 FL	*1,005.20 FL
7	1		*FRONT BUMPER BRACKET N/S	Bent	342.90 FL	*342.90 FL
8	1		*FRONT BUMPER FOG LAMP N/S	Cracked	350.90 FL	*350.90 FL
9	1		*FRONT CORNER PANEL N/S	Distorted	644.70 FL	*644.70 FL
10	1		*HEADLAMP N/S	Broken	1,088.60 FL	*1,088.60 FL
11	1		*HEADLAMP BULB N/S	Not Necessary	10.00 FL	*- FL
12	1		*FRONT DOOR N/S	Repair	1,915.00 FL	*- FL
13	1		*FRONT DOOR SIGNAL LAMP N/S	Cracked	148.00 FL	*148.00 FL
14	1		*FRONT DOOR MIRROR BRACKET N/S	Broken	420.00 FL	*420.00 FL
15	1		*FRONT DOOR MIRROR N/S	Missing	185.00 FL	*185.00 FL
16	1		*FRONT DOOR MIRROR ROUND N/S	Missing	125.00 FL	*125.00 FL
17	1		*FRONT DOOR OUTER PILLAR N/S	Badly Dented	989.00 FL	*989.00 FL
18	1		*FRONT DOOR INNER PILLAR N/S	Repair	866.00 FL	*- FL
19	2		*FRONT DOOR HINGES	Not Necessary	290.00 FL	*- FL
20	1		*FRONT DOOR CHECKER N/S	Not Necessary	162.00 FL	*- FL
21	1		*FRONT DOOR INNER LOCK N/S	Not Necessary	350.00 FL	*- FL
22	1		*FRONT DOOR INNER RUBBER N/S	Not Necessary	291.00 FL	*- FL
23	1		*FRONT WHEEL ARCH PANEL N/S	Repair	545.00 FL	*- FL
24	1		*FRONT STEP PANEL N/S	Repair	366.00 FL	*- FL
25	1		*FRONT STEP PANEL GARNISH N/S	Distorted	305.00 FL	*305.00 FL
26	1		*FRONT STEP PANEL GARNISH LAMP N/S	Not Necessary	105.00 FL	*- FL
27	1		*FRONT CONDENSER	Punctured	1,133.00 FL	*1,133.00 FL
28	1		*FRONT CONDENSER BRACKET	Repair	302.10 FL	*- FL
29	1		*SET FRONT BUMPER CLIPS	Necessary	50.00 FS	*40.00 FS
30	1		*FRONT WINDSCREEN SEALANT	Necessary	50.00 FS	*40.00 FS
31	1		*SET FRONT DOOR INNER TRIM BOARD CLIPS	Not Necessary	50.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	16,100.10	10,828.00
- List Item Discount on L Items 10.00/10.00% (S\$)	1,595.01	1,074.80
Total Parts (S\$)	14,505.09	9,753.20

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING	New	50.00	20.00
2	TO DISMANTLE & REPLACED FRONT WINDSCREEN	New	120.00	100.00
3	TO DISMANTLE & REFIX DASHBOARD	New	380.00	250.00
4	TO DISMANTLE & REFIX FRONT DOOR MECHANISM	New	120.00	0.00
5	TO REFILL AIR CON GAS	New	120.00	100.00
6	TO SPRAY RUST PROOFING	New	100.00	80.00
7	TO CONDUCT WHEEL ALIGNMENT	New	100.00	0.00
8	LABOUR FOR PANEL BEATING & REPLACED PARTS	New	1,500.00	1,200.00
9	TO PUTTY & SPRAY PAINTING	New	1,500.00	1,000.00
			Gross Labour Cost (\$\$)	3,990.00
				2,750.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >