

Your Ref : 304784

Date: 27<sup>th</sup> April 2023

Our Ref : CS4/MSG23002729/Pqy3m4

**M/s MSIG Insurance (S) Pte Ltd**

4 Shenton Way #21-01

SGX Centre 2

Singapore 068807

(The Motor Claims Department)

Dear Sirs/Madam,

**AUTOMOBILE INSPECTION REPORT OF ACCIDENT VEHICLE NO. FBK 2806Y ACCIDENT ON 11/02/2023**

Instruction was received to inspect the vehicle Reg. No. FBK 2806Y. The inspection was conducted on 16/03/2023 at the premises of M/s Glen Enterprise Pte Ltd, 1100 / 1102 Serangoon Road, Singapore 328196.

The following vehicle information was recorded:

Registration Number	: FBK 2806Y
Make/Model	: Suzuki UH200AL5 Burgman 200 Abs
Year of Registration	: 2015
Body Colour	: Grey
Chassis Number	: MLCC9112100402163
Engine Capacity	: 200 cc

The vehicle caught fire. The cause of fire probably due to fluid leakage to hot surfaces.  
(Details see photographs enclosed)

In view of this, we are of the opinion that it would be **uneconomical** to proceed with the repairs due to extensive repair cost and recommend it to be written off as **“Total Loss”**.

Market Value	S\$	3,800.00 (est)
Less: LTA Reimbursement Value (RV)	(S\$	1,396.00)
Nett Liability	S\$	2,404.00
	=====	

Vehicle Inspected By:



**SHERWIN BEH SWEE YANG**  
*Technical Investigator*



**K.K.LAU**  
*MSc(Eng M), B Eng(Hons), PEng(UK),  
MASME(USA), B Bus(Aust), MBA(UK),  
IEng(UK), MIIE(mech), MinstAEA, MFIEA,  
MIRTE, MIMI, MSAE, MCIARD, AM, NIJAAR(USA),  
AM CATARI(CAN), M.MATA(USA), M.MdATA(USA),  
Licensed Appraiser*

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.