

(08/18/13) wef

ASS. REC. BY: PMC

REF:

CS/AH12300 2981/Rqy3

900C

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: SG 59065at Workshop m/s BOX FRESHof 154, 4th CIRCUIT

Insured:

AGI

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

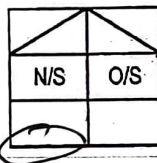

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

Veh No:

SG 59065

Yr Regn:

2017 / DCType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

MAN A95c.c. 10518

Colour

GREEN

A/C:

Insured / Std / NI / NA

Sp. Reading

327353

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WMAA45 Z204TF 003890

Gen. Cond: Good / Fair / Poor / Burnt

Steering: (order) / Jammed / Leaked / Burnt or

Brake: (order) / Jammed / Leaked / Burnt or

Modi: NIL / S/Rim / STD A/Rim or

Tyre Size:

F:

275/70R22-5

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

8

mm

R/Bal.

8/8

mm

L/Bal.

8

mm

L/Bal.

8/8

mm

D.O.A.

02/03/23

D.O.I.

22/03/23

Survey held at

BOX FRESH

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

REAR N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?



Prel. Report

1)



Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

Report Format :

Lump Sum / I.B.I: (\$

Add Fee:



Site Insp (\$



Interview (\$



Tech. Invs (\$



Weekend (\$



Boxfresh Pte Ltd

7030 Ang Mo Kio Ave 5 #06-49

Northstar @AMK Singapore 569880

Tel : 64585441 Fax : 64553470

Vehicle No : SG5906S

Accident date : 2th Mar 2023

Model No : Man

Registered owner : Go Ahead Singapore Pte Ltd

A95

Date of Estimate : 22/03/23

My Ref : BF-IC-1126

Total Charge

Parts Repair and Labour (Total 2 days of repair)

- a) Replace NS corner bumper P/N : G20.10.05.37 *can* S\$986.70
b) Replace NSR light deflector P/N: LRFC-808022-RED *? plus* S\$30.36

Subtotal : S\$ 1017.06

- c) Labour for removal and installation of new parts S\$ ~~160~~ 100
d) Labour and material for painting of replaced parts S\$ ~~300~~ 150

Subtotal : S\$ 460

Total Charge : S\$ 1477.06

BOXFRESH PTE LTD

WORKSHOP: 154 GUL CIRCLE SINGAPORE 629611

OFFICE: 7030 ANG MO KIO AVE 5 #06-49 NORTHSTAR SINGAPORE 569880

T: +65 64585441 • F: +65 64553470 • E: business@boxfresh.com.sg • W: www.boxfresh.com.sg



GST 8% S\$ 118.16

Total Bill : S\$ 1595.22

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Rene
Hp 90010068

1 day

22/03/23

Resy before part

BOXFRESH PTE LTD

WORKSHOP: 154 GUL CIRCLE SINGAPORE 629611

OFFICE: 7030 ANG MO KIO AVE 5 #06-49 NORTHSTAR SINGAPORE 569880

T: +65 64585441 • F: +65 64553470 • E: business@boxfresh.com.sg • W: www.boxfresh.com.sg