

VEHICLE SURVEY REPORTS																																				
<p>Chia Tuck Wah C/O Guan Auto Service Blk 7 Sin Ming Industrial Estate Sector C #01-80/#01-82 Singapore 575642</p>																																				
1	Reference Job Reference No : 22/002498 Claim No : - Claim Type : Third Party Accident Date : 07/05/2022 Survey Date : 17/05/2022 Survey Report Date : 23/05/2022																																			
2	Particulars Of Vehicle Vehicle Registration No : SJL3286R Make & Model : Mitsubishi Lancer 1.6 A Vehicle Registration Date : 24/11/2008 Chassis No : JMYSTCS3A8U010555 Engine No : Blocked Colour : Grey																																			
3	Condition Of Vehicle And Tyres <table border="0"> <tr> <td><u>Mileage (KM)</u></td> <td><u>Brakes</u></td> <td><u>Steering</u></td> <td><u>Modification</u></td> </tr> <tr> <td>208608</td> <td>Serviceable</td> <td>Serviceable</td> <td>None</td> </tr> <tr> <td colspan="4"> </td> </tr> <tr> <td><u>Tyres</u></td> <td><u>Make</u></td> <td><u>Size</u></td> <td><u>Balance (MM)</u></td> </tr> <tr> <td>Front RHS</td> <td>Kumho</td> <td>195/55R15</td> <td>5</td> </tr> <tr> <td>Front LHS</td> <td>Kumho</td> <td>195/55R15</td> <td>5</td> </tr> <tr> <td>Rear RHS</td> <td>Kumho</td> <td>195/55R15</td> <td>6</td> </tr> <tr> <td>Rear LHS</td> <td>Kumho</td> <td>195/55R15</td> <td>6</td> </tr> </table>				<u>Mileage (KM)</u>	<u>Brakes</u>	<u>Steering</u>	<u>Modification</u>	208608	Serviceable	Serviceable	None					<u>Tyres</u>	<u>Make</u>	<u>Size</u>	<u>Balance (MM)</u>	Front RHS	Kumho	195/55R15	5	Front LHS	Kumho	195/55R15	5	Rear RHS	Kumho	195/55R15	6	Rear LHS	Kumho	195/55R15	6
<u>Mileage (KM)</u>	<u>Brakes</u>	<u>Steering</u>	<u>Modification</u>																																	
208608	Serviceable	Serviceable	None																																	
<u>Tyres</u>	<u>Make</u>	<u>Size</u>	<u>Balance (MM)</u>																																	
Front RHS	Kumho	195/55R15	5																																	
Front LHS	Kumho	195/55R15	5																																	
Rear RHS	Kumho	195/55R15	6																																	
Rear LHS	Kumho	195/55R15	6																																	
4	Description Of Damages The vehicle sustained damages at front right hand portion. (For information of damages please refer to Parts/Labour/Photographs attached)																																			
5	Instruction This survey was conducted entirely on a "WITHOUT PREJUDICE" basis, and we have not authorised any repair.																																			

AUTO PERFORMANCE APPRAISAL

Vehicle Assessment Reports

Annex A

Ref No : 22/002498

Damage And Repair Cost Adjustment

<u>S/No</u>	<u>Qty</u>	<u>Parts Description</u>	<u>Comments/condition</u>	<u>Workshop Estimate (\$)</u>	<u>Our Assessment (\$)</u>
			<u>List Items</u>		
1	1	Front bumper	Deformed	743.00	743.00 ✓
2	1	Front bumper RH Fog lamp cover	Serviceable/reuse	64.00	-
3	1	Front bumper RH side bracket	Bent	37.00	37.00 ✓
4	1	Front bumper inner reinforcement	Badly dented/bent	147.00	147.00 ✓
5	1	Front bumper clips	Broken/necessary	30.00	30.00 ✓
6	1	Front grille complete	Dented/broken	197.00	197.00 ✓
7	1	RH headlamp	Broken/cut	612.00	612.00 ✓
8	1	Front RH fender	Badly dented/bent	486.00	486.00 ✓
9	1	Front RH fender under shield	Serviceable/reuse	90.90	- X nn
10	1 set	Front fender under shield clips	Broken/necessary	30.00	30.00 X nn
11	1	Front bonnet	Badly dented/bent	567.00	567.00 X R
12	1	Front bonnet lock	Bent	68.00	68.00 X R
13	1	Front support panel	Buckled/bent	567.00	567.00 X R
14	1	Air con condenser	Dented/leaking	527.00	527.00 X nn
15	1	Radiator	Serviceable/reuse	831.00	-
				4,996.90	4,011.00
Less discount 10%				499.69	401.10
				2252	
				-10%	
				2026.80	
Total :				4,497.21	3,609.90
			<u>Special Nett Items</u>		
16	1	Front number plate	Serviceable/reuse	45.00	- X nn
17	1L	Radiator coolant	Necessary	35.00	35.00 X nn
Total :				80.00	35.00
Total Spare Parts :				4,577.21	3,644.90

AUTO PERFORMANCE APPRAISAL

Vehicle Assessment Reports

Annex B

Ref No : 22/002498

Damage And Repair Cost Adjustment

<u>Items</u>	<u>Job Description</u>	<u>Workshop Estimate (\$)</u>	<u>Adjusted Costs (\$)</u>
1	To remove, jack out, straighten, panel beating, align and renew replaced parts.	1,000.00	700.00 500
2	To putty and respray painting on affected areas.	1,200.00	800.00 600
3	To check wirings and lightings.	50.00	30.00 ✓
4	To remove, refix aircon condenser, pipes, drier vacuum and recharge gas.	150.00	120.00 ✗
5	To supplied and applied anti rust treatments.	100.00	60.00 30
1160			
Total Labour :		2,500.00	1,710.00
Total Spare Parts :		4,577.21	3,644.90
Total Labour :		2,500.00	1,710.00
Total Repair Costs :		7,077.21	5,354.90

Assessor's Recommendation

Repairer Estimate : 7,077.21
Our Adjustment : 5,354.90

Remarks

The repairer has agreed to undertake the repair on a lump sum basis of \$4,300.00, with a repair period of 5 working days.

Surveyed By:

4 days

3186.80

L/S - 2549.44
= 2550


Lek Boon Hwee
Automobile Appraiser