

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS3/AIS23003116/WQP3E2**Date:** 04/04/2023REFERENCE

Handling Insurer:	Allianz Insurance Singapore Pte. Ltd.	Policy No:	SP2003111550
<b>Claimant Vehicle No :</b>	FBT6326S	<b>Insured Vehicle No :</b>	GBG7431H
Date of Loss:	21/03/2023	Nature of Claim:	TP
		Claim No:	202332006476

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	<b>FBT6326S</b>	Engine No:	G3M1E052255
Make & Model:	YAMAHA AEROX 155A, 155cc	Chassis No:	MLESG584111052216
Reg. Date:	13/04/2022 (Man. Year: 2020)	Odometer:	20660 km
Colour:	Red		
Engine Capacity:	155 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	110/80 R14	Rear Tyre Size:	140/70 R14
Front Left Side:	IRC 6 mm	Rear Left Side:	IRC 6 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	
<b>Global Sum Settlement (S\$)</b>		<b>0.00</b>		

INSPECTION

Date of Assignment:	25/03/2023		
Date Inspected:	27/03/2023	Inspected At:	EQBH PTE LTD (HQ) 25 Kaki Bukit Road 4, #03-79 Singapore 417800
Estimated Period of Repair:	4.0 days		

**Adjuster:** Mohdakid**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.

THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$3,500.00  
-\$4,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 04 Apr 2023)	
Parts:	N/A	YAMAHA AEROX 155A 155cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBT6326S)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >