

Case Details

Case Reference Number : TAX/01/23/2061
Type of Repair : Accident Repair
Vehicle Registration Number : SHB5627D

Company Type : Strides Taxi Pte Ltd
Estimation ID : EST-20369-ID
Assigned By : Taxi Claims Manager Team

Insurance Company Name : income insurance limited
Accident Date and Time : 26/01/2023 09:15 AM
Vehicle Age(In Months) : -

Documents / Photographs

View Documents / Photographs

Total Documents: 0

Estimation Details

Spare Part's Cost Detail

BOM Type	Costing Type	Portion	Material Number	SMRT Recommendation						Surveyor Approval				Remarks
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	
Standard	Main			COVER, FR BUMPER	1	560.30	560.30	25.00	420.22	Replace	1	0	Repair	Ry
Standard	Main			SUPPORT, FR BUMPER LH	1	86.20	86.20	25.00	64.65	Replace	0	0	Check	Ry
Standard	Main			EMBLEM ASSY FRONT	1	98.70	98.70	25.00	74.03	Replace	0	0	Not Give	X un
Standard	Main			CLIPS PIECE, FRT & RR BUMPER	10	4.80	48.00	25.00	36.00	Replace	10	36.00	Replace	all
Standard	Main			LAMP ASSY, FOG, LH	1	1,029.90	1,029.90	10.00	926.91	Replace	0	0	Not Give	X un
Standard	Main			UNIT, HEADLAMP, LH	1	2,852.40	2,852.40	10.00	2,567.16	Replace	0	0	Not Give	X un
Standard	Main			FENDER SUB-ASSY, FR, LH	1	1,060.70	1,060.70	25.00	795.53	Replace	1	0	Repair	Ry
Standard	Main			EMBLEM, SIDE PANEL (HYBRID)	1	59.10	59.10	25.00	44.33	Replace	1	44.33	Replace	all
Standard	Main			LINER, FR FENDER, LH	1	219.10	219.10	25.00	164.33	Replace	0	0	Check	Ry
Standard	Main			PAD, FR WHEEL LH	1	65.00	65.00	25.00	48.75	Replace	0	0	Check	X un.
Standard	Main			WHEEL, DISC FRONT	1	2,036.30	2,036.30	25.00	1,527.23	Replace	1	0	Repair	Ry
Standard	Main			TYRE	1	126.74	126.74	0.00	126.74	Replace	0	0	Not Give	X un
Standard	Main			HUB & BEARING ASSY, RH & LH	1	722.10	722.10	25.00	541.58	Replace	0	0	Not Give	X un

Total Spare Part Cost 10,095.67

Surveyor Total 140.33

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20.00

Final Spare Part Cost 8,028.54

Final Sur Total 112.26

<http://www.smrt.com.sg/Estimation.aspx>

SMRT Recommendation														Surveyor Approval	
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks	
Standard	Main			MOULDING ASSY, BODY ROCKER PANEL , LH	1	649.10	649.10	25.00	486.83	Replace	0	0	Not Give	✓ Xun	
Standard	Main			KNUCKLE, STEERING, LH	1	717.50	717.50	25.00	538.13	Replace	0	0	Not Give	✓ Xun	
Standard	Main			LOWER ARM SUB-ASSY, FRONT LH	1	823.20	823.20	25.00	617.40	Replace	0	0	Not Give	✓ Xun	
Standard	Main			PANEL SUB-ASSY, FRONT DOOR LH	1	1,407.80	1,407.80	25.00	1,055.85	Replace	1	0	Repair	✓ Ry	
Standard	Main			STICKER STRIDES TAXI (DOOR)	1	60.00	60.00	0.00	60.00	Replace	1	60.00	Replace	✓ well ✓	
Total Spare Part Cost									10,095.67	Surveyor Total		140.33			
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)					
Final Spare Part Cost									8,028.54	Final Sur Total		112.26			

AVC: In

T/Radio: In

45

36

44.33

60

140.33

36
44.33
60
140.33

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR FRONT LH PORTION	1,014.00	300	
Total:			1,014.00	300.00	✓

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO RESPRAY FRONT BUMPER	378.00	200	
2	Main	TO RESPRAY FRONT FENDER LH	378.00	200	
3	Main	TO RESPRAY FRONT DOOR LH	378.00	200	
4	Main	TO RESPRAY ROCKER PANEL MOULDING	180.00	0	Xun
5	Main	TO RESPRAY RIM	180.00	100	
Total:			1,494.00	700.00	✓

Other Cost Detail

SS. REC BY: /

Costing Type

Job Scope

SMRT Recommendation(\$)

Surveyor Adjustment(\$)

Remarks

From: 2 Main

Estimate

OD

To

TO WASH AND VACUUM

80.00

0

Xun

TO CHECK WIRING AND SYSTEM FUNCTION

120.00

0

Xun

TO APPLY RUST-PROOFING ON AFFECTED AREA

100.00

0

Xun

TO DO WHEEL ALIGNMENT / TYRE BALANCING

120.00

80

TO REMOVE AND REFIT TYRE

120.00

0

Xun

TO TRANSFER DOOR MECHANISM

120.00

0

Xun

TO PROVIDE LABOUR & MATERIAL FOR ADVERTISEMENT STICKER(NET)

148.44

148.44

Xun

TO REMOVE AND REFIX UNDERCARRIAGE

200.00

0

Xun

TO REPLACE SUNDRY PARTS

100.00

0

Xun

Total:

1,088.44

228.44

80

LKK Auto Consultants hence notify the Repairer of the following:

To resurvey before/after spray painting

To display damaged part(s) during resurvey

Parts prices are subject to confirmation

Third party survey is on a "Without Prejudice" basis

No illegal modification(s) is allowed

Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Summary

Estimator Assesment(\$)

Surveyor Assesment(\$)

Total Spare Part Detail

8,028.54

112.26

Total Labour Cost

1,014.00

300.00

Total Spray Painting

1,494.00

700.00

Other

1,088.44

228.44

Overall Total

11,624.98

1,340.70

Lump Sum Repair Option

☒

Lump Sum Total

11,600.00

1,350.00

Surveyor Approved Amount

1,350.00

No of Repair Days*

6

3

Remarks

Surveyor Name

Signature

Taufik

Save

Clear

Taufik 97495749

'wp' 3011230 320pm

3days

1/5 Resurvey after repair

Taufik ckhando.com

140-33

300

700

80

1220-33

1159950

03days

https://vacswb.smrt.com.sg/Estimation.aspx

https://vacswb.smrt.com.sg/Estimation.aspx

214