

# HIAP HONG MOTOR REPAIR

2 KAKI BUKIT AVE 2 #02-13 SINGAPORE 417921

TP Ching.

Xiao Chan.

Vehicle No. SLC3997X (2016)

TOYOTA WISH

JTDGG20W60J004168

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE(S\$)	SURVEYOR ADJUSTMENT
	<b>PARTS (LIST ITEMS)</b>			
1	REAR NUMBER PLATE LAMP @64.20 <i>new</i>		128.40	X.
2	REAR BUMPER <i>Distorted.</i>		596.90	✓
3	REAR BUMPER SIDE HOLDER @35.40 <i>and</i>		70.80	✓
4	REAR BUMPER REFLECTOR @56.20 <i>smushed</i>		112.40	✓
5	REAR BUMPER IMPACT BRACKET @68.40 <i>set.</i>		136.80	✓
6	REAR END PANEL <i>Distorted</i>		542.20	✓
7	REAR END PANEL TOP GARNISH <i>Distorted</i>		286.60	✓
8	REAR END PANEL ANTENNA SENSOR <i>cracked.</i>		161.70	✓
9	TAILLAMP @379.20 <i>Smushed</i>		758.40	✓
10	TAILLAMP LOWER BRACKET @45.40 <i>Smushed</i>		90.80	✓
11	TAILLAMP PANEL @278.90 <i>Dented.</i>		557.80	✓
12	TAILLAMP INNER PANEL @378.20 <i>Buckled</i>		756.40	✓
13	TAILGATE <i>Distorted</i>		1307.50	✓
14	TAILGATE LOCK <i>Loose</i>		374.40	✓
15	TAILGATE WEATHERSTRIPE <i>cut</i>		329.10	✓
16	TAILGATE INNER PULL POCKET <i>Distorted</i>		30.90	✓
17	TAILGATE HINGE @98.70 <i>Set.</i>		197.40	✓
18	TAILGATE DAMPER @265.60 <i>Dmg</i>		531.20	✓
19	TAILGATE REFLECTOR @277.60 <i>Smushed</i>		555.20	✓
20	TAILGATE INNER TRIM BOARD <i>Distorted</i>		485.50	✓
21	TAILGATE INNER SIDE TRIM BOARD @209.20 <i>rehd</i>		418.40	✓
22	TAILGATE INNER TOP TRIM BOARD <i>crack</i>		221.40	✓
23	TAILGATE OUTER CHROME MOULDING <i>crack</i>		321.70	✓
24	TAILGATE WIPER MOTOR <i>Dmg</i>		398.70	✓
25	TAILGATE WIPER ARM <i>? Distorted</i>		66.20	✓
26	TAILGATE WIPER ARM COVER		15.40	✓
27	TAILGATE GLASS <i>Shattered</i>		1029.40	✓
28	TAILGATE GLASS MOULDING <i>new</i>		162.10	✓
29	TAILGATE TOP SPOILER <i>Missing</i>		950.80	✓
30	TAILGATE TOP SPOILER BRAKE LAMP <i>crack</i>		241.40	✓
31	TOYOTA LOGO <i>? new</i>		60.40	✓
32	EMBLEM		41.70	✓
33	REAR FENDER @955.80 <i>Distorted</i>		1911.60	✓
34	REAR FENDER INNER TRIM BOARD @434.20 <i>? Distorted</i>		868.40	✓
35	REAR FENDER INNER TRIM BOARD UPPER @265		530.00	✓
36	REAR FENDER INNER SHIELD @142.60 <i>rehd</i>		285.20	✓
37	REAR LH FENDER GLASS @ 645.90 <i>Shattered</i>		<del>645.90</del> 491.80	✓
38	REAR LH FENDER AIR VENT <i>Distorted</i>		62.90	✓
39	REAR LH FENDER WHEEL HOUSE PANEL <i>Buckled</i>		859.40	✓
40	FLOOR PANEL <i>Buckled</i>		1025.30	✓
41	FLOOR PANEL CROSS MEMBER <i>Buckled</i>		598.60	✓
42	FLOOR PANEL TOP BOARD <i>rehd</i>		580.70	✓
43	FLOOR PANEL TOP SIDE BOARD @159.20 <i>LH Distorted</i>		<del>318.40</del> 159.20	✓
44	FLOOR PANEL INNER GARNISH <i>crack</i>		349.40	✓
45	SPARE TYRE LOCK REGULATOR <i>and</i>		322.90	✓
46	REAR EXHAUST PIPE <i>at new</i>		791.30	X.

47	REAR EXHAUST PIPE MOUNTING	38.40	X
48	REAR EXHAUST PIPE GASKET	32.10	X
49	REAR EXHAUST PIPE HEAT SHIELD	135.40	X
50	CENTRE EXHAUST PIPE	1250.10	+
51	CAR JACK PANEL <i>Distorted</i>	386.20	✓
52	REAR LH DOOR <i>Dented</i>	1278.40	✓
53	REAR LH DOOR LOCK	349.40	X
54	REAR LH DOOR WEATHERSTRIPE	294.10	X
55	ROOF PANEL <i>Buckled</i>	1645.90	✓
56	ROOF PANEL INNER TRIM BOARD <i>crumpled</i>	1985.40	✓
57	ROOF PANEL SIDE MOULDING @222.10 <i>LH Dehd</i>	444.20	222.10
58	REAR AXLE <i>the new</i>	2017.60	X
59	REAR WHEEL HUB C/W BEARING @525.40	1050.80	X
60	REAR SHOCK ABSORBER @231.70	463.40	X
61	FRONT BUMPER <i>Distorted</i>	585.60	✓
62	FRONT BUMPER SIDE HOLDER @35.40 <i>LH Dehd</i>	70.80	35.40
63	FRONT BUMPER SPONGE <i>crushed</i>	189.70	✓
64	FRONT BUMPER REINFORCEMENT <i>Dented</i>	327.40	✓
65	FRONT BUMPER SIDE GRILLE @139.20 <i>LH missing</i>	278.40	139.20
66	FRONT BUMPER FOG LAMP @295.60 <i>LH crushed</i>	591.20	295.60
67	FRONT BUMPER UNDERCOVER <i>Distorted</i>	289.40	✓
68	FRONT GRILLE <i>crushed</i>	391.60	✓
69	FRONT GRILLE TOP COVER <i>new</i>	177.60	X
70	HEADLAMP @1280.10 <i>crushed</i>	2560.20	✓
71	HEADLAMP ECU @281.20 <i>new</i>	562.40	X
72	BONNET <i>Dented</i>	885.40	✓
73	BONNET LOCK <i>Dehd</i>	69.90	✓
74	BONNET HINGE @58.20	116.40	X
75	BONNET INSULATOR	241.10	X
76	BONNET LOGO <i>new</i>	58.90	✓
77	FRONT FENDER @689.40 <i>Rips</i>	1378.80	X
78	FRONT FENDER INNER SHIELD @185.70 <i>new</i>	371.40	X
79	FRONT SUPPORT PANEL <i>Distorted</i>	874.10	✓
80	FRONT BRACE PANEL <i>Bent</i>	91.20	✓
81	AIR CON CONDENSER <i>Distorted</i>	1425.90	✓
82	AIR CON CONDENSER SIDE GUIDE @35.10 <i>LH Dehd</i>	70.20	35.10
83	AIR CON FAN BLADE <i>end</i>	90.40	✓
84	AIR CON FAN MOTOR <i>end</i>	340.20	✓
85	AIR CON SUCTION PIPE	390.40	X
86	AIR CON DISCHARGE PIPE	385.10	X
87	AIR CON LIQUID PIPE	341.70	X
88	RADIATOR <i>Distorted</i>	1546.20	✓
89	RADIATOR TOP HOSE <i>new</i>	39.50	X
90	RADIATOR FAN BLADE <i>end</i>	90.40	✓
91	RADIATOR FAN MOTOR <i>new</i>	349.10	X
92	RADIATOR FAN COWLING <i>crushed</i>	247.90	✓
93	RADIATOR <del>SPARE TANK</del> <i>Top Cover</i> <i>crushed</i>	195.80	✓
94	AIR CLEANER BOX	301.70	X
95	INTAKE MANIFOLD	760.40	X
96	BATTERY TRAY	89.60	X
97	BATTERY TOP BRACKET	20.40	X
98	WIPER WASH TANK	95.60	X
99	WIPER WASH TANK NECK	21.40	X
100	WIPER WASH TANK MOTOR	180.40	+
101	WIPER PANEL GARNISH	284.70	+

3693850  
2770350

	49709.50	
less 25%	12427.38	25%
	37282.13	
	30.00	✓
	30.00	✓
	30.00	✓
	<del>280.00</del>	200
	60.00	✓
	20.00	✓
	30.00	✓
	40.00	✓
	10.00	✓
	60.00	✓
	<del>280.00</del>	200
	480.00	380
	550.00	480
	60.00	✓
	40.00	✓
	40.00	✓
	<del>40.00</del>	80 ✓
	280.00	200
	<del>100.00</del>	60
	<del>3000.00</del>	2000
	30.00	✓
	30.00	✓
	30.00	✓
	30.00	✓
	20.00	✓
	20.00	+
	30.00	+
	<del>20.00</del>	10
	50.00	✓
	200.00	X
	30.00	X
	60.00	X
Total Parts	6010.00	

SPECIAL NETT ITEMS

- 1 REAR NUMBER PLATE *curd*
- 2 REAR NUMBER PLATE HOLDER *debd*
- 3 REAR BUMPER CLIPS *ku*
- 4 REVERSE SENSOR *Dngd*
- 5 REAR END PANEL SEALANT *ku*
- 6 REAR END PANEL TOP GARNISH CLIPS *ku*
- 7 TAILGATE INNER TRIM BOARD CLIPS *ku*
- 8 TAILGATE INNER SIDE TRIM BOARD CLIPS *ku*
- 9 TAILGATE INNER TOP BOARD CLIPS *ku*
- 10 TAILGATE GLASS SEALANT *ku*
- 11 TAILGATE GLASS SOLAR FILM *ku*
- 12 REAR CAMERA *Dngd*
- 13 REAR VIDEO RECORDER *Dngd*
- 14 REAR FENDER INNER TRIM BOARD CLIPS *ku*
- 15 REAR FENDER INNER UPPER TRIM BOARD CLIPS *ku*
- 16 REAR FENDER INNER SHIELD CLIPS *ku*
- 17 REAR FENDER GLASS SEALANT *40*
- 18 FLOOR PANEL INSULATION PAD *ku*
- 19 ROOF PANEL INNER TRIM BOARD CLIPS *ku*
- 20 REAR SEAT (3RD ROW) @1500 *Dngd*
- 21 FRONT NUMBER PLATE *3pistkd*
- 22 FRONT NUMBER PLATE HOLDER *ku*
- 23 FRONT BUMPER CLIPS *ku*
- 24 FRONT BUMPER UNDERCOVER CLIPS *ku*
- 25 FRONT GRILLE CLIPS *ku*
- 26 FRONT GRILLE TOP COVER CLIPS *ku*
- 27 BONNET INSULATOR CLIPS *ku*
- 28 AIR CON CONDENSER SIDE GUIDE CLIPS *ku*
- 29 RADIATOR COOLANT *ku*
- 30 BATTERY *ku*
- 31 WIPER PANEL GARNISH CLIPS *ku*
- 32 FRONT FENDER INNER SHIELD CLIPS *ku*

4250

# HIAP HONG MOTOR REPAIR

2 KAKI BUKIT AVE 2 #02-13 SINGAPORE 417921

Vehicle No. SLC3997X

S/N	DESCRIPTION	REPAIRER'S ESTIMATE (\$\$)	OUR ASSESSMENT (\$\$)
	<u>LABOUR</u>		
1	PANEL BEATING	<del>4500.00</del>	3800
2	SPRAY PAINTING	<del>3500.00</del>	3000
3	WIRING	<del>150.00</del>	100
4	TO APPLY TUFF COAT	<del>250.00</del>	220
5	TO REMOVE UPHOLSTERY & 3RD ROW SEATS	<del>380.00</del>	200
6	TO TRANSFER TAILGATE FITTINGS	<del>150.00</del>	80
7	TO REPLACE TAILGATE GLASS	<del>180.00</del>	120
8	TO REPLACE REAR FENDER GLASS	<del>200.00</del>	120
9	TO REMOVE REVERSE SENSOR	<del>100.00</del>	50
10	TO REMOVE REAR CAMERA	<del>100.00</del>	50
11	TO REMOVE REAR VIDEO RECORDER	<del>100.00</del>	50
12	TO REMOVE FUEL TANK	<del>150.00</del>	80
13	TO TRANSFER REAR DOOR FITTINGS	<del>150.00</del>	80
14	TO REMOVE REAR & CENTRE EXHAUST PIPES	<del>300.00</del>	80
15	TO REMOVE ROOF INNER TRIM BOARD	<del>200.00</del>	80
16	TO VACCUM GLASS FRAGMENTS & TO CLEAN UP INTERIOR	<del>120.00</del>	60
17	TO REMOVE CONDENSER & TO TOP UP AIR CON GAS	<del>120.00</del>	60
18	TO REMOVE RADIATOR & TO TOP UP COOLANT	<del>120.00</del>	60
19	TOWING FEES	60.00 ✓	
	Labour Total :	10730.00	
	TOTAL (PARTS & LABOUR):	54022.13	

8350

Total: 40303.50  
 H/s: 301K (Nett Value)  
 30 Days.

**LKK Auto Consultants hence notify**

**the Repairer of the following:**

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: