5/19/23, 3:41 PM Adjuster Report

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Allianz Insurance Singapore Pte. Ltd. **Our File No:** CS6/AIS23003730/KWP3M4

79 Robinson Road #09-01 Date: 19/05/2023 Singapore 068897

REFERENCE

Insured/Claimant: PTE LTD MERCEDES-BENZ FLEET MANAGEMENT SINGAPORE

Policy No: SP2003907937

Nature of Claim 21/03/2023 OD 202332006652 Date of Loss: Claim: No:

DESCRIPTION & IDENTIFICATION OF VEHICLE

SLC9194G Reg No:

Make & Model: M.G. HS, 1.5 (A) Engine No: 15E4E8AGLC290023 Reg. Date: 11/06/2021 (Man. Year: 2021) Chassis No: LSJA24U90MN024708

Colour: Metallic Pearl White Odometer: 37964 km

Engine Capacity: 1490 cc

Market Value/New Car

S\$133,000.00 Price:

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Engine Modification: Pre-accident Condition: Handbrake (Serviceable): Yes Nο

CONDITION OF TYRES

Front Tyre Size: 235/50R18 Rear Tyre Size: 235/50R18 Rear Left Side: Front Left Side: Michelin 8 mm Michelin 8 mm Front Right Side: Michelin 8 mm Rear Right Side: Michelin 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS		Repairer's	Adjuster's	Difference	Diff %
Parts		2,189.55	2,148.80	40.75	1.86
Miscellaneous Items		0.00	0.00	0.00	
Labour		2,130.00	720.00	1,410.00	66.20
Paintwork Labour		0.00	0.00	0.00	
Towing		0.00	0.00	0.00	
	Calculated Gross Total (S\$)	4,319.55	2,868.80	1,450.75	33.59
	- Excess (S\$)	700.00	700.00	0.00	0.00
	(S\$)	3,619.55	2,168.80	1,450.75	40.08
	+ GST 8.00/8.00% (S\$)	289.56	173.50	116.06	40.08
	Nett Amount (S\$)	3,909.11	2,342.30	1,566.81	40.08

INSPECTION

Date of Assignment: 11/04/2023

Tong Luck Auto Pte Ltd (HQ) 160 Sin Ming Drive, #07-01/06 Sin Ming AutoCity Date Inspected: 12/04/2023 Inspected At:

Singapore 575722

Estimated Period of Repair: 2.0 days

Adjuster: KENNETH KONG Manager: XinYu

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 19 May 2023)

Parts: M1-SUV M.G. HS 1.5 (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SLC9194G)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with

the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*HEADLAMPASSY - LH (WCP)	Cut	1,850.00 F	*1,850.00 F
2	1		*FRONT BUMPER SIDE RETAINER - LH (WCP)	Distorted	58.00 F	*58.00 F
3	1		*FRONT BUMPER CLIPS 15PIECES (S/N)	Necessary	90.75 FS	*50.00 FS
F=Fra	ınchise	part. S=SpcNe	tt.	_		
				Sub Total (S\$)	1,998.75	1,958.00
	+ Margin on L,N Items 10.00/10.00% (S\$)			190.80	190.80	
				Total Parts (S\$)	2,189.55	2,148.80
	Report was unsubmitted during this print-out.					

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Lab	our Items			
1	TO REMOVE AND REFIT FRONT BUMPER SENSOR	New	100.00	0.00
2	TO CHECK AND RECTIFY WIRING SYSTEM	New	80.00	20.00
3	TO PANEL BEAT AND REPAIR FRONT BUMPER, LH FRONT FENDER, INCLUDING REPLACEMENT OF PARTS AND ALIGN WHERE NECESSARY, TO REFIT AND ADJUST THE SAME	New	800.00	200.00
4	TO PUTTY AND SPRAY PAINT ON THE AFFECTED AREAS	New	800.00	250.00
5	TO RESET AND REPROGRAM HEADLAMP FAULT CODE	New	350.00	250.00
	Gross Labour Cost (S\$)		2,130.00	720.00
	Report was unsubmitted during this	print-out		

< END OF ESTIMATES >