



FALCON-AIR

INSURER: Allianz Insurance Singapore Pte. Ltd. (HQ)

PARTICULARS OF CLAIM

Claim Type:	OD (OWN DAMAGE)	Ref. No:	
Policy No:	SP2001257650	Date of Loss:	10/04/2023
Vehicle Reg. No.:	SGM6199U	Driveable?	
Driver Age/Info:		Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	XU BINGTAO		
<hr/>			
Make/Model:	AUDI A6, 1.8 TFSI S-TRONIC (A)	Vehicle Reg. Date:	26/04/2016
Vehicle Colour:	BLACK		
Engine No:	CYG009519	Chassis No:	WAUZZZ4G8GN080280
Odometer:	80000 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	10		
Present Location:	FALCON-AIR AUTO SERVICES PTE LTD (TAMPINES)		

*not allowed
see
Excess \$?
12/4/23
2/55*

*take photo after repair
6 days.*

COST OF CLAIMS

	Amount
Parts	23,797.50
Miscellaneous Items	0.00
Labour	4,100.00
Paintwork Labour	0.00
Towing	0.00
<hr/>	
Gross Total (\$\$)	27,897.50
+ GST 8.00% (\$\$)	2,231.80
Nett Amount (\$\$)	30,129.30

This claim is handled by: JOSHUA NG

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 11 Apr 2023)
Parts: 143 AUDI A6 1.8 TFSI S-tronic (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's (Price-denominated Standard List)
Print Code: Falcon-Air Auto Services Pte Ltd/SGM6199U/11/04/2023 09:34
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount	
1	1		*O/S HEADLAMP <i>holder</i>	0.00	0.00	*3,500.00 F	✓
2	1		*O/S HEADLAMP LOWER BRACKET	0.00	0.00	*150.00 F	✓
3	1		*O/S HEADLAMP PANEL	0.00	0.00	*240.00 F	?
4	1		*FRONT SUPPORT PANEL	0.00	0.00	*780.00 F	?
5	1		*O/S FRONT FENDER <i>Buc</i>	0.00	0.00	*840.00 F	✓
6	1		*O/S FRONT FENDER INNER SHIELD <i>Torn</i>	0.00	0.00	*260.00 F	✓
7	1		*O/S FRONT FENDER INNER SHIELD CLIPS <i>new</i>	0	0.00	*40.00 FS	✓
8	1		*O/S FRONT FENDER INNER SHIELD RIVETS <i>new</i>	0	0.00	*60.00 FS	✓
9	1		*O/S FRONT FENDER STONE GUARD STICKER <i>new</i>	0	0.00	*150.00 FS	✓
10	1	<i>fuel</i>	*O/S REAR DOOR STONE GUARD STICKER <i>new</i>	0	0.00	*150.00 FS	✓
11	1		*RADIATOR GRILLE	0.00	0.00	*1,100.00 F	?
12	1		*FRONT BUMPER <i>Deform shu?</i>	0.00	0.00	*1,610.00 F	✓
13	1		*O/S FRONT BUMPER SIDE RETAINER <i>one</i>	0.00	0.00	*155.00 F	✓
14	1		*FRONT BUMPER CLIPS <i>new</i>	0	0.00	*40.00 FS	✓
15	1		*FRONT BUMPER RIVETS <i>new</i>	0	0.00	*60.00 FS	✓
16	1		*O/S FRONT BUMPER AIR GRILLE <i>new</i>	0.00	0.00	*245.00 F	✓
17	1		*O/S FRONT BUMPER AIR GRILLE CHROME <i>new</i>	0.00	0.00	*165.00 F	✓
18	1		*O/S FRONT BUMPER SENSOR <i>11</i>	0.00	0.00	*240.00 F	X
19	4		*FRONT BUMPER SENSOR ORING <i>11</i>	0.00	0.00	*60.00 F	X
20	4		*FRONT BUMPER SENSOR BRACKET <i>11</i>	0.00	0.00	*220.00 F	X
21	1		*FRONT BUMPER TOP COVER <i>Torn</i>	0.00	0.00	*195.00 F	✓
22	1		*O/S FRONT AIR GUIDE	0.00	0.00	*160.00 F	?
23	1		*O/S FRONT TYRE <i>SVC</i>	0.00	0.00	*400.00 F	X
24	1		*O/S FRONT RIM <i>new</i> <i>pos s/w</i>	0.00	0.00	*1,050.00 F	200
25	1		*O/S FRONT SHOCK ABSORBER	0.00	0.00	*450.00 F	?
26	1		*O/S FRONT SHOCK LOWER ARM	0.00	0.00	*610.00 F	?
27	1		*O/S FRONT SHOCK CONTROL ARM	0.00	0.00	*610.00 F	?
28	1		*O/S FRONT WHEEL HUB	0.00	0.00	*420.00 F	?
29	2		*O/S FRONT UPPER ARM	0.00	0.00	*820.00 F	?
30	1		*O/S FRONT LINKAGE	0.00	0.00	*95.00 F	?
31	1		*FRONT ANTI ROLL BAR	0.00	0.00	*650.00 F	?
32	1		*O/S FRONT DRIVESHAFT	0.00	0.00	*1,800.00 F	?
33	1		*STEERING RACK AND PINION	0.00	0.00	*2,500.00 F	?
34	1		*O/S SIDE SKIRT <i>R</i>	0.00	0.00	*1,800.00 F	X
35	1		*O/S SIDE SKIRT CLIPS <i>new</i>	0	0.00	*60.00 FS	X

F=Franchise part. S=SpcNett.

Sub Total (\$\$)	21,685.00
+ Margin on L,N Items 10.00% (\$\$)	2,112.50
Total Parts (\$\$)	23,797.50

Falcon-Air Auto Services Pte Ltd/SGM6199U/11/04/2023 09:34. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

No	Particulars	Lab.Type	Amount
Labour Items			
1	TO FOCUS HEADLAMP	New	20 50.00
2	TO CODE AND PROGRAM HEADLAMP MODULE	New	100 280.00
3	TO REPLACE FRONT UNDERCARRIAGE	New	300 380.00
4	TO FIT TYRE ON NEW RIM PLUS BALANCING	New	11X 50.00
5	TO CONDUCT 4 WHEEL COMPUTERISE WHEEL ALIGNMENT	New	100 120.00
6	TO DIAGANOSE AND RESET CHECK LIGHTS	New	? 300.00
7	TO REMOVE/REFIX AIR CON CONDENSER, PIPE ETC TO VACUUM AND TOP UP AIR CON GAS	New	? 120.00
8	TO REPAIR INNER PANEL, ACCIDENT DAMAGE AREA, CUT/REWELD FRONT SUPPORT PANEL, REPLACEMENT OF PARTS AND ALIGN THE SAME	New	600 1,000.00
9	TO PUTTY AND SPRAY PAINT ON ACCIDENT DAMAGE AREA	New	1100 1,800.00
Gross Labour Cost (\$\$)			4,100.00

Falcon-Air Auto Services Pte Ltd/SGM6199U/11/04/2023 09:34. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

FALCON-AIR AUTO SERVICES PTE LTD

(a subsidiary of Falcon-Air Holdings Pte Ltd)

Head Office : Blk 176 Sin Ming Drive #01-06/07/13, #05-17 Sin Ming Autocare S(575721) Tel: 6452-0880 / 6458-0880 Fax: 6454-7862

Branches : Tampines St 93 Blk 9006 #01-200 S(528840) Tel: 6789-7997 Fax: 6788-7997 • No 8 Pandan Loop S(128226) Tel: 6779-5665 Fax: 6779-1110
Website: www.falconair.com.sg Email: email@falconair.com.sg

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: