

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/HLA23003753/TNY3M4**Date:** 02/08/2023REFERENCE

Handling Insurer:	HL Assurance Pte Ltd	Policy No:	MP314031
Claimant Vehicle No :	SMR9201D	Insured Vehicle No :	SLS6907C
Date of Loss:	08/04/2023	Nature of Claim:	TP
		Claim No:	MPC04086

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMR9201D		
Make & Model:	SUBARU XV, 2.0 I-S EYESIGHT AWD CVT (A)	Engine No:	FB20CG81004
Reg. Date:	31/01/2020 (Man. Year: 2019)	Chassis No:	JF1GT7KL5LG093503
Colour:	Silver	Odometer:	46593 km
Engine Capacity:	1995 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/55R18	Rear Tyre Size:	225/55R18
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,164.10	1,710.60	3,453.50	66.88
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,630.00	1,630.00	5,000.00	75.41
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	11,794.10	3,340.60	8,453.50	71.68
+ GST 8.00/8.00% (S\$)	943.53	267.25	676.28	71.68
Nett Amount (S\$)	12,737.63	3,607.85	9,129.78	71.68

INSPECTION

Date of Assignment:	11/04/2023	
Date Inspected:	19/04/2023	Inspected At: Motor Image Enterprises Pte Ltd (Leng Kee) 25 Leng Kee Road Singapore 159097
Estimated Period of Repair:	3.0 days	

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** HUEY YON*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 02 Aug 2023)
Parts:	M1-SUV	SUBARU XV 2.0 I-S EYESIGHT AWD CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMR9201D)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SUNDRIES	Necessary	100.00 FS	*20.00 FS
2	1		*BUMPER FACE F XUV	Cracked	610.50 FS	*610.50 FS
3	1		*ENR ABSORB FOAM XUV	Not Necessary	61.60 FS	*- FS
4	1		*BRKT CORNER F FHILH	Not Necessary	37.00 FS	*- FS
5	1		*BRKT SD F XUV LH	Not Necessary	7.40 FS	*- FS
6	1		*BEAM COMPL F EU	Not Necessary	355.60 FS	*- FS
7	1		*COVER FOG F XUV LH	Cut	48.10 FS	*48.10 FS
8	1		*LAMP ASSY HEAD	Not Necessary	2,911.90 FS	*- FS
9	1		*FRONT UNDER SPOILER GT	Deformed	1,032.00 FS	*1,032.00 FS
Total Parts (S\$)						5,164.10
						1,710.60

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	REPLACE FRONT BUMPER,ENERGY ABSORBER AND BUMPER BEAM	New	3,500.00	600.00
2	RESPRAY FRONT BUMPER & BUMPER BEAM	New	2,500.00	600.00
3	TO CONDUCT FRONT LIGHTING TEST	New	50.00	0.00
4	FAULT DIAGNOSTIC (RESET)	New	280.00	280.00
5	REMOVE & REFIX FRONT HEADLAMP WASHER AND PIPING	New	150.00	0.00
6	REMOVE & INSTALL FRONT UNDER SPOILER	New	150.00	150.00
Gross Labour Cost (S\$)			6,630.00	1,630.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >