



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD  
300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV No. AC2303907  
INV Date 19/06/2023  
Reference CC4/LPC23003827/Upa3q2  
Code LPC2

#### PROFESSIONAL SERVICE FEE

Vehicle No. SDT 1909U  
Insured Veh. XD 8942Z  
Claim No. 22/23/23/VC05/027246  
Policy No. Z22VC05014755  
Accident Date 11/04/2023  
Inspection Date 13/04/2023

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>350.00</b>
<b>GST (8%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>378.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

300 BEACH ROAD

#17-04/07 THE CONCOURSESINGAPORE 199555

Ref: CC4/LPC23003827/Upa3q2

Date: 19/06/2023

Code: LPC2

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	XD 8942Z	<b>Veh. Inspected</b>	SDT 1909U
<b>Policy No.</b>	Z22VC05014755	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	22/23/23/VC05/027246	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	CHARMAINE KONG	<b>Assign Date</b>	12/04/2023

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	TOYOTA PREVIA 8 SEATER (A)	<b>c.c</b>	2362
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2010
<b>Chassis No.</b>	JTEGD52M40A022976	<b>Colour</b>	GREY
<b>Odometer</b>	247801 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	215/60 R16	TOURADOR	6 mm
<b>L/H Front Tyre</b>	215/60 R16	TOURADOR	6 mm
<b>R/H Rear Tyre</b>	215/60 R16	TOURADOR	6 mm
<b>L/H Rear Tyre</b>	215/60 R16	TOURADOR	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	11/04/2023	<b>Inspection Date</b>	13/04/2023
<b>Survey held at</b>	SME MOTOR PTE LTD 1 KAKI BUKIT AVE 6 #02-15 (AUTOBAY @KAKI BUKIT) SINGAPORE 417883		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

<b>ESTIMATED NORMAL PERIOD FOR REPAIR:</b>	<b>5 Working Days</b>
--	-----------------------



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SDT 1909U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	FRT BONNET (WCP)	BUCKLED	245.00	245.00
2	FRT BONNET HINGES (WCP)	BENT	100.00	100.00
1	FRT BONNET LOCK (WCP)	TWISTED	65.00	65.00
1	FRT BONNET INSULATOR (WCP)	NOT NECESSARY	120.00	-
8	INSULATOR CLIPS (WCP)	NECESSARY	16.00	16.00
1	FRT GRILLE (WCP)	CRACKED	245.00	245.00
1	GRILLE OUTER GARNISH (WCP)	CRACKED	145.00	145.00
1	GRILLE CENTRE LOGO (WCP)	NECESSARY	50.00	50.00
4	GRILLE CLIPS (WCP)	NECESSARY	8.00	8.00
1	FRT BUMPER (WCP)	DISTORTED	350.00	350.00
10	FRT BUMPER CLIPS (WCP)	NECESSARY	20.00	20.00
2	HEADLAMP (HID ) (WCP)	HOLDER CRACKED / BROKEN	1,500.00	1,500.00
1	HEADLAMP SUPPORT PANEL (WCP)	BENT	580.00	580.00
1	FRT BUMPER REINFORCEMENT (WCP)	TO REPAIR SEE LABOUR	150.00	-
1	BRACE PANEL (WCP)	BENT	65.00	65.00
1	AIRCON CONDENSER (WCP)	BENT / PUNCTURE	580.00	580.00
1	RADIATOR (WCP)	BENT / PUNCTURE	650.00	650.00
1	RADIATOR MOTOR (WCP)	* CHECK	195.00	-
1	RADIATOR MOTOR COWLING (WCP)	CRACKED	175.00	175.00
1	RADIATOR FAN BLADE (WCP)	* CHECK	95.00	-
1	RADIATOR TOP HOSE (WCP)	* CHECK	45.00	-
1	FRT BUMPER TOP RUBBER SEAL (WCP)	TORN	50.00	50.00
1	RADIATOR TOP GARNISH (WCP)	DISTORTED	65.00	65.00
1	RADIATOR SPARE TANK (WCP)	* CHECK	175.00	-
1	WASHER TANK NECK (WCP)	DEFORMED	30.00	30.00
1	AIRCON LIQUID PIPE (WCP)	NOT NECESSARY	450.00	-
1	AIRCON DISCHARGE PIPE (WCP)	NOT NECESSARY	195.00	-
1	AIRCON COOLING PIPE (WCP)	NOT NECESSARY	280.00	-
2	RADIATOR TOP BRACKET @\$28.00 (WCP)	BENT	56.00	56.00

Report Ref No. CC4/LPC23003827/Upa3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BATTERY BRACKET (WCP)	BENT	50.00	50.00
1	RESONATOR BOX (WCP)	NOT NECESSARY	95.00	-
1	HEADLAMP SUPPORT TOP GARNISH (WCP)	TORN	145.00	145.00
8	TOP GARNISH CLIPS (WCP)	NECESSARY	16.00	16.00
1	UPPER BLOWER NECK (WCP)	* CHECK	65.00	-
1	AIR INTAKE HOSE (WCP)	DISTORTED	95.00	95.00
1	AIR CLEANER BOX (WCP)	CRACKED	380.00	380.00
1	ENGINE OIL DIPSTICK (WCP)	DAMAGED	38.00	38.00
	COST PLUS 20%		1,516.80	1,143.80
			9,100.80	6,862.80
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	RADIATOR COOLANT (SN)	NECESSARY	25.00	20.00
			25.00	20.00
	<b><u>LABOUR</u></b>			
	WIRE CHECKING .		30.00	20.00
	REMOVE & REFIX AIRCON AND GAS .		100.00	100.00
	LABOUR CHARGE.INCLUSIVE OF THE REPAIR OF FRT BUMPER REINFORCEMENT.		700.00	600.00
	SPRAY PAINTING.		700.00	600.00
			1,530.00	1,320.00
<b>GRAND TOTAL</b>			<b>10,655.80</b>	<b>8,202.80</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (REPAIR COST NOT CONCLUDE) (EXCLUDE CHECK ITEMS S\$690.00 NETT)</b>				<b>6,550.00</b>

Report Ref No. CC4/LPC23003827/Upa3q2

CHUA KANG SENG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SDT 1909U

## INSPECTION

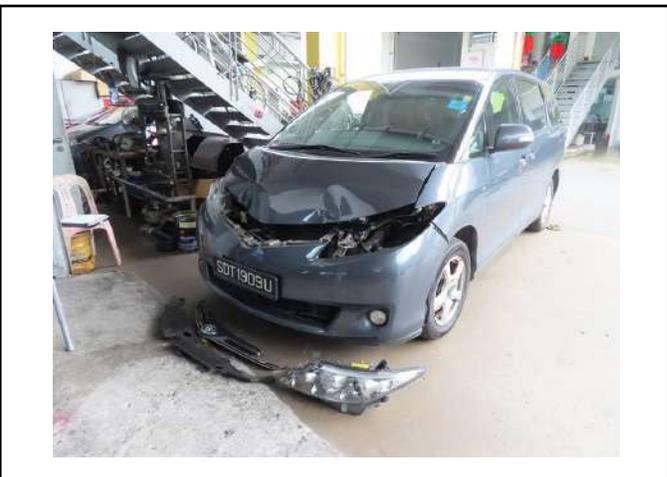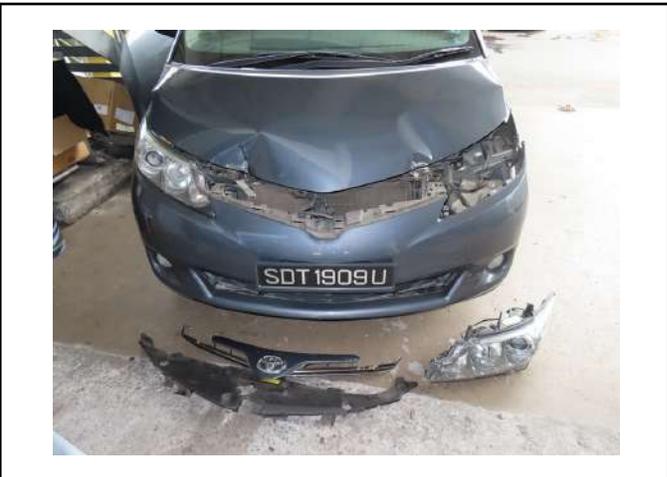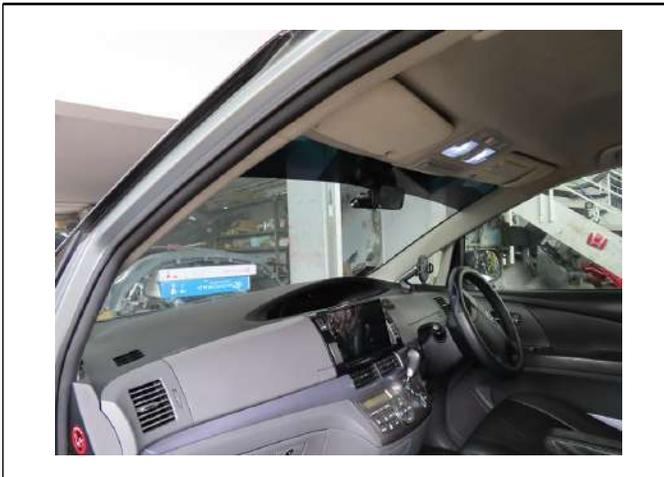







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

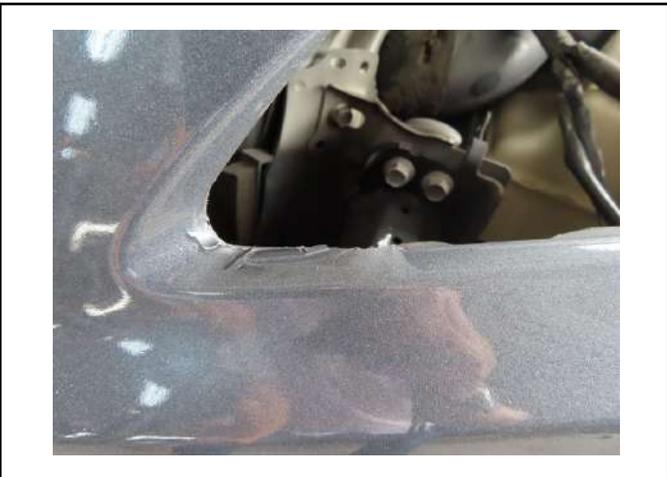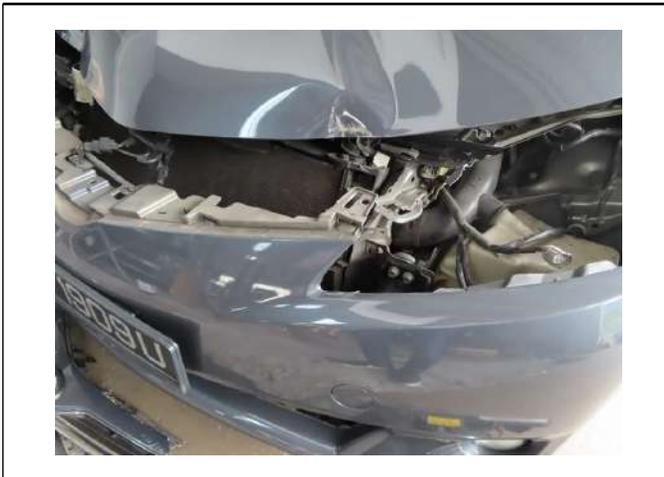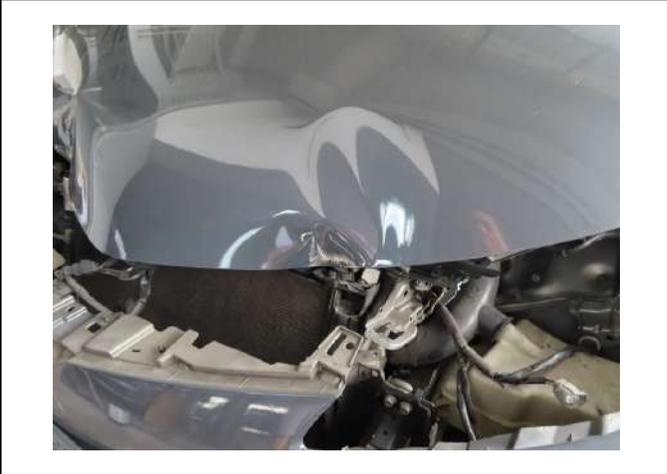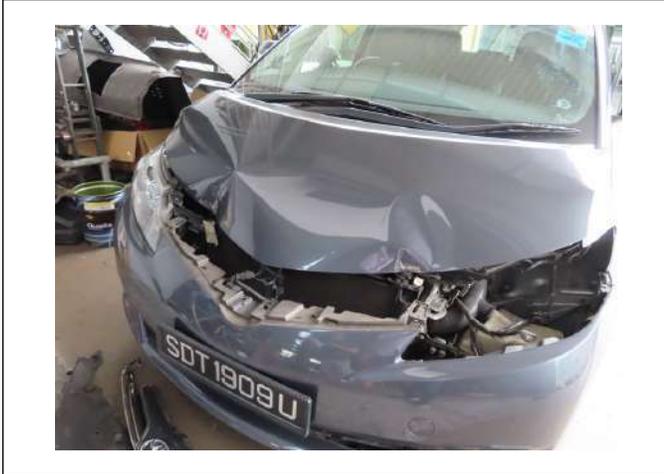




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

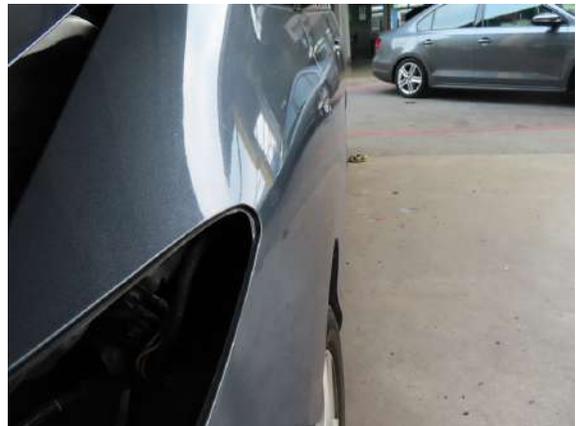







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

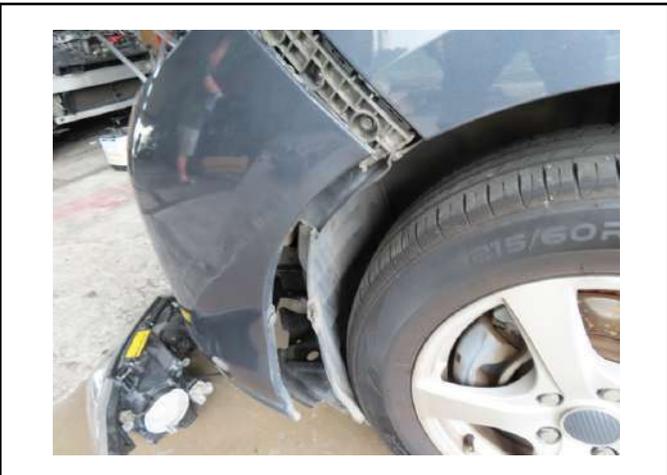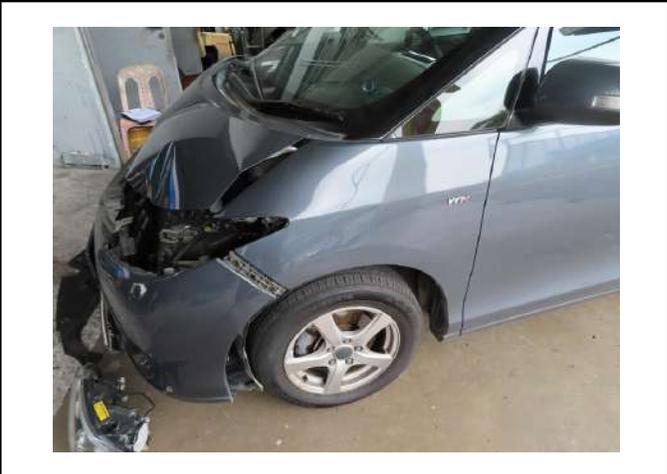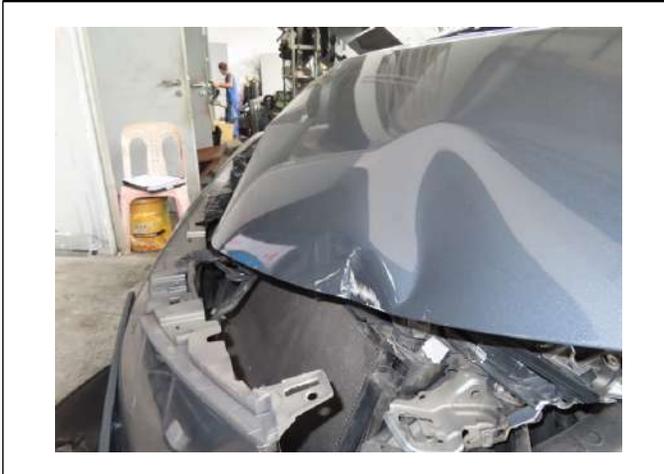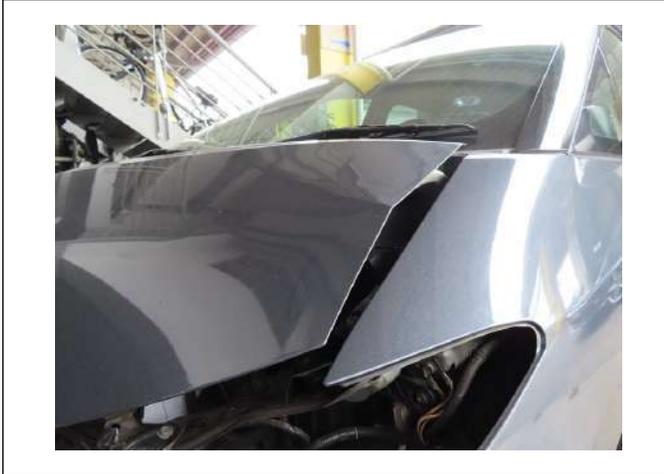







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

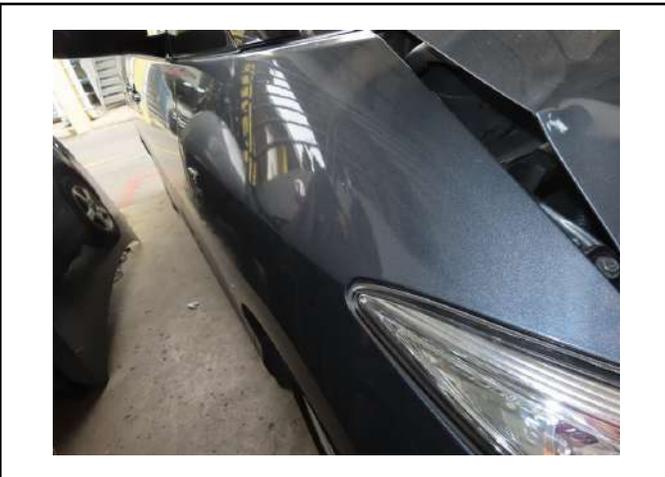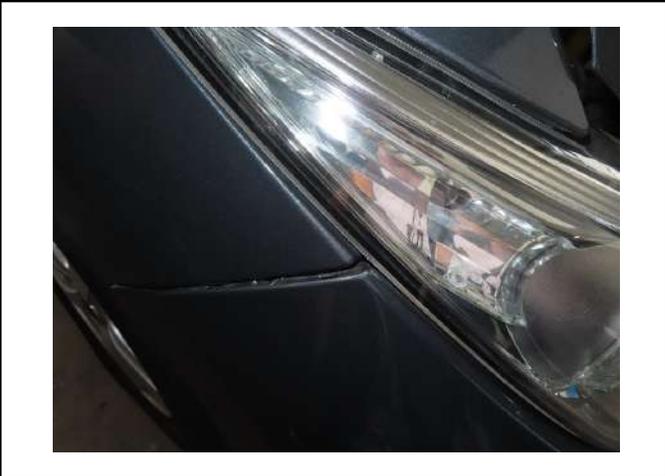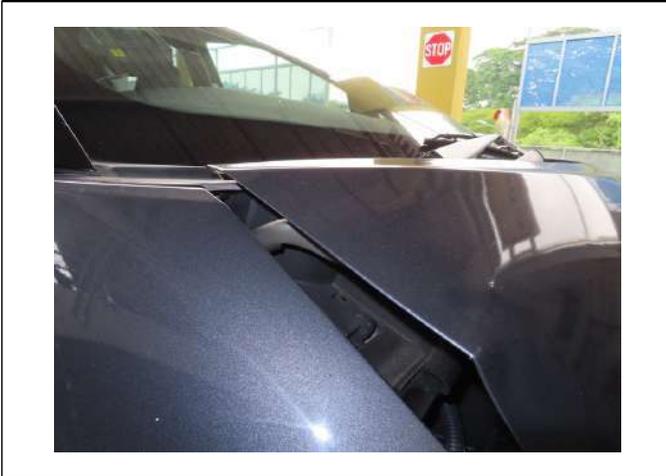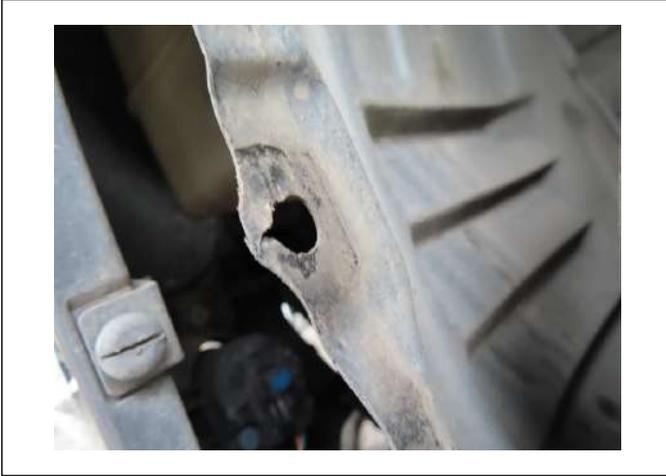





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

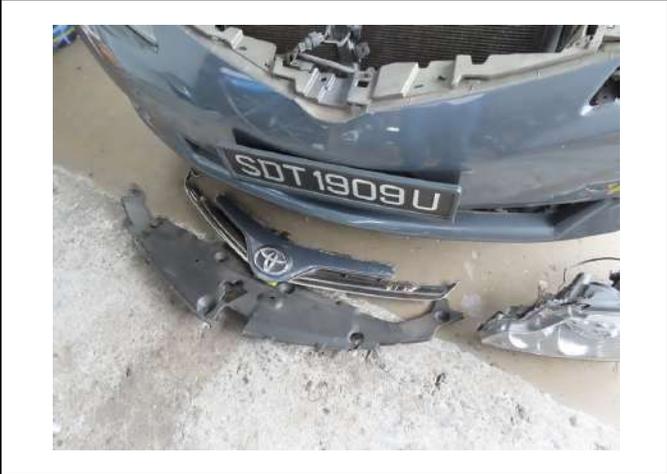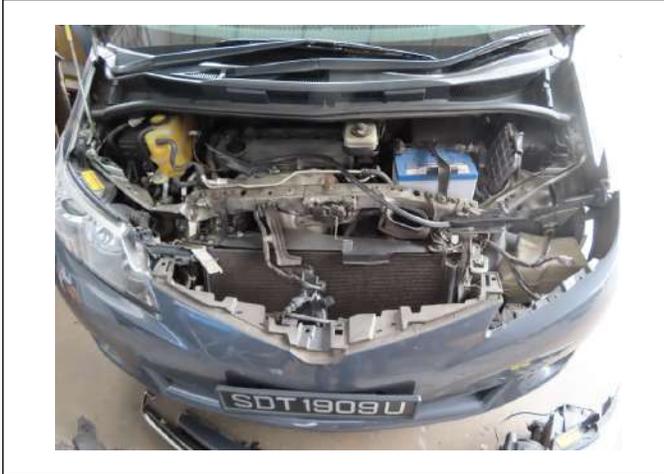






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

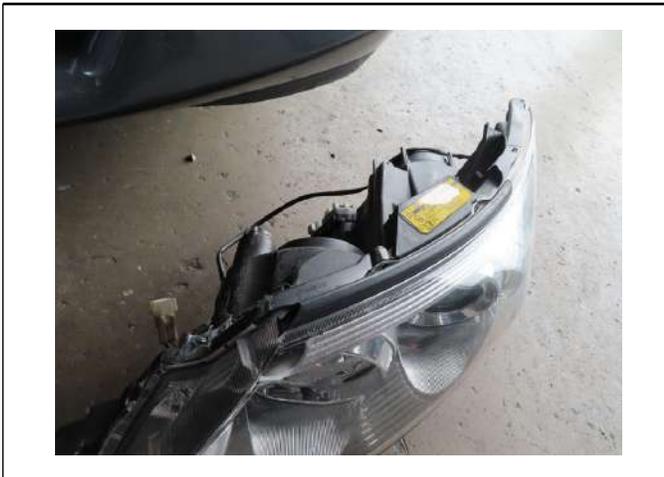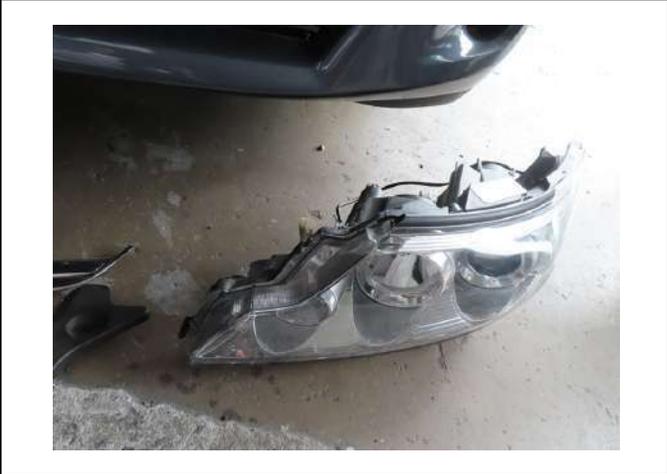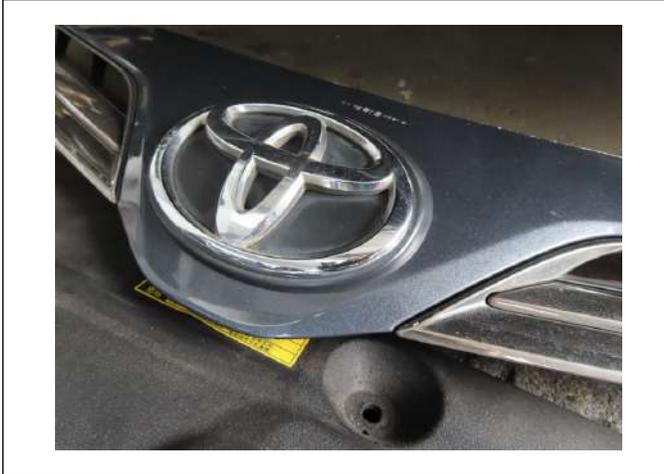








# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

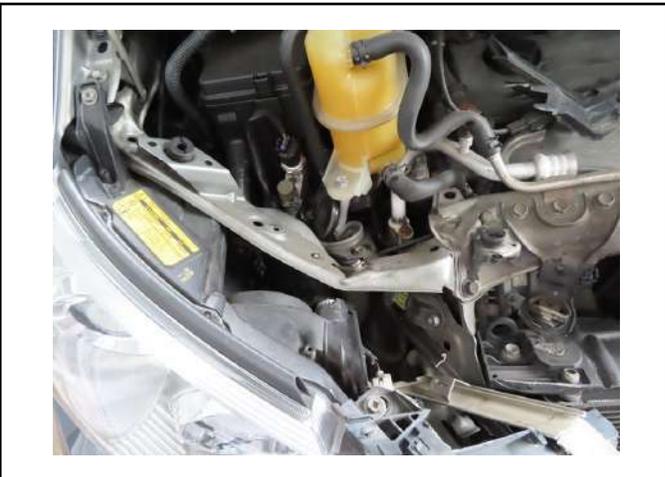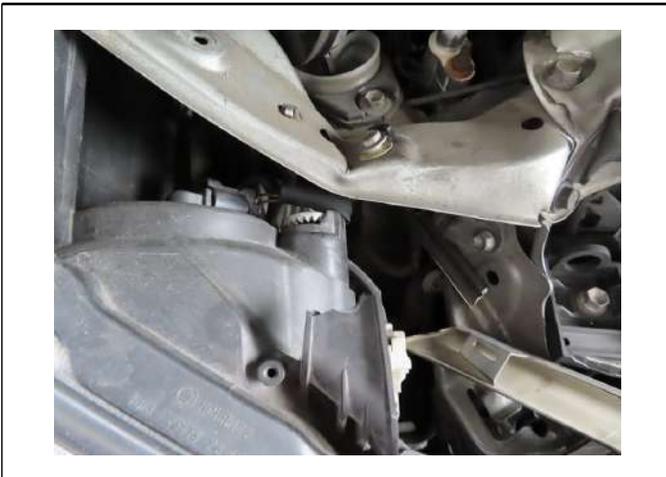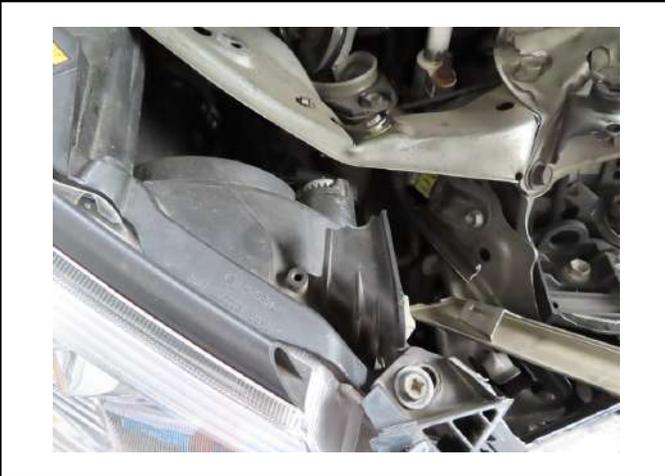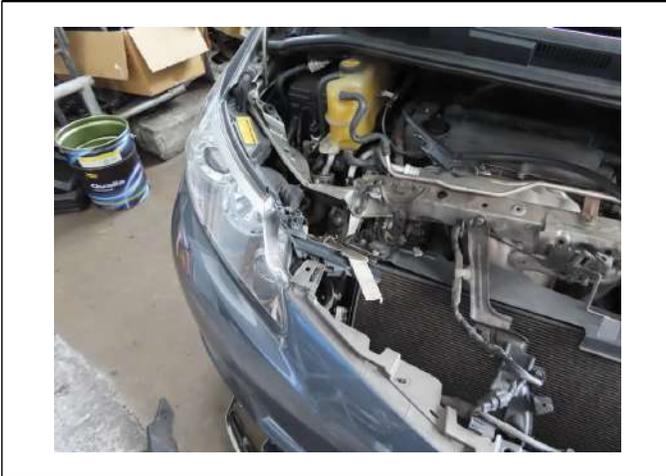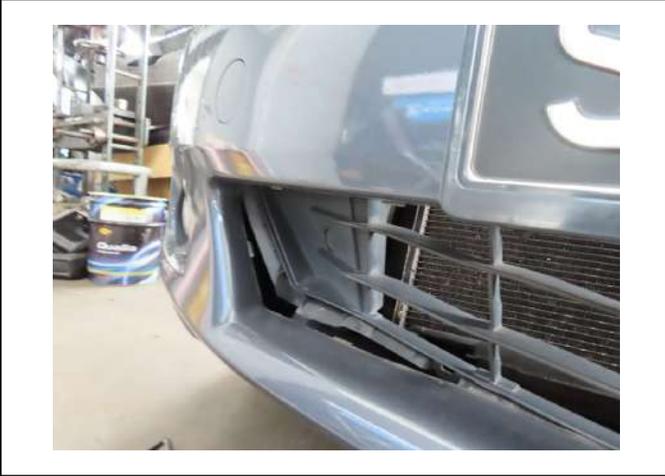



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

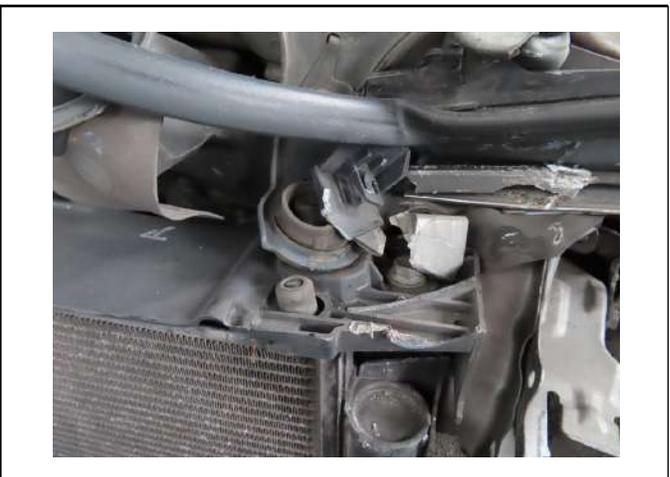



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

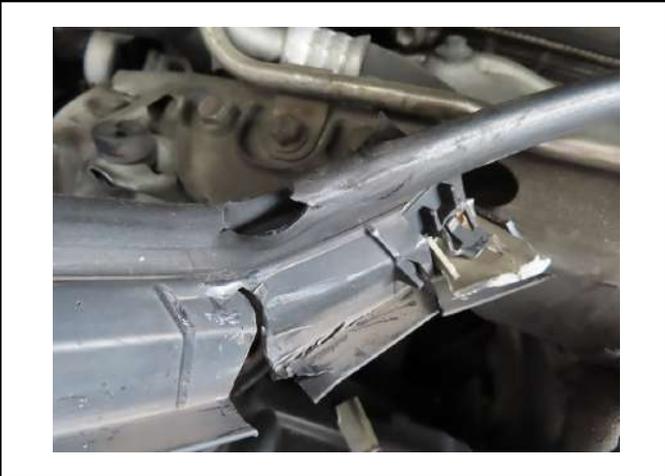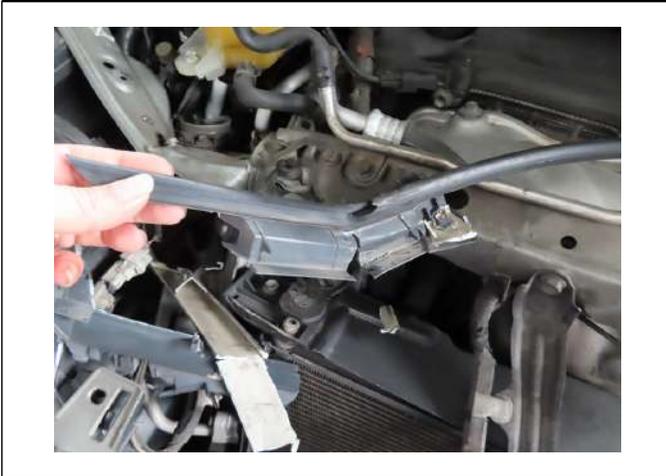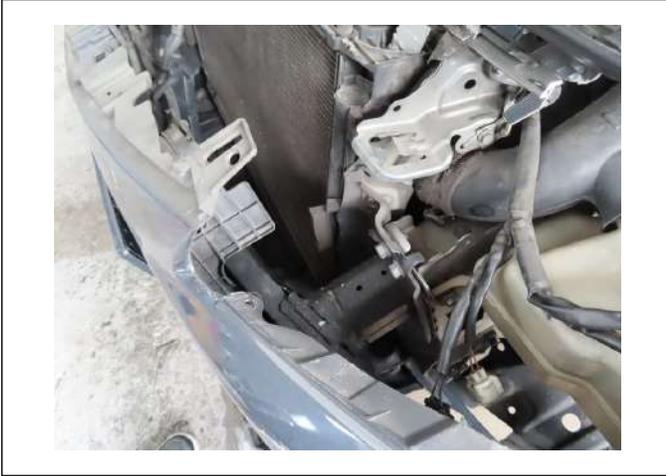



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

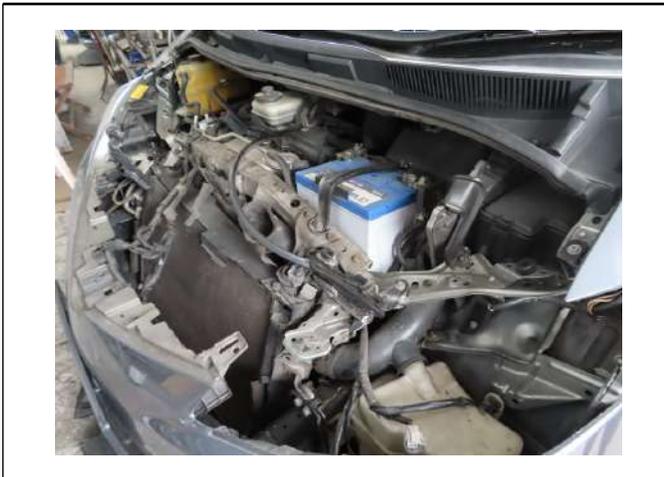



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SDT 1909U

RE-INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

