



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

PRE-REPAIR INSPECTION REPORT

HSBC LIFE (SINGAPORE) PTE LTD
10 MARINA BOULEVARD #48-01 MARINA BAY
FINANCIAL CENTRE TOWER 2 SINGAPORE
018983
ATTN: HO WINNIE

Ref: CS3/HSB23003986/Wqp3m4
Date: 15/05/2023
Code: HSB

1. Policy Particulars :- (THIRD PARTY CLAIM)

| | | | |
|---------------------|--------------|-----------------------|------------|
| Insured Veh. | SHA 9841E | Veh. Inspected | SCJ 666R |
| Policy No. | VFX/P2419140 | Coverage (\$) | 0.00 |
| Claim No. | S3M04LKI | Excess (\$) | 0.00 |
| Assign From | HO WINNIE | Assign Date | 18/04/2023 |

2. Vehicle Particulars & Condition

 
| | | | |
|-------------------------|-------------------|---------------------|--------------------|
| Make & Model | MAZDA 6 | c.c | 1998 |
| Engine No. | HIDDEN | Year of Reg. | 2015 |
| Chassis No. | JM6GJ1071F0144723 | Colour | BLUE |
| Odometer | 159288 KM | Steering | IN ORDER |
| Brakes | IN ORDER | Modification | STANDARD ALLOY RIM |
| General | GOOD | | |

3. Conditions of Tyres

| | Size | Make | Balance |
|-----------------------|------------|----------|---------|
| R/H Front Tyre | 225/55 R17 | MICHELIN | 6 mm |
| L/H Front Tyre | 225/55 R17 | MICHELIN | 6 mm |
| R/H Rear Tyre | 225/55 R17 | MICHELIN | 6 mm |
| L/H Rear Tyre | 225/55 R17 | MICHELIN | 6 mm |

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY.



5. General Information

| | | | |
|-----------------------|---|----------------------------|-------------------------|
| Accident Date | 11/04/2023 | Inspect Date / Time | 18/04/2023 (11:30 AM) |
| Survey held at | 60 JALAN LAM HUAT #07-35/36 CARROS CENTRE S737869 | | |
| Repairer | WELLTAC AUTO SPRAY CENTRE | | |

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.
D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$3,000-\$4,000

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **4 Working Days**

Report Ref No. CS3/HSB23003986/Wqp3m4

Inspected By

MUHAMMAD AKID BIN MOHAMED KAMAL

Asst. Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE, MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.