

**CHOW AUTOMOBILE ASSESSOR & SURVEYOR**  
**BLK 299, BUKIT BATOK STREET 22, #02-10, SINGAPORE 650299.**  
(Business Reg.No. 282126/00K)  
**TEL : 6665 4133**  
Email: chowauto@singnet.com.sg

**VEHICLE INSPECTION REPORT NO.: C/TPC/01/23**

Name:	KAREN CHOO YOKE LIAN		
Policy No.:	D.O.A. 27.11.22	Sum Insured:	3RD PARTY CLAIM
Reg. No.:	SKX 8214 R	Condition:	GOOD
Model:	VOLKSWAGEN 1.4 AUTO	Year:	2014
Eng.No.:	-	Colour:	M.SILVER
Chassis No.:	WVWZZZAUZFW077599	Odometer:	108,281 KM

**CONDITION OF TYRES:**

R/F TYRE :	MICHELIN 225/40 ZR 18	Worn:	40%
R/R TYRE :	MICHELIN 225/40 ZR 18	Worn:	40%
L/F Tyre:	MICHELIN 225/40 ZR 18	Worn:	40%
L/R Tyre:	MICHELIN 225/40 ZR 18	Worn:	40%
Spare Tyre:	-	Worn:	-

**EXTRA FITTINGS:**

Air-con:	CONCEL	Rad./Tape:	VW
----------	--------	------------	----

As Requested By: THE ABOVE      On: 5.12.22  
The Above Vehicle Was Inspected On: 5.12.22      At:  
LEE LUEW SING MOTORS, NO.10 ANG MO KIO IND PARK2A #03-10,  
AMK AUTOPOINT, SINGAPORE 568047.

35      photos were taken at the time of inspection and are attached

The Repairer's estimate was for a total amount of-----	\$ 9,476.00
After adjustments, the estimate was revised to-----	\$ 8,346.00
However, the repairer's had agreed to accept a lump sum of -----	\$ 6,700.00
The Repairer's were NOT AUTHORISED	
to proceed with the repairs at the above figure in accordance	
with the Appendix "A" attached to this report, subject their	
collecting from the owner the Excess of-----	N.A
The Nett total after deducting Excess-----	\$ 6,700.00

It is estimated that the repairs will take about ----- SIX days to complete.

**CHOW AUTOMOBILE ASSESSOR & SURVEYOR**  
**BLK 299, BUKIT BATOK STREET 22, #02-10, SINGAPORE 650299.**  
(Business Reg.No. 282126/00K)  
TEL : 6665 4133  
Email: chowauto@singnet.com.sg

GENERAL DESCRIPTION OF DAMAGE

REPORT NO.: C/TPC/01/23

SKX 8214 R VW GOLF 1.4 AUTO

The damage was due to an impact to the FRONT PORTION of the vehicle.



Front support panel bent, rad. Grille cracked, both headlamp housing cracked, front bumper bent and cut, tow cover cut, lower grille cracked, R/F headlamp washer cut, R/F bumper lamp cracked, R/F bumper retainer cracked, R/F fender bent and twisted, R/F parking sensor cut, front no.plate and base bent.

REMARKS

Brakes and steering in order.

Survey was carried out w/o prejudice.

Lump sum repair at \$6,700.00 net

Vehicle was reinspected on 7/12/22 & 10.12.22.

DATE: 13.2.23

*Chow Cher Pow*

**C.P.CHOW**  
**VEHICLE APPRAISER**

<u>REPLACEMENT OF PARTS</u>	<u>REPAIRER'S ESTIMATE</u>	<u>REMARKS</u>	<u>REVISED</u>
TO SUPPLY (SKX 8214 R VW GOLF 1.4 AUTO)	\$	YEAR: 2014 (D.O.A. 27.11.22)	\$
1 pc. Rad. Support panel	1,050.00	Replace	1,050.00 <i>cur</i>
1 pc. Rad. Grille	750.00	"	750.00 <i>446 cur</i>
1 pc. Rad. Grille emblem "VW"	135.00	"	135.00 <i>120 nec</i>
2pcs. Headlamp assy	1,250.00	"	<i>LH X M</i> 1,250.00 <i>625 cur</i>
2pcs. Headlamp assy panel	320.00	"	<i>LH X M</i> 320.00 <i>160 bt</i>
2pcs. Headlamp lower bracket	90.00	"	<i>LH X M</i> 90.00 <i>45 dis</i>
1 pc. Front bumper	1,450.00	"	1,450.00 <i>1075 de</i>
1 pc. Front bumper reinforcement	695.00	"	695.00 <i>576 bt</i>
2pcs. Front bumper retainer	60.00	"	60.00 <i>de</i>
1 pc. Front bumper inner sponge	190.00	"	190.00 <i>87 de</i>
1 pc. Front bumper tow cover	50.00	"	50.00 <i>de</i>
1 pc. R/F headlamp nozzle cover	72.00	"	72.00 <i>de</i>
1 pc. R/F headlamp nozzle	58.00	"	58.00 <i>cur</i>
1 pc. R/F side lamp	190.00	"	190.00 <i>cur</i>
1 pc. Front bumper lower grille	280.00	"	280.00 <i>de</i>
2pcs. Front bumper R/H parking sensor	600.00	"	200.00 <i>nw</i>
	7,240.00		6,840.00
Less 10%	724.00	Less 10%	684.00
	6,516.00		6,156.00
1set Rad. Grille clips	50.00	sn necessary	50.00 <i>sn 20 nec</i>
1set Front bumper clips	60.00	"	60.00 <i>" 30 nec</i>
1 pc. Front no. plate c/w holder	50.00	" replace	50.00 <i>" 45 bt</i>
			95
<u>LABOUR CHARGES :</u>			
Remove front lamps, replace damaged lamps, refit same, refocus headlamps and check lights system.	80.00	Necessary	50.00
Remove air-con condenser, motor fan, pipes and fittings, replace damaged parts, refit same, vacuum and refill Freon gas.	160.00	Necessary	120.00
Remove damaged parts, jack out and cut out panels, realign front or rear body, replace damaged parts, weld where necessary and refit same.	1,200.00	Necessary	600
			800.00
Balance C/F	8,116.00	Balance C/F	7,286.00

<u>REPLACEMENT OF PARTS</u>	<u>REPAIRER'S ESTIMATE</u>	<u>REMARKS</u>	<u>REVISED</u>
TO SUPPLY (SKX 8214 R VW GOLF 1.4 AUTO)	\$	YEAR : 2014 (D.O.A. 27.11.22)	\$
Balance B/F	8,116.00	Balance B/F	7,286.00
Spray paint the exterior and interior of replacement parts and respray damaged parts to same colour.	1,000.00	Necessary	800.00 600
To respray rust-proof under-seal to affected areas.	160.00	Necessary	80.00 Xrm
To conduct diagnostic check on the control units & reset memory to specification.	200.00	Necessary	180.00 ✓
TOTAL :	<u>9,476.00</u>		<u>8,346.00</u> 1550

4584.60  
95  
1550  
-----  
6229.60  
4584.60  
5 days.

ADJUSTED AMOUNT	\$	8,346.00
LUMP SUM REPAIR AT	\$	6,700.00
LESS EXCESS	\$	N.A
NETT TOTAL	\$	<u>6,700.00</u>

IT IS ESTIMATED THAT THE REPAIRS WILL TAKE SIX DAYS TO COMPLETE.