

108/11 (13) web  
ASS REC BY: [Signature]

REF: C66/AH23004378/Rpa3

3770

**ASSIGNMENT**

From: \_\_\_\_\_ Date: \_\_\_\_\_  
Estimated Cost: \_\_\_\_\_  
OD / TP / WS / TP RES / OD RES / EVA / INV / MV  
To Insure Vehicle No: GBL 8409R  
at Workshop m/s R & S AUOCLAIM  
of 13, Pioneer Sector 1  
Insured: AH  
Policy No: \_\_\_\_\_  
Claims No: \_\_\_\_\_  
Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
(Client's Record)  
Make of Veh: \_\_\_\_\_

Veh No: GBL 8409R Yr Regn: 2022 / APR  
Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /  
Truck / Trailer or \_\_\_\_\_  
Make: Suzuki Every Joint Turbo cc 658  
Colour: Grey A/C: Insured / Std / NI / NA  
Sp. Reading: 10135 T/Radio: Insured / Std / NI / NA  
Eng/No: \_\_\_\_\_  
C/No: DA17V88616  
Gen. Cond: Good / Fair / Poor / Burnt  
Steering: Inorder / Jammed / Leaked / Burnt or \_\_\_\_\_  
Brake: Inorder / Jammed / Leaked / Burnt or \_\_\_\_\_  
Modi: Nil / S/Rim / STD A/Rim or \_\_\_\_\_  
Tyre Size: F: 145/80R12  
R: \_\_\_\_\_  
BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
TOYO / YOKO or \_\_\_\_\_

N/S	O/S

(Policy Condition)  
Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: 67K  
IDAC Accident Rpt: Consistent? : Yes or No  
GIA / PR Seen: Consistent? : Yes or No  
Est. Repairs: \_\_\_\_\_ days Res.: Yes or No  
Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No  
CA / REV / REP. / 24 HRS  
Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Front \_\_\_\_\_ Rear \_\_\_\_\_  
R/Bal. 6 mm R/Bal. 6 mm  
L/Bal. 6 mm L/Bal. 6 mm  
D.O.A. 27/04/23 D.O.I. 02/05/23  
Survey held at R & S  
Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or  
FRONT  
The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>REPAIR LIMIT - 39K</u>

Date/Time, File Pass to?  : Preli. Report  
 : Final Report

Days Of Repair: \_\_\_\_\_  
Resurvey No. of Trip: \_\_\_\_\_

1) \_\_\_\_\_  
Date/Time, File Return to?

Add Fee:  : Site Insp (\$ )  
 : Interview (\$ )  
 : Tech. Invs (\$ )  
 : Weekend (\$ )

Survey Fee:

Transportation:	_____
S + RS	SI
Photos	_____
Others	_____
TOTAL	_____

Report Format : \_\_\_\_\_  
Lump Sum / I.B.I: (\$ \_\_\_\_\_)

# 日昇 R & S Autoclaim Pte Ltd

UEN : 202245519N

TEL : (65) 6264 7001

FAX : (65) 6264 7002

EMAIL : [msautoclaim@mseng.com.sg](mailto:msautoclaim@mseng.com.sg)

Address : No.13 Pioneer Sector 1,

Singapore 628424

## GBL8409R

### ACCIDENT REPAIR ESTIMATE

Vehicle Reg. No. : GBL8409R  
Vehicle Reg. Date: 28/04/2022  
Make / Model : SUZUKI EVERY JOIN TURBO 660 AUTO  
Engine No. : R06A3125214  
Chassis No. : DA17V886116

TP INSURER : AIG  
OWN INSURER : INCOME  
CLAIM TYPE : TP  
Date of Accident : 27/04/2023

### Surveyor Name and Company :

RASUL - Hg 9006068

Date of survey : 02/05/23 @ 1415

Part by Part Lump Sum : 5 days

Resurvey Before Paint After Paint

Authorize/Not Authorize/Without Prejudice

Email : \_\_\_\_\_

Fax No : \_\_\_\_\_

HP No : 9006068

### COST OF CLAIMS

Parts Cost / List Items : \$ -  
Plus/Less 20% \$ -  
Total Cost / List : \$ -  
Special Nett Items : \$ -  
Total Parts Amount : \$ -  
Total Labour Amount : \$ 3,240.00  
Gross Total : \$ 3,240.00  
GST % : 8% \$ 259.20  
Nett Amount : \$ 3,499.20

This claim is handled by : MINOKO



Vehicle Reg No. : GBL8409R  
 Vehicle Reg Date: 28/04/2022  
 Make / Model : SUZUKI EVERY JOIN TURBO 660 AUTO  
 Engine No. : R06A3125214  
 Chassis No. : DA17V886116

Parts

No	Qty	PARTICULARS	CONDITION	AMOUNT	S/N	ADJUSTED AMOUNT
1	1	HEADLAMP LH	CR /			409.00
2	1	HEADLAMP BRACKET LH	X /			
3	1	HEADLAMP PANEL LH	X /			
4	1	FRONT BUMPER	de /			1693.75
5	1	FRONT BUMPER SIDE RETIANER LH	ne /			32.10
6	10	FRONT BUMPER CLIPS	ne /			50
7		FRONT BUMPER CROSSMEMBER	X /			
8	1	FRONT FENDER LH	st /			308.50
9	1	FRONT FENDER INNER SHIELD LH	de /			45.10
10	1	FRONT FENDER INNER SHIELD CLIPS LH	ne /			35.00
11	1	FRONT GRILLE ASSY	X /			
12	1	FRONT BONNET	X /			
13	0	0				
14	0	0				
15	1	0				
16	0	0				
17	0	0				
18	0	0				
19	0	0				
20	0	0				
21	0	0				
22	0	0				
23	0	0				
24	0	0				
25	0	0				
26	0	0				
27	0	0				
28	0	0				
29	0	0				
30	0	0				
31	0	0				
32	0	0				
33	0	0				
34	0	0				
35	0	0				
36	0	0				
37	0	0				
38	0	0				
39	0	0				
40	0	0				

**LKK Auto Consultants hence notify the Repairer of the following:**

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
 Signature:  
 Date:

1973.45  
 159  
 1677.43  
 -----  
 1677.43  
 1070.00  
 -----  
 2747.43