



**ACCIDENT DAMAGED VEHICLE INSPECTION REPORT**

M/S : BM Transport Services  
C/O Guan Auto Service  
Blk 7 Sin Ming Industrial Estate Sector C,  
#01-82 Singapore 575642.

Date : 13 March 2023  
Our Ref : TP/GAS/SLR9038X/8791

**REFERENCE PARTICULARS**

Date of Accident : 13 February 2023  
Date of Inspection : 15 February 2023

Type of Inspection : Third Party Claim  
Date of Re-Inspn : ~

**VEHICLE PARTICULARS**

Registration No : SLR 9038 X  
Make : Honda  
Model : Vezel Hybrid 1.5X Auto  
Year : 2017 (COE Expiry 29 Aug 2027)

Engine No : LEB5949263  
Chassis No : RU31249246  
Odometer : 076192 km  
Colour : Black

**CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)**


Engine condition : Good  
Front brake : Serviceable  
Rear brake : Serviceable

General Body Work : Good  
Steering : Serviceable  
Lightings : Serviceable

**TYRE CONDITION (Remaining estimated life of tyre in mm)**

	<u>Make</u>	<u>Size</u>	<u>Thread Balance</u>
Front Near side	: Habilead	225/50R17	6 mm
Front Off Side	: Habilead	225/50R17	6 mm
Rear Near Side	: Habilead	225/50R17	6 mm
Rear off Side	: Habilead	225/50R17	6 mm

**GENERAL DESCRIPTION OF DAMAGES**

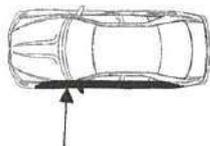

The vehicle sustained damage at the whole near side portion.  
For details, refer to assessment for repairs and photographs attached.

**ASSESSMENT SUMMARY**

Our assessment of the repair costs to pre-accident condition was **\$29,500.00 nett** at lump sum basis. (Subject to GST if applicable)

Under normal circumstances, estimated period required for repairs : Eighteen (18) working days.

Enclosed One Hundred and Twelve (112) photographs depicting damage to the vehicle.

Inspection conducted at : Guan Auto Service.  
Blk 7 #01-82 Sin Ming Industrial Estate Sector C, Singapore 575642.

In accordance to your instruction, we have **not authorise** repairs and inspection was conducted strictly on a "**WITHOUT PREJUDICE BASIS**".

**ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS**

DESCRIPTION OF PARTS AND NATURE OF REPAIRS		QTY	ASSESSED	ORIGINAL	REVISED
A)	SPARE PARTS	PC/SET	CONDITION	QUOTATION	QUOTATION
1	Front fender LH	1	Grazed/Dented	\$ 489.00	\$ 489.00
2	Front fender inner shield LH	1	Torn	\$ 109.20	\$ 109.20
3	Front fender brace bracket LH	1	Torn	\$ 67.10	\$ 67.10
4	Front fender arch protector LH	1	Cracked	\$ 345.00	\$ 345.00
5	Front door LH	1	Grazed/Dented	\$ 1,690.50	\$ 1,690.50
6	Front side mirror assy LH	1	Malfunction	\$ 697.00	\$ 697.00
7	Front door belt molding LH	1	Necessary	\$ 114.90	\$ 114.90
8	Front door chrome trim LH	1	Grazed	\$ 218.40	\$ 218.40
9	Front door lower seal LH	1	Necessary	\$ 47.00	\$ 47.00
10	Front door window glass regulator LH	1	Jammed	\$ 640.30	\$ 640.30
11	Front door window glass lower sash LH	1	Bent	\$ 56.00	\$ 56.00
12	Front door window runner channel LH	1	Torn	\$ 180.00	\$ 180.00
13	Front door weather-strip LH	1	Torn	\$ 115.70	\$ 115.70
14	Front door outer handle LH	1	Scratched	\$ 367.00	\$ 367.00
15	Front door lock assy LH	1	Jammed	\$ 270.00	\$ 270.00
16	Front door upper/lower hinge LH @ \$62.50	2	Bent	\$ 125.00	\$ 125.00
17	Front door checker LH	1	Bent	\$ 105.30	\$ 105.30
18	Front door water shield LH	1	Necessary	\$ 87.00	\$ 87.00
19	Front door inner trim panel LH	1	Torn/Deformed	\$ 618.00	\$ 618.00
20	Front passenger seat-back pad LH	1	Deployed-Necessary	\$ 829.00	\$ 829.00
21	Front steering box assy	1	Broken/Jammed	\$ 1,709.20	\$ 1,709.20
22	Front steering tie rod LH	1	Bent	\$ 138.30	\$ 138.30
23	Front knuckle arm LH	1	Misaligned	\$ 427.15	\$ 427.15
24	Front disc rotor LH	1	Serviceable	\$ 329.30	~
25	Front wheel hub bearing LH	1	Affected	\$ 250.90	\$ 250.90
26	Front suspension sub frame	1	Bowed	\$ 1,504.00	\$ 1,504.00
27	Front knuckle lower ball joint LH	1	Affected	\$ 112.50	\$ 112.50
28	Front lower control arm LH	1	Misaligned	\$ 406.90	\$ 406.90
29	Front stabilizer bar link arm LH	1	Damaged	\$ 91.70	\$ 91.70
30	Front stabilizer bar	1	Bent	\$ 365.70	\$ 365.70
31	Front stabilizer bar bush @ \$15.20	2	Necessary	\$ 30.40	\$ 30.40
32	Front drive shaft LH	1	Serviceable	\$ 925.40	~
33	Front shock absorber LH	1	Bent	\$ 438.80	\$ 438.80
34	Front pillar lower panel LH	1	Repair	\$ 658.00	~
35	Front pillar side cover LH	1	Torn	\$ 114.50	\$ 114.50
36	Center pillar upper garnish LH	1	Torn	\$ 196.20	\$ 196.20
37	Center pillar lower garnish LH	1	Torn	\$ 278.20	\$ 278.20
38	Side lower lining assy LH	1	Torn	\$ 178.00	\$ 178.00
39	Front outer side panel LH	1	Dented	\$ 2,735.90	\$ 2,735.90
40	Front stiffener panel LH	1	Dented	\$ 890.00	\$ 890.00
41	Side sill panel LH	1	Dented	\$ 1,450.00	\$ 1,450.00
42	Side sill garnish LH	1	Deformed/Sheared off	\$ 459.80	\$ 459.80
43	Rear door LH	1	Grazed/Dented	\$ 1,706.20	\$ 1,706.20
44	Rear door belt molding LH	1	Necessary	\$ 114.90	\$ 114.90
45	Rear door chrome trim LH	1	Grazed	\$ 218.40	\$ 218.40
46	Rear door center seal LH	1	Cut	\$ 72.40	\$ 72.40
47	Rear door lower seal LH	1	Necessary	\$ 47.00	\$ 47.00
48	Rear door window regulator assy LH	1	Jammed	\$ 456.60	\$ 456.60
49	Rear door window glass lower sash LH	1	Serviceable	\$ 56.00	~
50	Rear door window runner channel LH	1	Serviceable	\$ 175.00	~
				\$ 23,708.75	\$ 21,565.05

<b>Balance B/F</b>				\$	<b>23,708.75</b>	\$	<b>21,565.05</b>
51	Rear door water shield LH	1	Necessary	\$	87.00	\$	87.00
52	Rear door upper/lower hinge LH @ \$62.50	2	Bent	\$	125.00	\$	125.00
53	Rear door lock assy LH	1	Jammed	\$	270.00	\$	270.00
54	Rear wheel arch protector LH	1	Grazed	\$	375.00	\$	375.00
55	Rear door inner trim panel LH	1	Torn/Deformed	\$	618.00	\$	618.00
56	Rear bumper corner LH	1	Serviceable	\$	349.20		~
57	Rear bumper side spacer LH	1	Serviceable	\$	56.00		~
				\$	25,588.95	\$	23,040.05
			Less 20%	\$	5,117.79	\$	4,608.01
				\$	20,471.16	\$	18,432.04
<b>B) S/NETT ITEM</b>							
58	Front air bag side impact inflator module	1	Activated-Necessary	\$	2,494.70	\$	2,494.70
59	Front passenger seat belt	1	Activated-Necessary	\$	740.00	\$	740.00
60	Front driver seat belt	1	Activated-Necessary	\$	740.00	\$	740.00
61	Front passenger seat belt buckle	1	Activated-Necessary	\$	164.00	\$	164.00
62	Front driver seat belt buckle	1	Activated-Necessary	\$	164.00	\$	164.00
63	Passenger side curtain airbag LH	1	Deployed-Necessary	\$	2,706.00	\$	2,706.00
64	SRS unit (SDM Module)	1	Activated-Necessary	\$	1,835.00	\$	1,835.00
65	Front door panel speaker LH	1	Damaged	\$	80.00	\$	80.00
66	Front door stainless sill plate	1 set	Bent	\$	284.00	\$	284.00
67	Front door window glass visor LH	1 set	Necessary	\$	230.00	\$	230.00
68	Front fender arch protector clips LH	1 set	Necessary	\$	28.00	\$	28.00
69	Front door frame black out tape LH	1	Necessary	\$	54.00	\$	54.00
70	Front door trim panel clips LH	1 set	Necessary	\$	34.00	\$	34.00
71	Side sill garnish retainer LH @ \$4.30	8	Necessary	\$	34.40	\$	34.40
72	Side sill garnish clips LH @ \$0.45	8	Necessary	\$	3.60	\$	3.60
73	Front & Rear sport rim LH	1 set	Dented/Grazed	\$	1,600.00	\$	1,600.00
74	Rear fender arch protector clips RH	1 set	Necessary	\$	28.00	\$	28.00
75	Rear door frame black out tape LH	1	Necessary	\$	54.00	\$	54.00
76	Rear door trim panel clips	1 set	Necessary	\$	34.00	\$	34.00
77	Rear bumper clips	1 set	Not Required	\$	38.00		~
			<b>Parts Total :</b>	\$	<b>31,816.86</b>	\$	<b>29,739.74</b>
<b>C) LABOUR CHARGES &amp; MISC</b>							
78	Spray painting on above new & repaired parts including supply of paint materials.			\$	2,500.00	\$	1,800.00
79	Remove damaged parts, knock out dents on rear fender, straighten, jack out damaged panel, cutting, welding, remove & reinstall necessary fittings to facilitate repairs, reshape, refit, adjust, replace and realign all relevant parts.			\$	4,500.00	\$	3,500.00
80	To mount vehicle onto chassis alignment bench, repair, straighten chassis frame and re-align body structure panel.			\$	1,200.00	\$	600.00
81	To carry out diagnostic checks check & reset vehicle smart entry system.			\$	380.00	\$	280.00
82	To remove & reinstall trims garnish, upholstery, etc. to enable necessary repairs, check, refit as same.			\$	180.00	\$	120.00
83	Check wiring, lighting system, fuse, relay, focus headlight, power window & central locking system for proper function.			\$	50.00	\$	30.00
84	To transfer front & rear door mechanism & components.			\$	160.00	\$	80.00
85	Remove & replace under carriages damaged parts, dismantle & reassemble rear suspension to enable necessary repairs, check & refit same.			\$	450.00	\$	380.00
86	To conduct wheel alignment & balancing.			\$	120.00	\$	120.00
87	To cavity preservation on all affected areas.			\$	350.00	\$	180.00
88	To provide towing services.			\$	60.00	\$	60.00
			<b>Labour Total :</b>	\$	<b>9,950.00</b>	\$	<b>7,150.00</b>
			<b>Total Parts and Labour</b>	\$	<b>41,766.86</b>	\$	<b>36,889.74</b>
			<b>FINAL LUMP SUM ADJUSTMENT</b>			\$	<b>29,500.00</b>

**POINT OF IMPACT**

The impact was confined to the whole near side portion of the vehicle.  
The damages appeared to be consistent as per the accident report statement.  
Please refer the attached schedule and photographs for details.


**ADJUSTMENT/RECOMMENDATIONS**

We have thoroughly inspected each and every item on the repairer's estimates against the actual damaged found on the vehicle. We have listed the breakdown of our findings and recommendations as per assessment above.



**CONCLUSION**

The repairer has agreed to undertake repair the vehicle at a lump sum basis of **\$29,500.00 nett** corresponding to replacement of parts, spray painting and labour charges. We now revert for your decision on the above claim.



Yours faithfully  
KTO Automobile Assessors

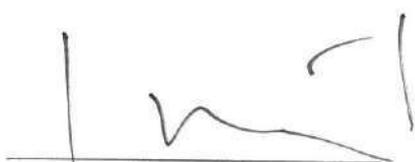

Ong Ah Keng (CAE, AMIMI, MSAAA)  
Automotive Appraiser

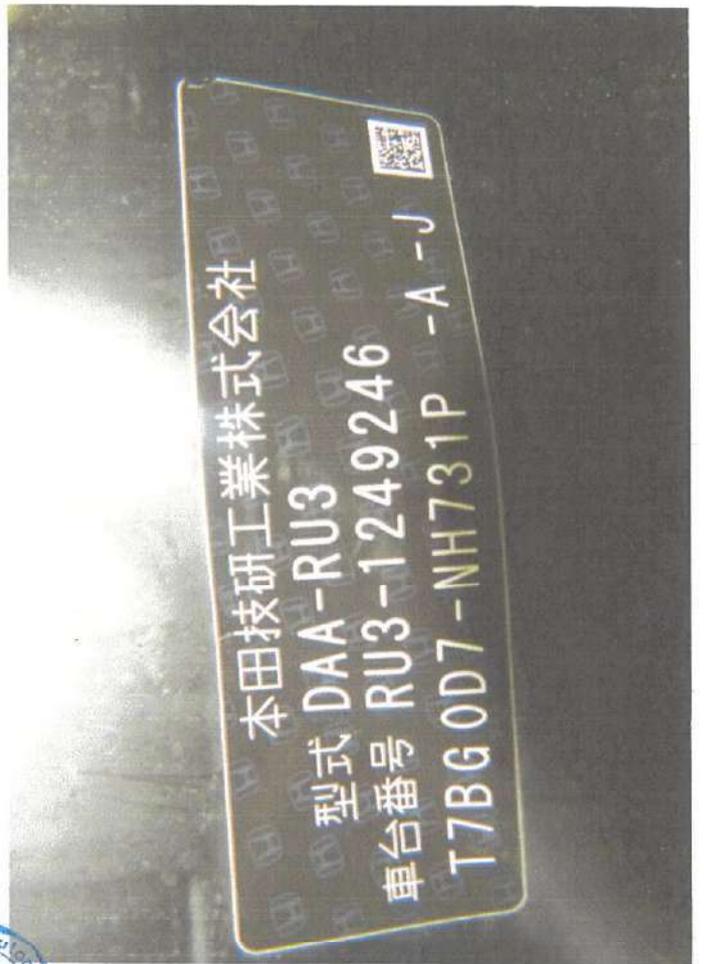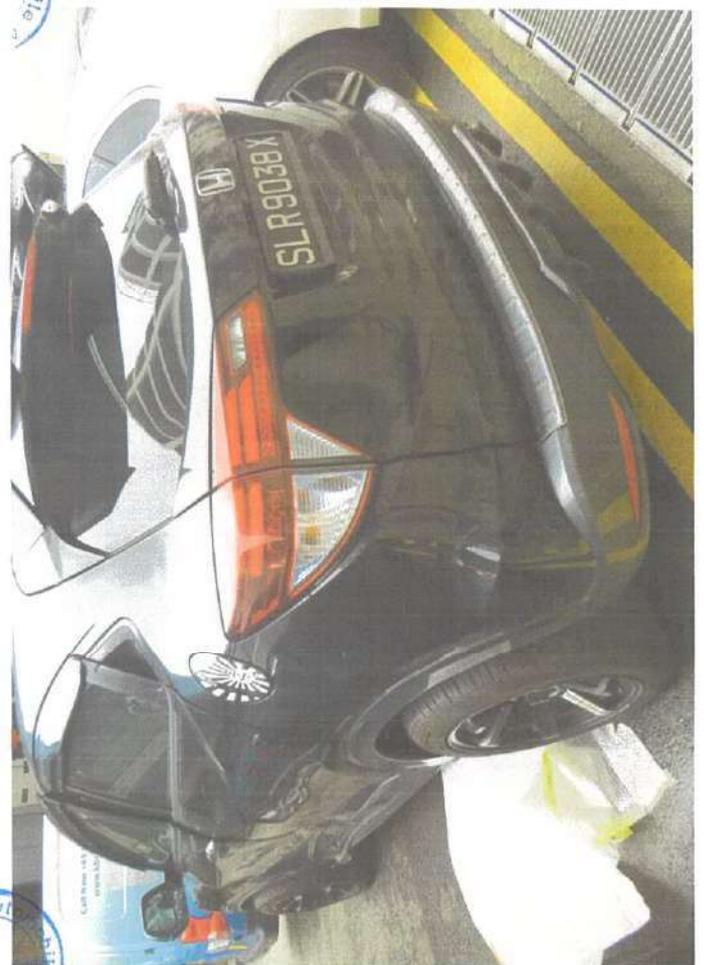






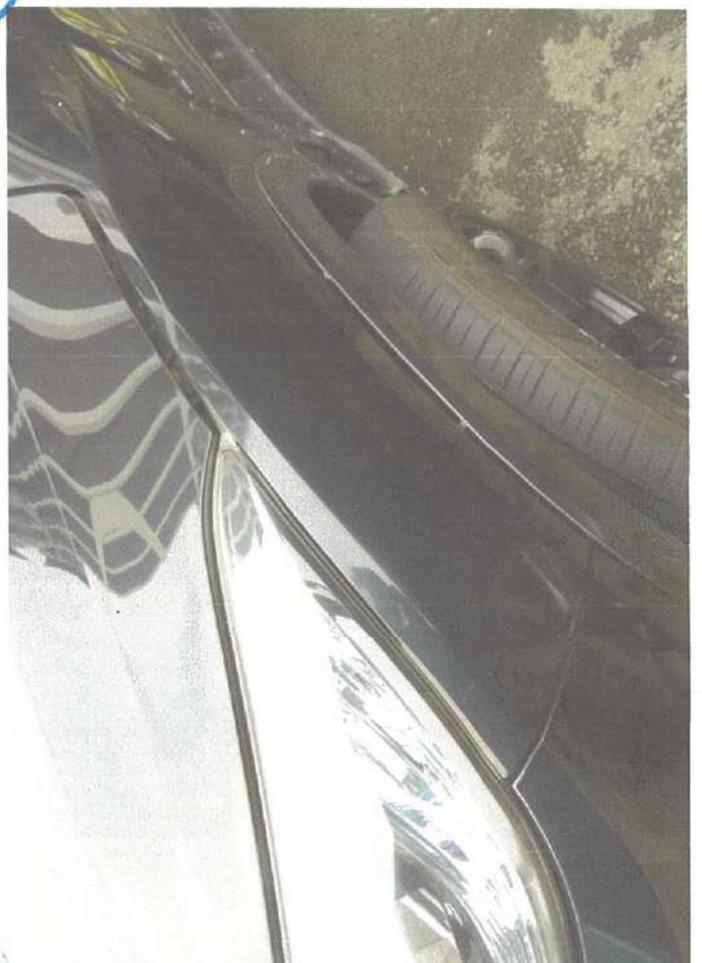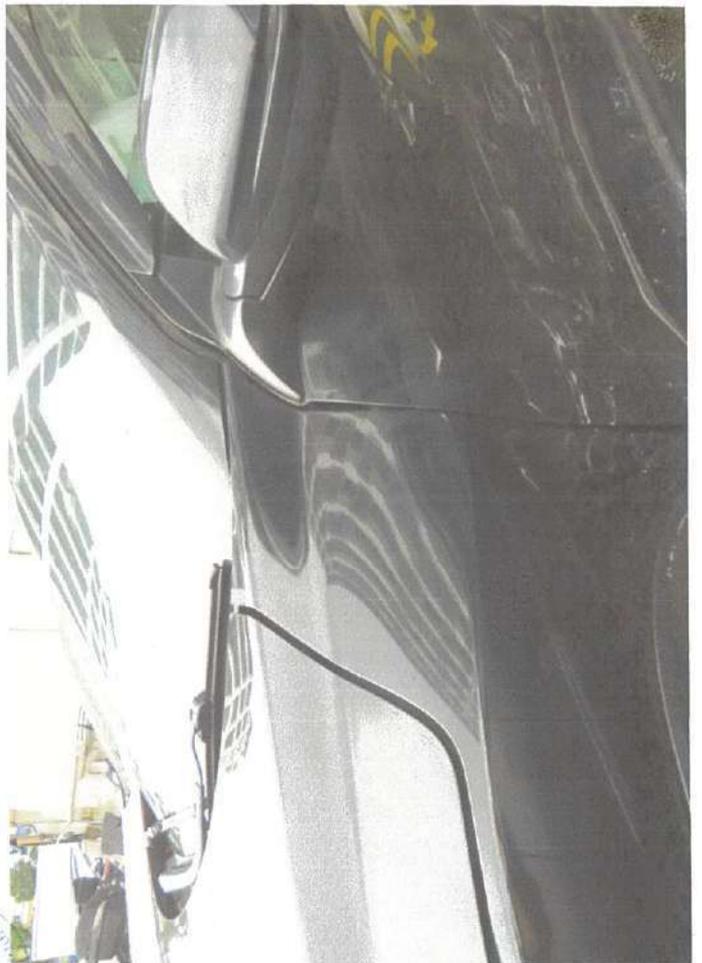








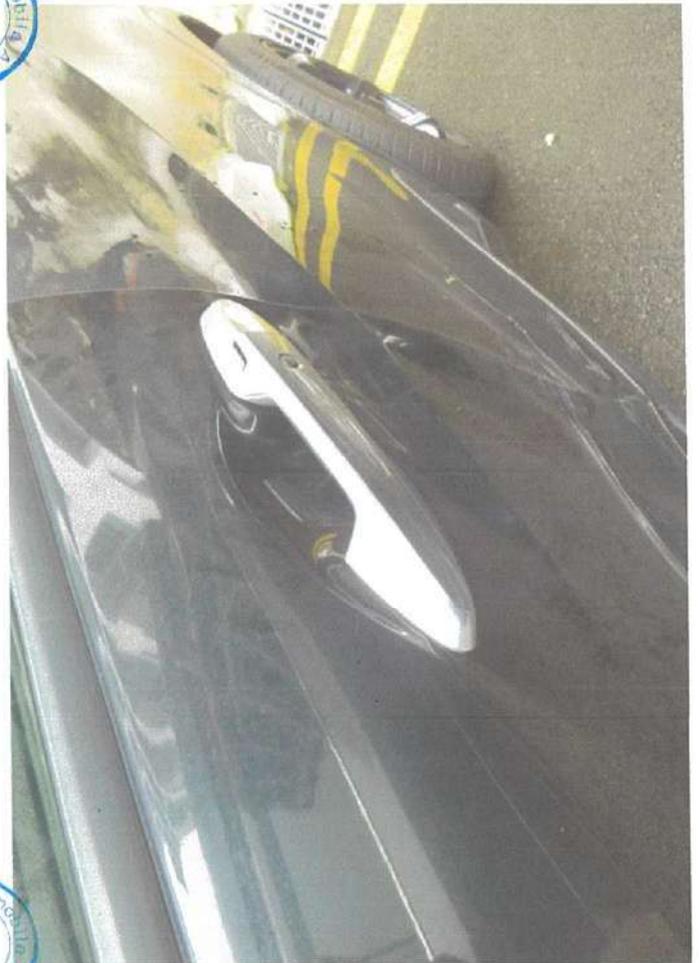


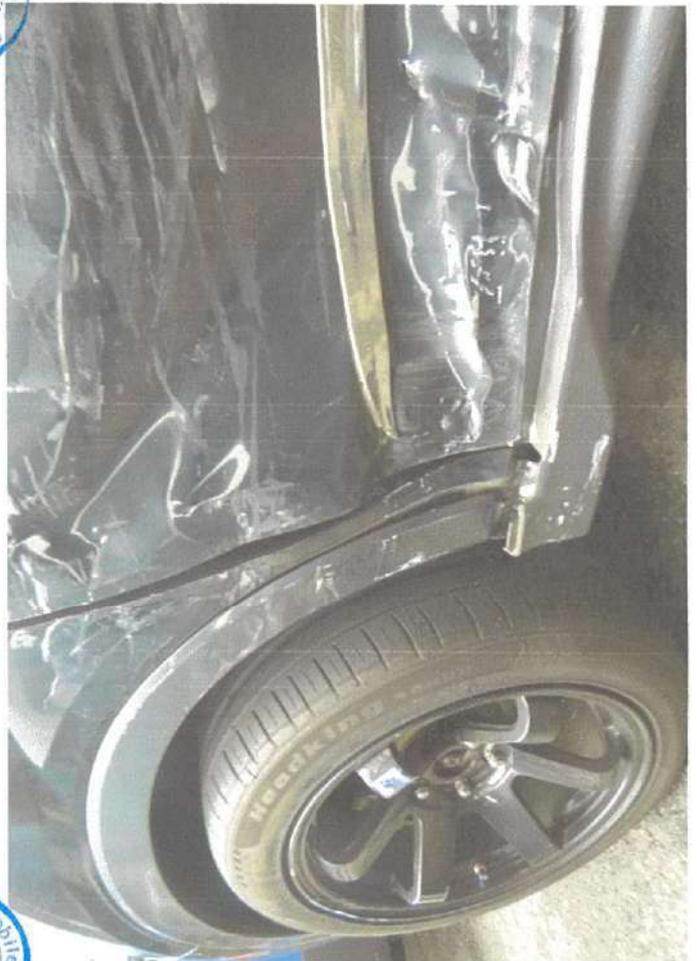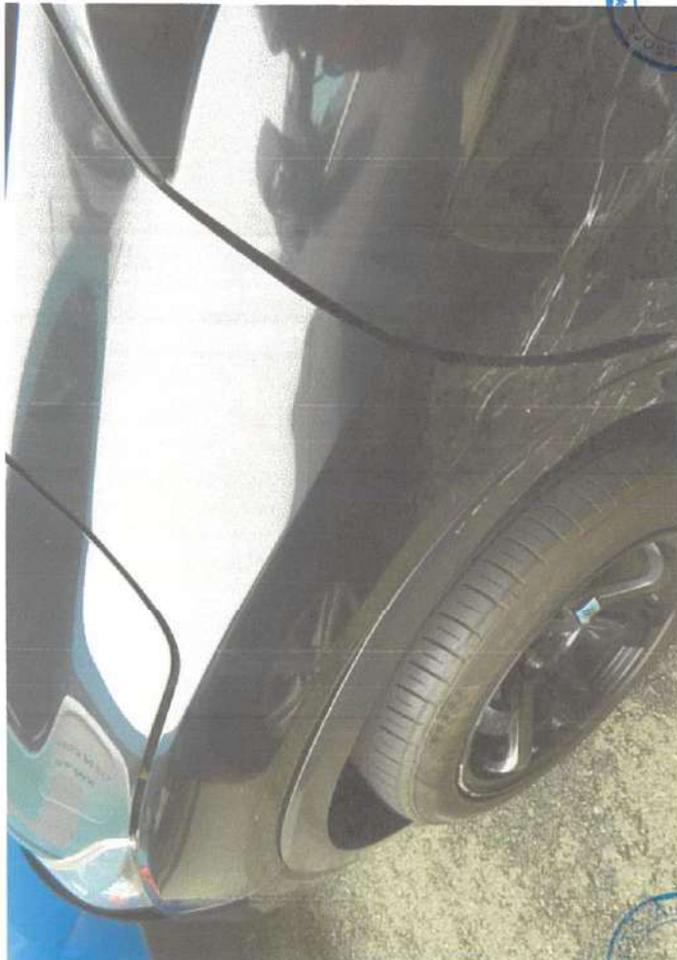



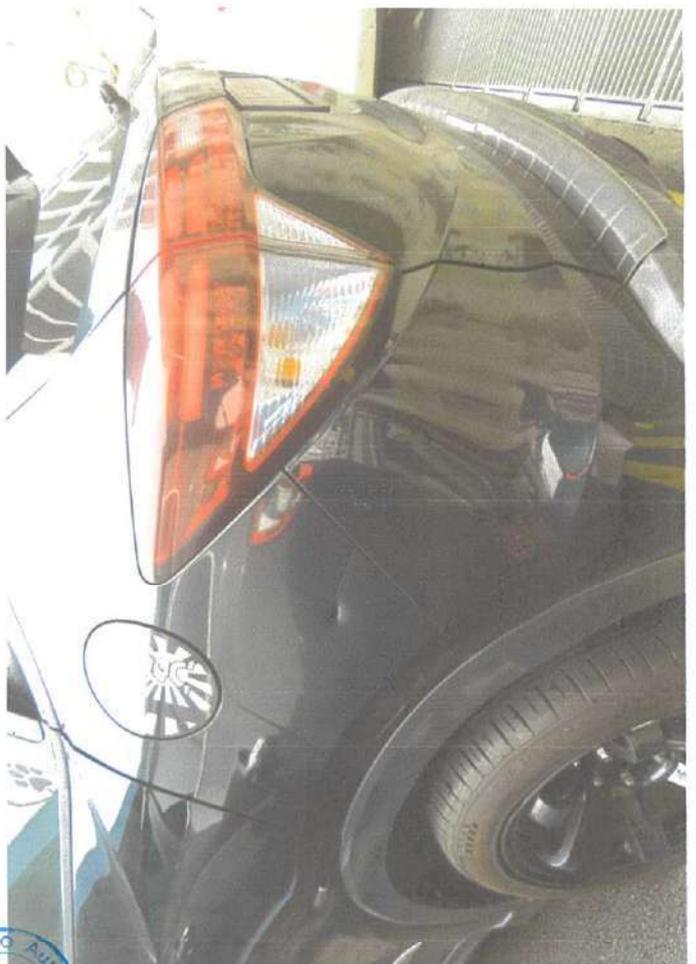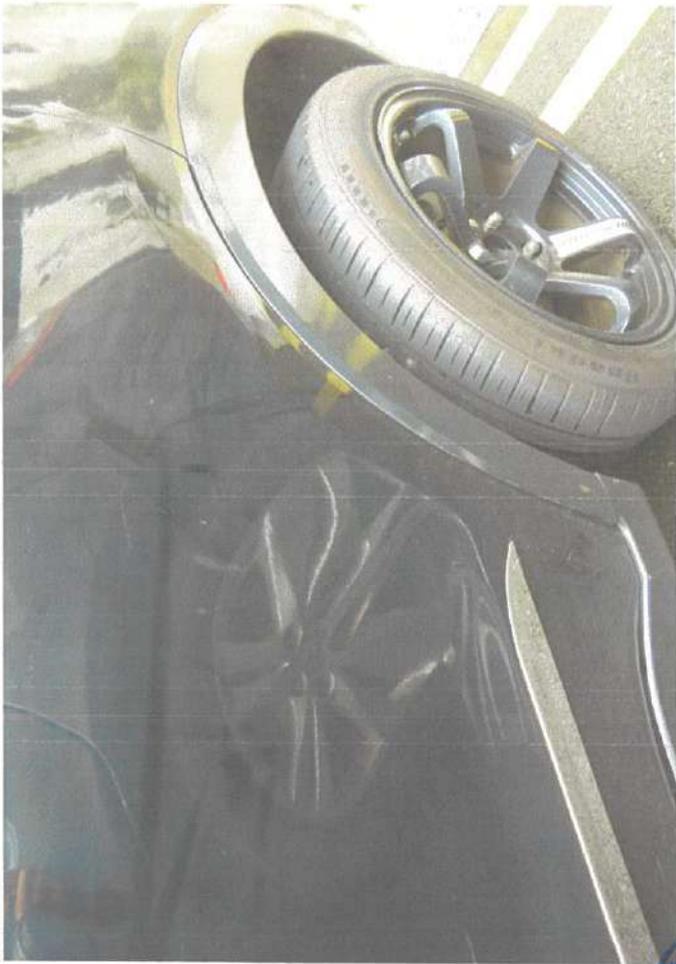



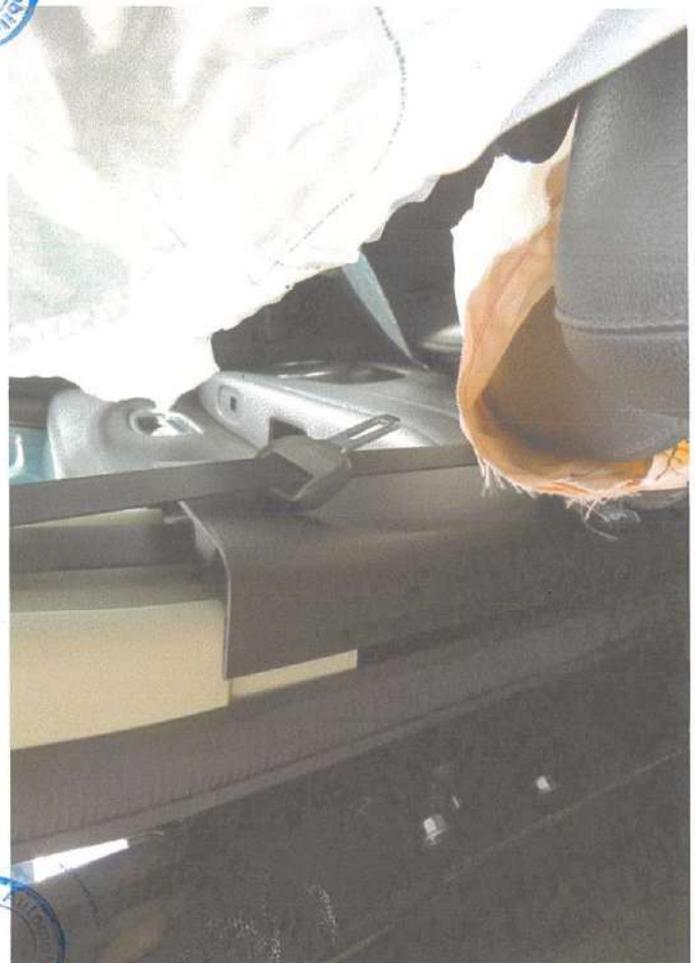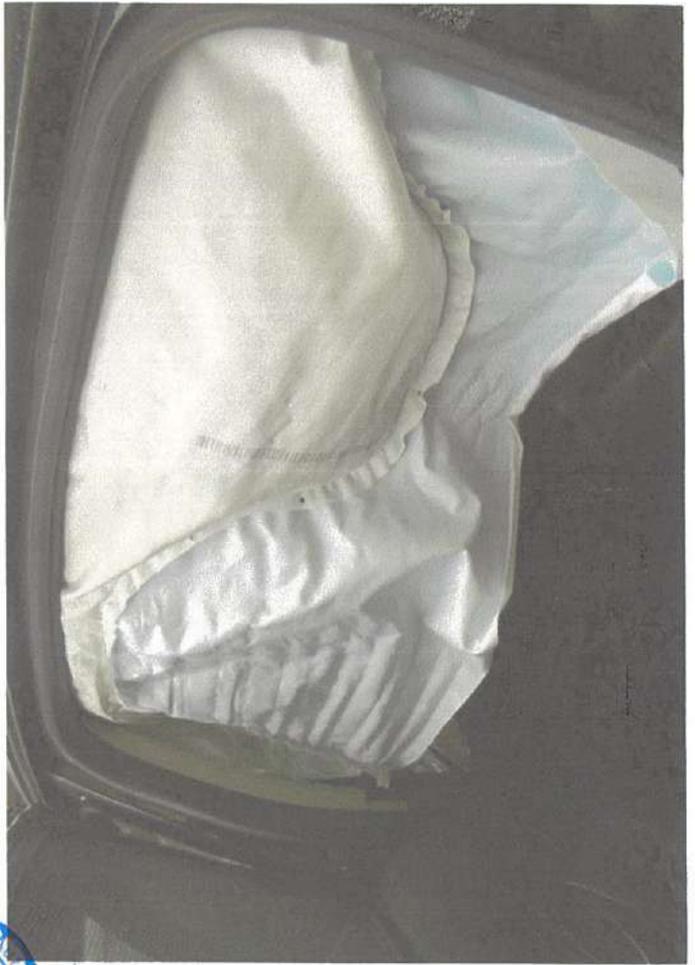







KTO Automobile  
Assesment

KTO Automobile

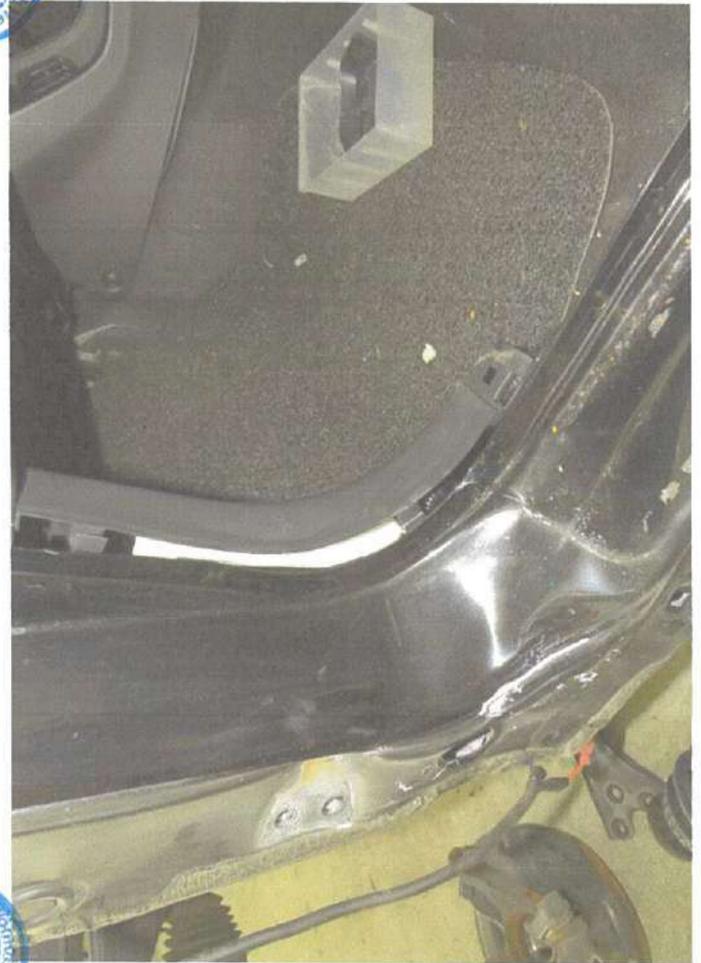



TO AUTOMOTIVE


TO AUTOMOTIVE

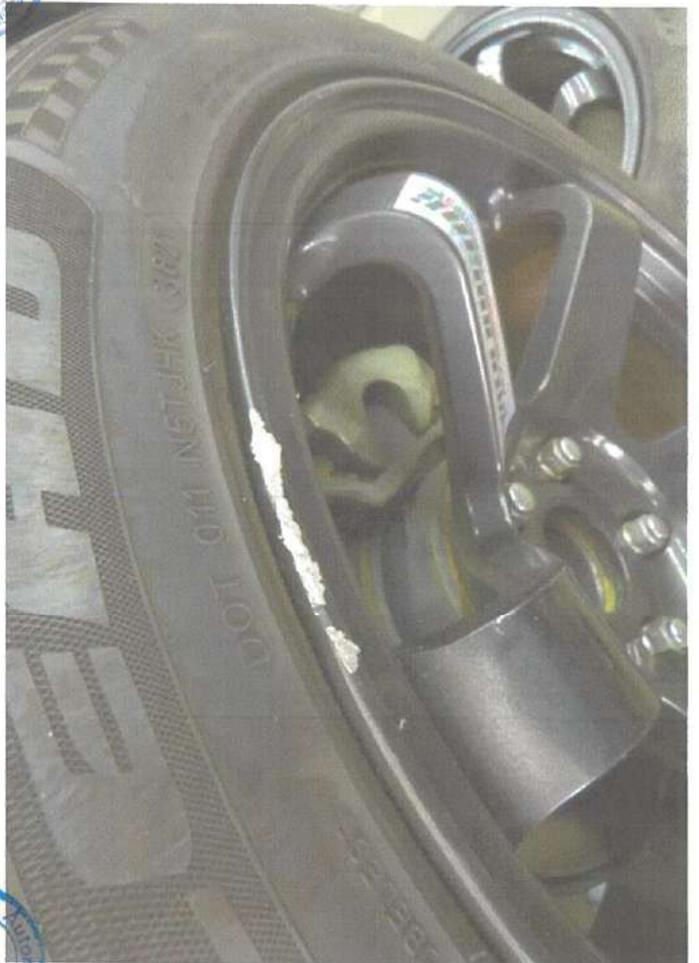








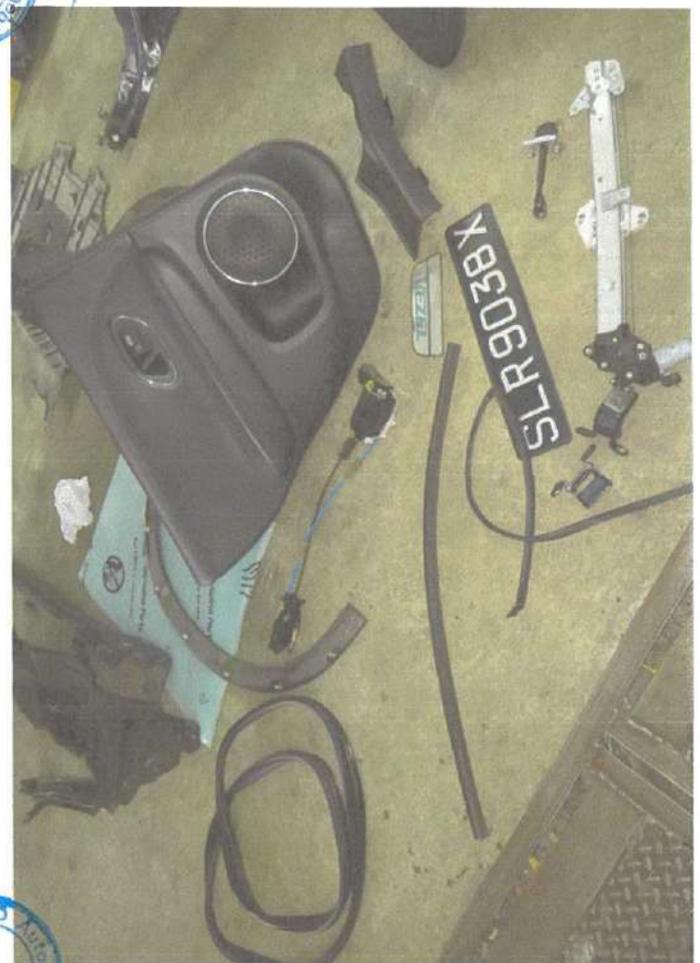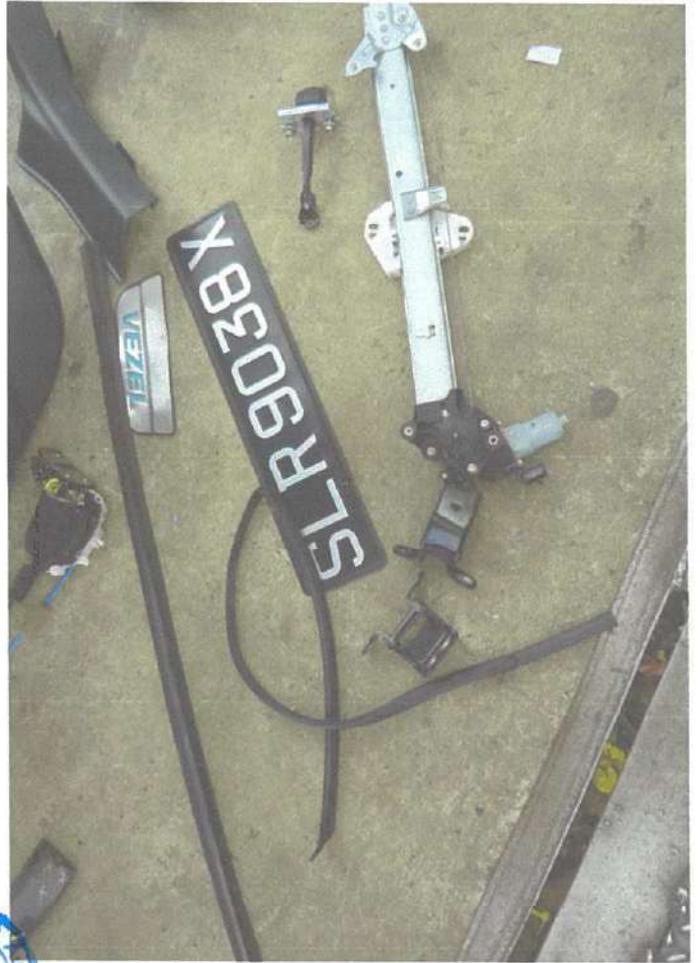


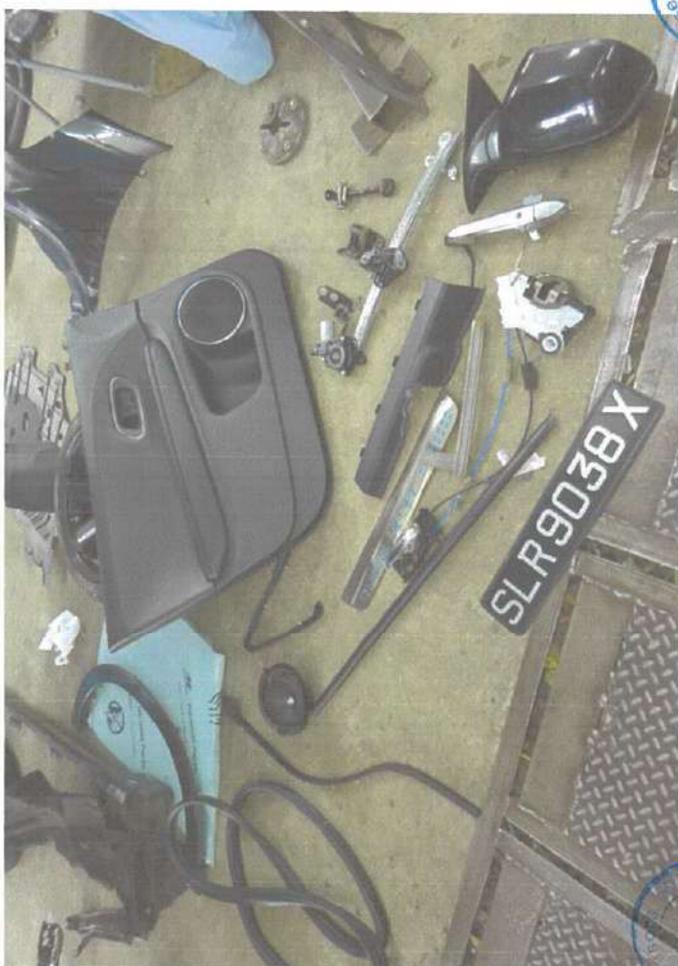





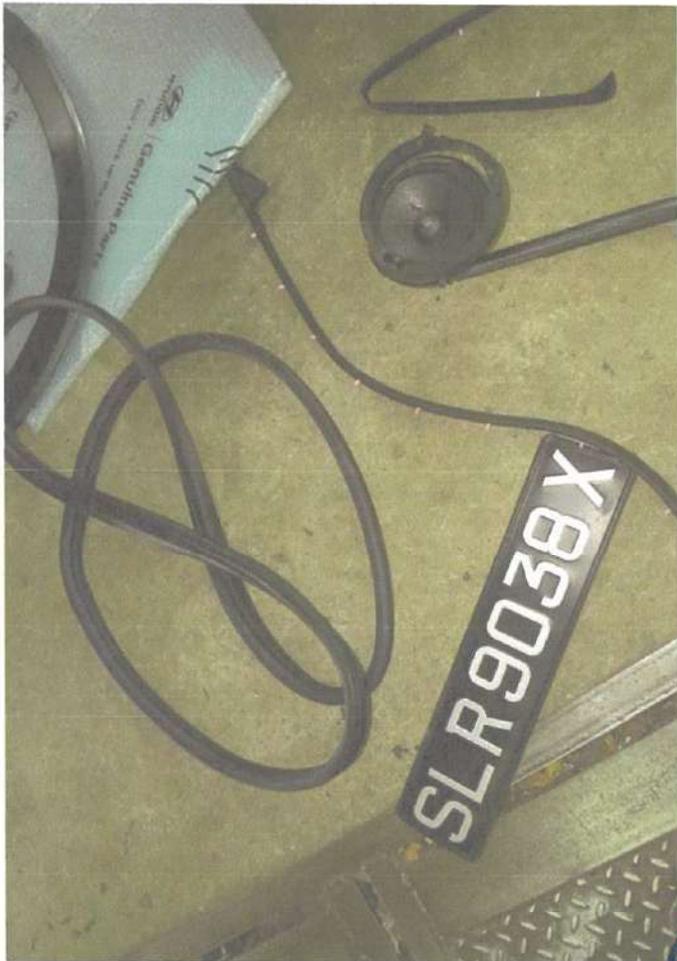

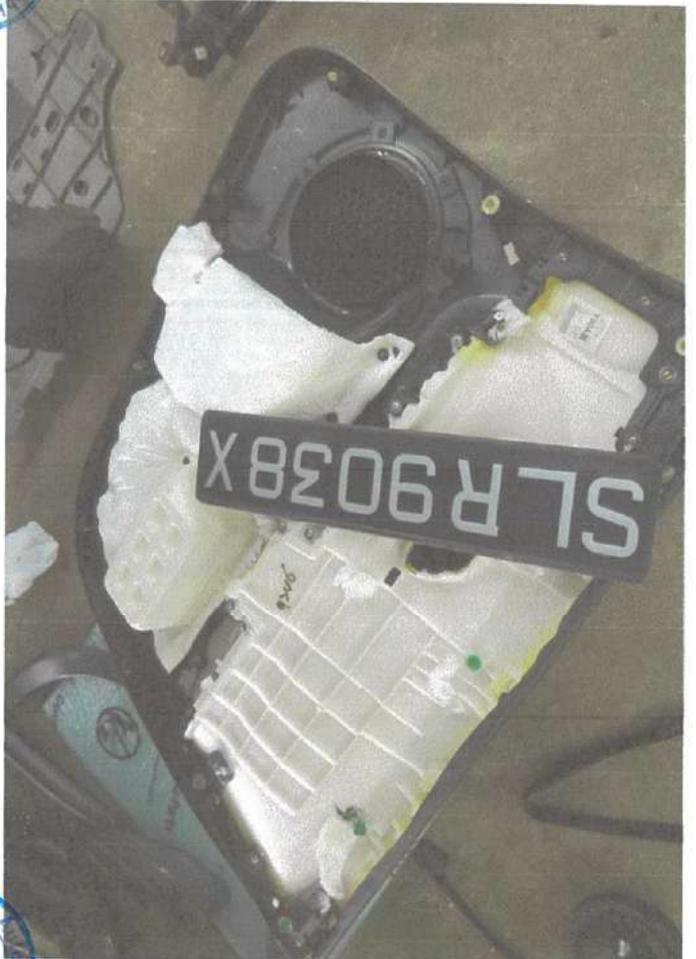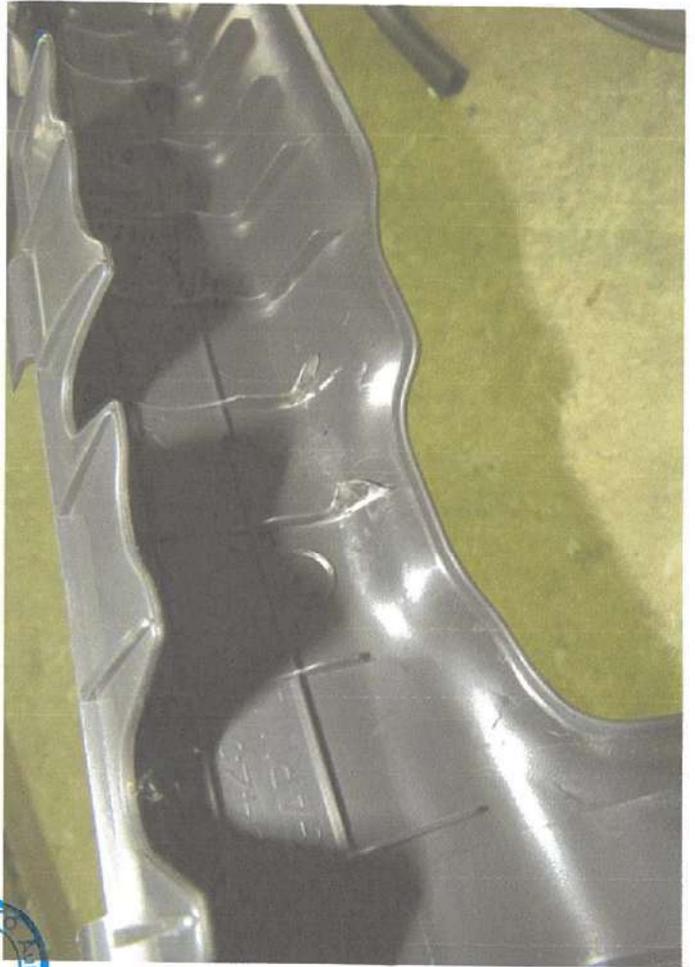


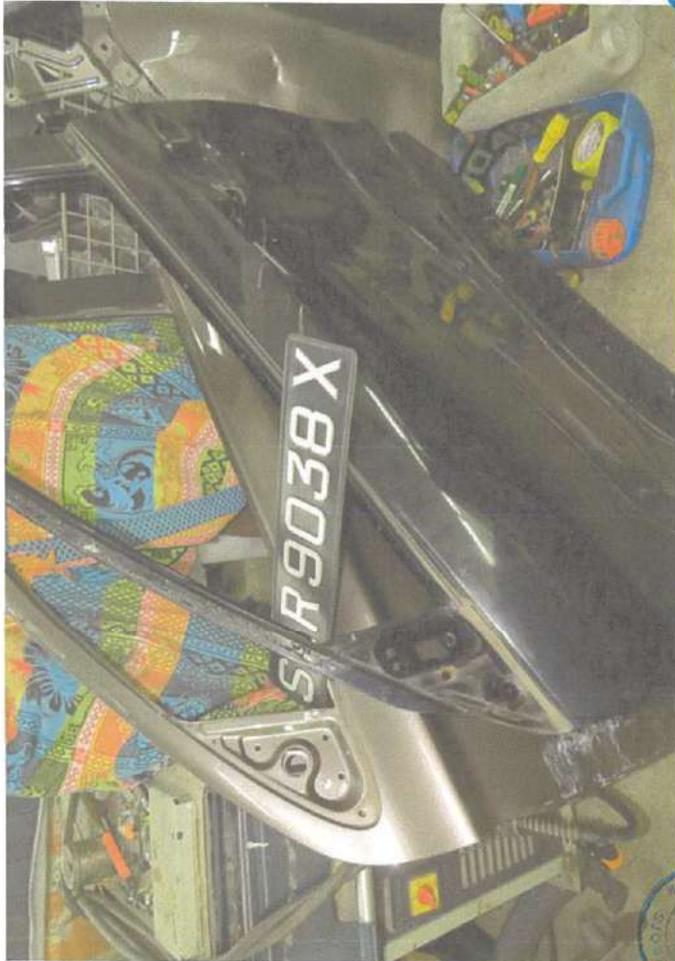

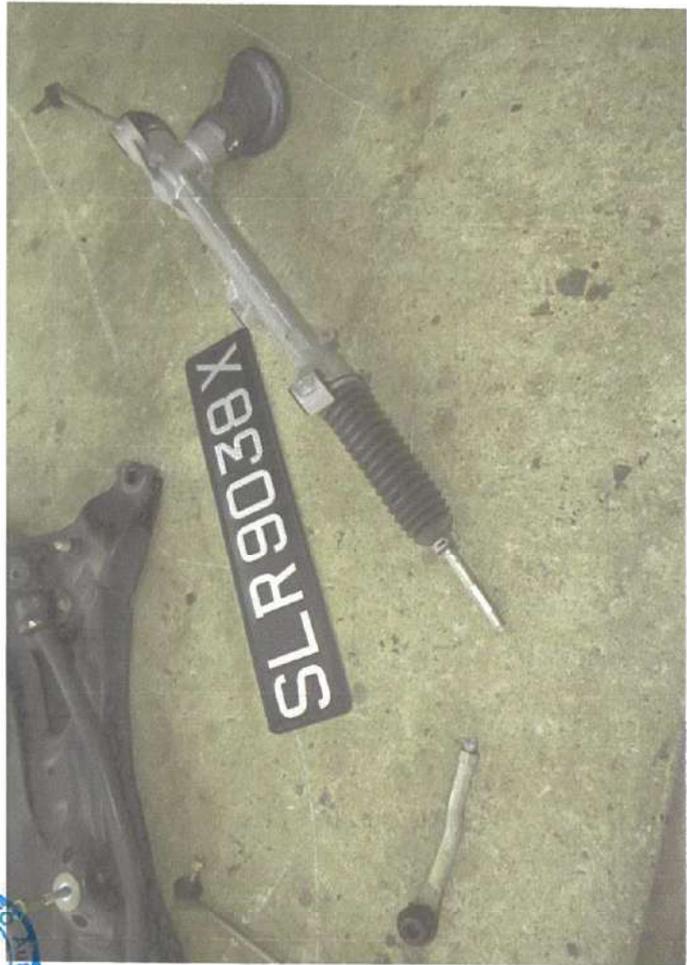

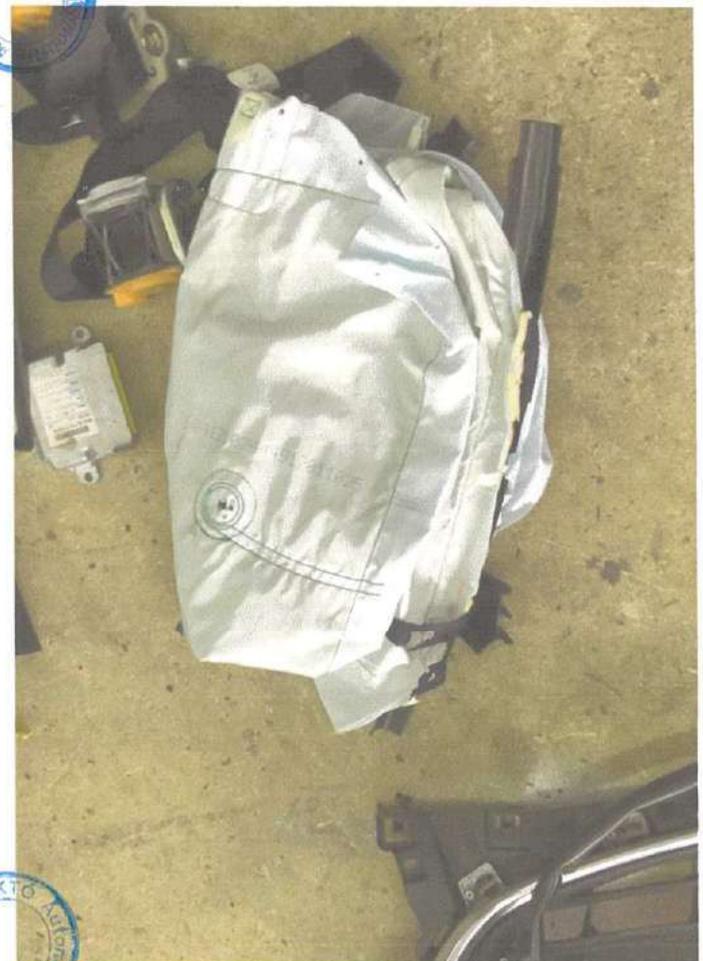



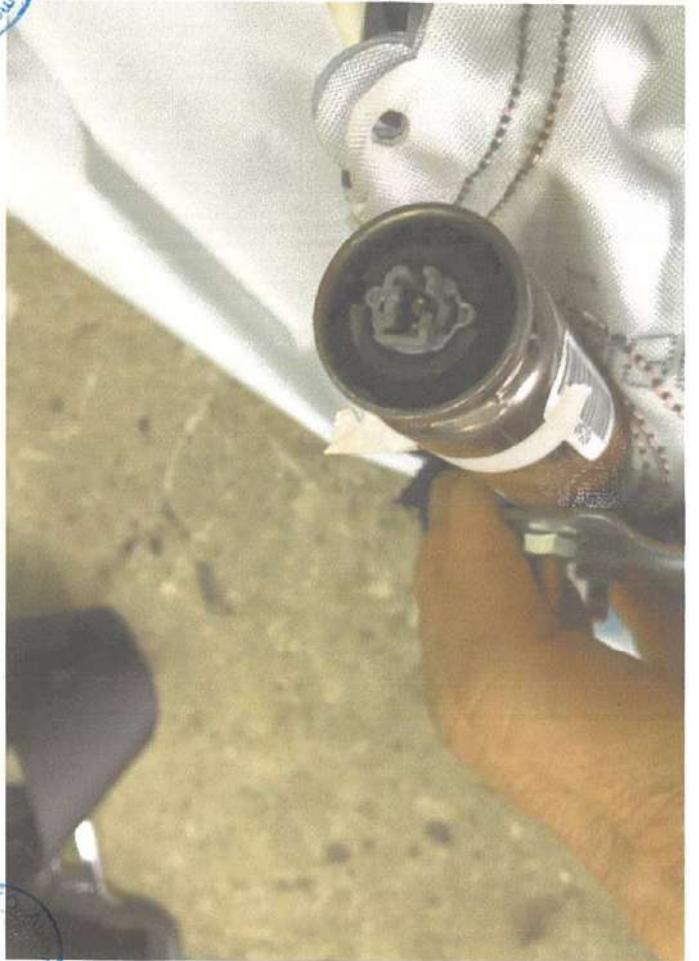


KTC Automobile Asses

KTC Automobile Asses



KTO  
Kontrolle  
Kesseler  
K...

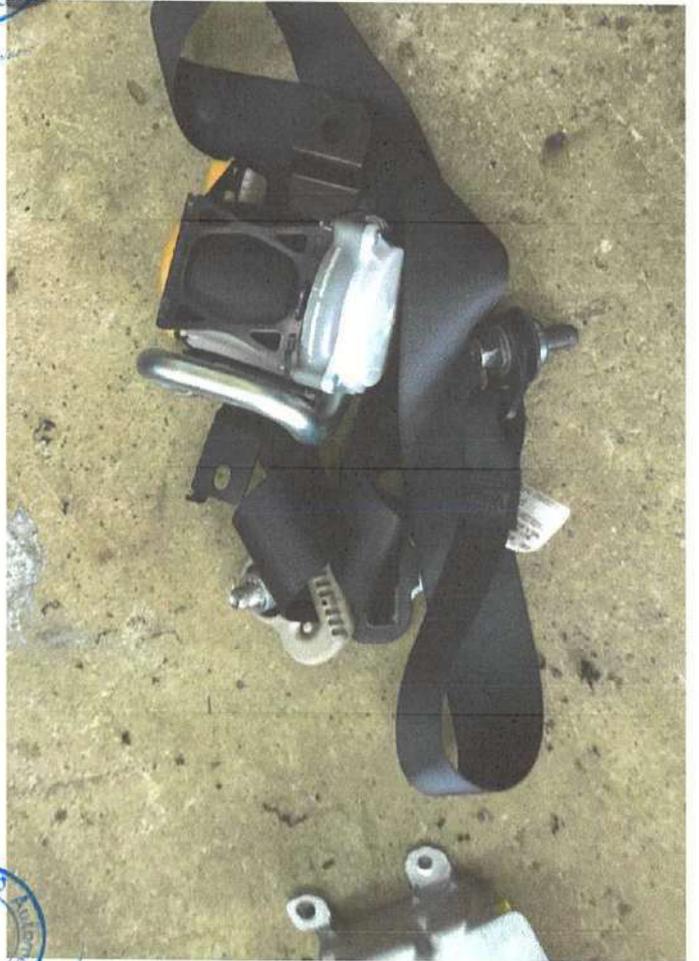

KTO  
Kontrolle  
Kesseler  
K...