

ASS. REC. BY: T. J. Smith

REF:

### ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s: \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

|     |     |
|-----|-----|
|     |     |
| N/S | O/S |
|     |     |

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: \_\_\_\_\_ days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: SMN48344 Yr Regn: 2019

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Honda Freed c.c. 1496

Colour: Silver A/C: Insured / Std / NI / NA

Sp. Reading: \_\_\_\_\_ T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: G671092183\*

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/R/m / STD A/Rim or

Tyre Size: F: 185/65R15

R: \_\_\_\_\_

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Kapsen

Front 6 Rear \_\_\_\_\_

R/Bal. \_\_\_\_\_ mm R/Bal. 6 mm

L/Bal. 6 mm L/Bal. 6 mm

D.O.A. \_\_\_\_\_ D.O.I. 02/05/23

Survey held at Apex Motoring @ 3pm

Des. of Damages : Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

| Date / Time | Action / Instruction |
|-------------|----------------------|
|             |                      |
|             |                      |
|             |                      |
|             |                      |
|             |                      |
|             |                      |
|             |                      |
|             |                      |
|             |                      |
|             |                      |

Date/Time, File Pass to?  : Preli. Report  
 : Final Report

1) Date/Time, File Return to?

2) \_\_\_\_\_


Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Add Fee:  : Site Insp (\$)  
 : Interview (\$)  
 : Tech. Invs (\$)  
 : Weekend (\$)

|                 |  |
|-----------------|--|
| Survey Fee:     |  |
| Transportation: |  |
| S + RS. SI      |  |
| Photos          |  |
| Others          |  |
| TOTAL           |  |

Repair Format: \_\_\_\_\_  
Lump Sum / B.B. / C/P

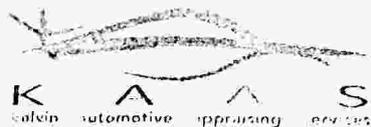

6 Tampines St 73, #01-03, Singapore 520825  
Tel: 6746 2118 Fax: 6746 1148  
Reg No: 53058468m

Claim Reference : -  
Insured Vehicle No. : -  
Thirty Party Veh No. : -  
Officer-In-Charge : -

Our Reference : KAAS/TA/6479/4834/TP/11.22  
Date : 16 December 2022

To: Advance CR Pte Ltd  
c/o 25 Kaki Bukit Road 4  
#01-55, Synergy @ Kaki Bukit  
Singapore 417800

### VEHICLE APPRAISAL REPORT

Name of Workshop : Apex Motoring  
Place of inspection : 25 Kaki Bukit Road 4 #01-55, Synergy @ Kaki Bukit, Singapore 417800  
Date of Assignment : 22 November 2022  
Date of Accident : 19 November 2022  
Date of Inspection : 22 November 2022

#### **PARTICULARS OF INSPECTED VEHICLE**

|                         |                               |                        |               |
|-------------------------|-------------------------------|------------------------|---------------|
| Registration No.        | : SMN 4834G                   | Chassis Frame No.      | : GB7-1092183 |
| Make / Model            | : Honda Freed Hybrid 1.5G (A) | Engine No. ( Logcard ) | : LEB5631252  |
| Year of Manufacture/Reg | : 2019                        | Odometer Reading       | : 271,082 KM  |
| Colour                  | : Silver                      |                        |               |
| Class / Type            | : MPV                         |                        |               |

#### **CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)**


General Condition : Very Good  
Paintwork : Very Good  
Market Value : -  
Scrap Value : -

#### **CONDITION OF TYRES ON VEHICLE**

|         | <u>Make/Size</u>    | <u>Thread Balance</u> |
|---------|---------------------|-----------------------|
| Front L | KAPSEN 185 / 65 R15 | 7 mm                  |
| Front R | KAPSEN 185 / 65 R15 | 7 mm                  |
| Rear L  | KAPSEN 185 / 65 R15 | 7 mm                  |
| Rear R  | KAPSEN 185 / 65 R15 | 7 mm                  |

\*The above is an estimate of the remaining life of the tyre thread in millimeters

The information contained in these documents may be privileged and confidential and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this survey report in error, please contact us immediately by phone so that we can arrange for its return.

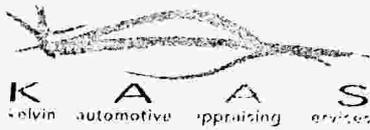

6 Tampines St 73, #01-03, Singapore 528225  
 tel: 6746 2118 fax: 6746 1148  
 reg no: 53058468m

Our Reference : KAAS/TA/6479/4834/TP/11.22  
 Vehicle Number : SMN 4834G

### APPRAISEMENT SCHEDULE

| S/N                  | Qty    | Descriptions                           | Conditions  | Repairer's Estimate | Revised Amount |
|----------------------|--------|--|-------------|---------------------|----------------|
| LIST ITEMS:-         |        |  |             |                     |                |
| 1                    | 1 pc   | rear bumper                            | deformed    | \$ 1,064.20         | \$ 1,064.20    |
| 2                    | 2 pcs  | rear bumper side retainer @\$47.00     | necessary   | \$ 94.00            | \$ 94.00       |
| 3                    | 2 pcs  | rear bumper side support @\$79.00      | necessary   | \$ 158.00           | \$ 158.00      |
| 4                    | 1 set  | rear bumper clips                      | necessary   | \$ 35.00            | \$ 35.00       |
| 5                    | 1 pc   | tailgate                               | buckled     | \$ 1,265.50         | \$ 1,265.50    |
| 6                    | 1 pc   | tailgate chrome garnish                | broken      | \$ 368.70           | \$ 368.70      |
| 7                    | 1 pc   | tailgate logo emblem                   | necessary   | \$ 77.00            | \$ 77.00       |
| 8                    | 1 pc   | tailgate " freed " emblem              | necessary   | \$ 64.20            | \$ 64.20       |
| 9                    | 1 pc   | tailgate " hybrid " emblem             | necessary   | \$ 62.10            | \$ 62.10       |
| 10                   | 1 pc   | tailgate outer handle                  | damaged     | \$ 57.60            | \$ 57.60       |
| 11                   | 1 pc   | tailgate inner lock                    | jammed      | \$ 181.00           | \$ 181.00      |
| 12                   | 1 pc   | tailgate inner trim board              | deformed    | \$ 331.90           | \$ 331.90      |
| 13                   | 1 set  | tailgate inner trim board clips        | necessary   | \$ 24.00            | \$ 24.00       |
| 14                   | 2 pcs  | tailgate no. plate lamp @\$25.00       | broken      | \$ 50.00            | \$ 50.00       |
| 15                   | 1 pc   | tailgate l/h lamp                      | broken      | \$ 380.20           | \$ 380.20      |
| 16                   | 1 pc   | tailgate r/h lamp                      | broken      | \$ 380.20           | \$ 380.20      |
| 17                   | 1 pc   | tailgate weatherstrip                  | deformed    | \$ 194.00           | \$ 194.00      |
| 18                   | 1 pc   | rear windscreen wiper motor            | not working | \$ 632.50           | \$ 632.50      |
| 19                   | 1 pc   | rear windscreen glass                  | broken      | \$ 806.00           | \$ 806.00      |
| 20                   | 1 pc   | rear windscreen moulding               | necessary   | \$ 91.10            | \$ 91.10       |
| 21                   | 1 pc   | l/h taillamp                           | broken      | \$ 667.70           | \$ 667.70      |
| 22                   | 1 pc   | r/h taillamp                           | broken      | \$ 667.70           | \$ 667.70      |
| 23                   | 2 pcs  | taillamp lower filler panel @\$347.60  | buckled     | \$ 695.20           | \$ 695.20      |
| 24                   | 1 pc   | rear end panel                         | dented      | \$ 717.25           | repair         |
| 25                   | 1 pc   | rear end panel top garnish             | deformed    | \$ 178.95           | \$ 178.95      |
| 26                   | 1 pc   | l/h rear fender inner trim board       | deformed    | \$ 570.00           | \$ 570.00      |
| 27                   | 1 pc   | r/h rear fender inner trim board       | deformed    | \$ 570.00           | \$ 570.00      |
| 28                   | 1 set  | l/h rear fender inner trim board clips | necessary   | \$ 35.00            | \$ 35.00       |
| 29                   | 1 set  | r/h rear fender inner trim board clips | necessary   | \$ 35.00            | \$ 35.00       |
| Less 20%             |        |  |             | \$ 10,454.00        | \$ 9,736.75    |
|                      |        |  |             |                     | \$ 1,947.35    |
| SPECIAL NETT ITEMS:- |        |  |             | \$ 10,454.00        | \$ 7,789.40    |
| 30                   | 1 set  | reverse sensor                         | not working | \$ 300.00           | \$ 250.00      |
| 31                   | 1 set  | reverse camera                         | not working | \$ 480.00           | \$ 450.00      |
| 32                   | 1 roll | rear windscreen sealant                | necessary   | \$ 60.00            | \$ 40.00       |
|                      |        |  |             | \$ 840.00           | \$ 740.00      |
| Sub - Total          |        |  |             | \$ 11,294.00        | \$ 8,529.40    |

880.30

1240  
320.40

288.40

181.90  
325

629.40  
629.40  
538


K/h  
K/h  
K/h  
L/h

7672.15  
6137.72

200  
300

540



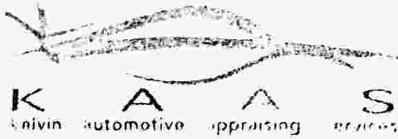


6 Tampines St 73, #01-03, Singapore 529825  
 tel: 6746 2118 fax: 6746 1148  
 reg no. 53058468m

Our Reference : KAAS/TA/6479/4834/TP/11.22  
 Vehicle Number : SMN 4834G

### ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered **Squarely to the Rear** portion of the vehicle.

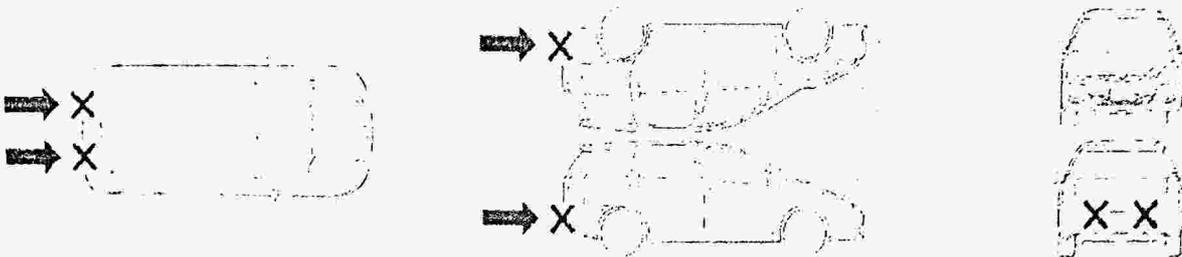

The general area of damages is at the **Rear portion**  
 ( Please refer to the parts list and photographs as attached for more information )

### ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs **Apex Motoring** is S 15,094.00 .

We have adjusted the cost to \$ 11,759.40 and the repairer has agreed to undertake the repairs at a **Contract Lump Sum of \$ 9,400.00** to a acceptable quality and standards.

However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of **9** working days.

**80** photographs were taken at the time of static inspection.

This report is strictly done in a **Without Prejudice Basis**.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No. **6479** for our services rendered and we thank you for engaging our services.

**KELVIN AUTOMOTIVE APPRAISING SERVICES**

**KELVIN TEO**  
 Licensed Automotive Appraiser  
 Nitec in Automotive Technology  
 Cert. Crash Investigation & Reconstruction  
 Dip MS  
 MSAAA, AM SAE-A

**NOTE :** This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company within Seven (7) days from the date hereof. Otherwise this revised amount shall be treated as valid.