## ALLIED AUTO APPRAISAL

22 Upper Serangoon Crescent #16-53 Singapore 534025

Company Registration No. 53127785B

Veh No : ER 819 B Our Ref: Allied/TP/22-11026 Date Report 7-Mar-22

27-Oct-22 Date of Accident **RS Garage Services Pte Ltd** Repairer 18-Nov-22 Date of Survey

Address of Inspection 2 Balestier Road, #04-665, Balestier Hill Shopping Centre,

Singapore 320002

**VEHICLE PARTICULARS & CONDITION** 

Date of Registration 12-Oct-21 Mercedes Benz G63 AMG Make & Model 3982 cc Engine c.c. 17798060167134 Engine No 11-Oct-31 **COE Expiry Date** W1N4632762X380408 Chassis No

**CONDITION OF VEHICLE** 

Modification No **General Condition** Good Air-Conditioner Yes Steering Serviceable

Handbrake Serviceable Serviceable Footbrake Good

Wing Mirror Yes Paint Work

**CONDITION OF TYRES** (The below values represent the remaining tyre treads depth)


295/40R22 Front Tyre Size 295/40R22 Rear Tyre Size Front Left Side 6mm Pirelli Rear Left Side 6mm Pirelli Front Right Side 6mm Pirelli Pirelli Rear Right Side 6mm

## **GENERAL DESCRIPTION OF DAMAGE**

The inspected vehicle sustained damage at the REAR RIGHT SIDE portion.

During visual inspection, our surveyor noted that the rear right side fender, rear bumper assembly and among other parts were affected.

All stated damage is subject to consistency of the accident reports.

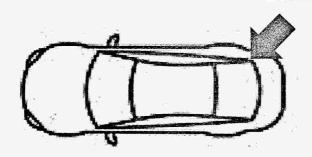

Repairer Estimate

**Our Recommendation** Parts 19,393.29 : Parts: 15,735,38 Labour 2,430.00 ; Labour: 1,980.00 Total

21,823.29 GST (7.00%):

Total: 17,715.38 Less 20%: 3,543.08 14,172.30

Lump Sum (Estimated): 14,150.00

Licensed Appraiser

The repairer agree to repair the vehicle on a Lump Sum Basis with our recommendation of SGD 14,150.00 (SGD Fourteen Thousand One Hundred and Fifty only) and we are in the opinion the repairer would need about a 8.0 working day period to repair the vehicle.

**Allied Auto Appraisal** Ng Heng Chai Surveyed by

## ALLIED AUTO APPRAISAL

RECON	IMENDED PARTS					
No.	Descriptions	Condition	Qty	Repairer	Adjusted	
1	REAR FENDER PANEL (RH)	Repair	1	6,829.95	5,335.90	7.55
2	REAR FENDER ARCH PROTECTOR (RH)	Dented/Deformed	1	685.95	535.90	•
3	REAR FENDER ARCH PROTECTOR REAR RETAINER (RH)	Cracked	1	250.75	195.90	
4	REAR FENDER INNER SHIELD (RH)	Deformed/Cracker	1	327.55	255.90	
5	REAR FENDER INNER SHIELD CLIPS (RH)	Necessary	1	109.44	85.50	
6	REAR BUMPER ASSEMBLY	Torn/Cracked	1	2,989.44	2,335.50	
7	REAR BUMPER SIDE PARKING SENSOR (RH)	Cracked/Broken	1	417.15	325.90	
8	REAR BUMPER SIDE RETAINER (RH)	Cracked	1	237.95	185.90	
9	REAR AXLE WHEEL SHAFT (RH)	Affected	1	1,709.95	1,335.90	Xnn.
10	REAR RIGHT WINDSCREEN WITH MOULDING	Necessary	1	2,989.95	2,335.90	xnn.
		Sub Total (S\$):	_	16,548.10	12,928.20	3920.5
		Discount (10%):		1,654.81	1,292.82	
		Total Parts (S\$):	-	14,893.29	11,635.38	35 28"
RECO	MMENDED SPECIAL NETT ITEMS		on s	one en al la marche de la		
No.	Descriptions	Condition	up.	Repairer	Adjusted	
1	REAR WHEEL RIM (RH)	Chipped		4,500.00	4,100.00	2500
			-	4,500.00	4,100.00	
RECO	MMENDED LABOUR					
No.				Repairer	Adjusted	
1	TO PANEL BEAT RIGHT REAR FENDER PANEL AND REPLA	ACE RIGHT REAR		1,200.00	1,000.00	800
2	TO REMOVE/INSTALL RIGHT REAR AXLE WHEEL SHAFT TO REPLACE.			250.00	200.00	
3	TO REMOVE/INSTALL RIGHT REAR BUMPER SIDE PARKI	NG SENSOR TO		100.00	100.00	50
4	RUST PROOFING ON THE RIGHT REAR ACCIDENT PORTION	ON.		80.00	80.00	<del>/</del> 0
5	TO PUTTY AND RESPRAY RIGHT REAR FENDER PANEL, R	IGHT REAR FENDER		800.00	600.00	V
				2,430.00	1,980.00	1490
COST	OF CLAIMS			Repairer	Adjusted	( ( ( -
1	TOTAL PARTS			19,393.29	15,735.38	
2	LABOUR & SPRAY			2,430.00	1,980.00	
		Gross Total (S\$):	_	21,823.29	17,715.38	
		GST 7.00% (S\$):		-		
		Total Amount (S\$):	_	21,823.29	17,715.38	

3528.45 2500 1490 7518.45 Usq6000 06days.