



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. EL 7711M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	DEFORMED	717.00	682.00
1	FORNT BUMPER SIDE RETAINER RH	CRACKED	38.50	38.50
1	FRONT FOGLAMP FINISHER RH	NOT NECESSARY	102.00	-
1	FRONT FOGLAMP RH	NOT NECESSARY	298.66	-
1	FRONT FENDER RH	DISTORTED	588.00	588.00
1	FRONT FENDER OUTER ARCH GARNISH RH	DEFORMED	296.00	296.00
1	FRONT FENDER INNER SHIELD RH	TORN	125.00	125.00
1	BONNET	TO REPAIR SEE LABOUR	984.50	-
1	HEADLAMP RH	CRACKED	1,225.00	1,225.00
1	FRONT RADIATOR GRILLE C/W CHROME MOULDING	HOLDER BROKEN	396.00	396.00
1	FRONT LOWER ARM RH	NOT NECESSARY	271.00	-
1	FRONT KNUCKLE ARM RH	NOT NECESSARY	481.94	-
1	FRONT WHEEL HUB AND BEARING RH	NOT NECESSARY	247.33	-
1	FRONT LINKAGE RH	NOT NECESSARY	98.00	-
1	FRONT SHOCK ABSORBER RH	NOT NECESSARY	493.85	-
1	FRONT DOOR RH (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 10% DISCOUNT		-636.28	-335.05
			5,726.50	3,015.45
<u>SPECIAL NETT ITEMS</u>				
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	SET FRONT RADIATOR GRILLE CLIP (SN)	NECESSARY	15.00	15.00
1	FRONT TYRE RH (SN)	NOT NECESSARY	290.00	-
1	FRONT RIM RH (SN)	BENT	980.00	650.00
1	FRONT FENDER INNER SHIELD CLIP RH (SN)	NECESSARY	30.00	20.00
			1,365.00	715.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO DISMANTLE, REPLACE, CUT, WELD, KNOCK OUT DENTS TO STRAIGHTEN ACCIDENT PARTS AS-MENTIONED ON THE 'PARTS REPAIR' COLUMN INCLUSIVE OF REPLACEMENT PARTS. INCLUSIVE OF THE REPAIR OF BONNET AND FRONT DOOR RH.		900.00	500.00
	PUTTY & SPRAY PAINTING TO ADJACENT PANELS. JOB ALLOWANCE. PAINT / MATERIALS.		900.00	800.00
	APPLY RUST PROOFING ON THE ADJACENT PANELS.		50.00	30.00
	SPECIALIST CHARGES - WHEEL ALIGNMENTS.		60.00	60.00
	REMOVE AND REPLACE FRONT UNDERCARRIAGE WORK RH.	NOT NECESSARY	225.00	-
	SPECIALIST CHARGES - CHECK / DIAGNOSTIC AND REPROGRAMMING.		200.00	150.00
	WIRING / BULB CHECKING (INCLUSIVE OF RE-FOCUS / RE-ADJUST ON ANGLE OF LIGHT INTENSITY).		36.00	30.00
			2,371.00	1,570.00
GRAND TOTAL			9,462.50	5,300.45
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,250.00

Report Ref No. CS3/SMR22006118/Tqy3e2-1

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.