

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189
Email: mirage1195@gmail.com Mobile: 9061 0543

ACCIDENT VEHICLE INSPECTION REPORT

Report no : 109M0323.PMG
Vehicle no : GBL7620C

1 REFERENCE

Date of inspection : 27 March 2023
Requested by : Westcoast Garage
10 Kaki Bukit Road 2
#03-10 First East Centre
Singapore 417868
Type of survey : Independent
Repairer : Polymath Garage
1 Kaki Bukit Ave 6, #01-15 AutoBay @ Kaki Bukit, Singapore 417883
Date of accident : 25March 2023

2 VEHICLE DATA

Make/model : **NISSAN NV350 URVAN PANEL VAN 5MT**
Chassis no : JN1MA2E26Z0000418
Engine no : QR20020948R
Date of registration : 28 March 2022 *COE Expiry Date:* 27 March 2032
Engine capacity : 1998 cc
Odometer reading : 11327 km
Colour : Grey

3 STATIC CONDITION CHECK

Steering : Serviceable
Foot brakes : Serviceable
Hand brakes : Serviceable
Paintwork : Good
General Condition : Good

4 TIRE CONDITION CHECK

	<u>RH/MAKE</u>	<u>LH/MAKE</u>	<u>SIZE</u>
Front tread	: 8 mm/Yokohama	8 mm/Yokohama	195R15
Rear tread	: 8 mm/Yokohama	8 mm/Yokohama	195R15

5 BRIEF DESCRIPTION OF DAMAGE

Rear bumper scraped/cut/deformed, rear RH outer panel bent, etc. Please see para. 8 of this report for more details.

6 REMARKS

This inspection is carried out on a "WITHOUT PREJUDICE" basis and I have not authorized any repairs.

7 RECOMMENDATION

Cost of repairs : **\$1,500.00** (lump sum)
Estimated no of days : **Four (4)**

8 ASSESSMENT OF DAMAGE AND COSTS

Report no: 109M0323.PMG
 Vehicle no: GBL7620C

A SPARE PARTS

<u>Description</u>	<u>Qty</u>	<u>Assessed Condition</u>	<u>Repairer's Amount</u>	<u>Revised Amount</u>
<u>(Nett Item)</u>				
Rear bumper cover	1	scraped/cut/deformed	642.50	642.50
Rear bumper side retainer	2	necessary	36.40	36.40
Rear RH outer panel	1	to repair	3,645.90	0.00
		Subtotal of the above	4,324.80	678.90
		Discount	10% / 10% 432.48	67.89
		<i>Subtotal 1:</i>	<u>3,892.32</u>	<u>611.01</u>
<u>(Special nett)</u>				
Rear bumper clip	8	necessary	32.00	32.00
		<i>Subtotal 2:</i>	<u>32.00</u>	<u>32.00</u>
		Total cost of parts:	<u>3,924.32</u>	<u>643.01</u>

B LABOUR

To check wiring.			60.00	45.00
To remove and reinstall reverse sensors and check operating functions.			80.00	60.00
To apply anti-rust undercoat.			60.00	30.00
Labour charges to remove and replace, to cut and weld, to panel beating affected and damaged parts.			750.00	500.00
Spray painting charges to paint the rear bumper, rear RH outer panel and necessary areas.			750.00	500.00
		Total cost of labour:	<u>1,700.00</u>	<u>1,135.00</u>
		Total cost of repair:	5,624.32	1,778.01

Report no: 109M0323.PMG
Vehicle no: GBL7620C

9 CONCLUSION

The revised or adjusted cost of repairs to restore the vehicle is \$1,778.01

(a) However, the recommended cost of repair based on lump sum basis would be **\$1,500.00**

(b) The estimated number of days taken to complete the repairs would be **Four (4)**

(1st re-inspection conducted on 29 March 2023)

(Post Repair Inspection conducted on 1 April 2023)

The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.

Note: Lump Sum Repair Basis

This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.

Prepared by:



.....
Liaw Leong San

Licensed Automotive Appraiser

Dated: 26 April 2023

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Email: mirage1195@gmail.com Mobile: 9061 0543

Westcoast Garage
10 Kaki Bukit Road 2
#03-10 First East Centre
Singapore 417868

Invoice no:	POS0109/23
Date:	26 April 2023
Report no:	109M0323.PMG
Vehicle :	GBL7620C

INVOICE


No	Item Description	Qty	Unit Price	Total Amount(\$)
01	Being charges for the inspection of the accident vehicle, transport and photographs.			520.00
SGD(\$):			Payable Amount:	520.00



"Cheque should be crossed and made payable to "Pro-Option Services"

PRO-OPTION SERVICES


.....
Authorised Signature



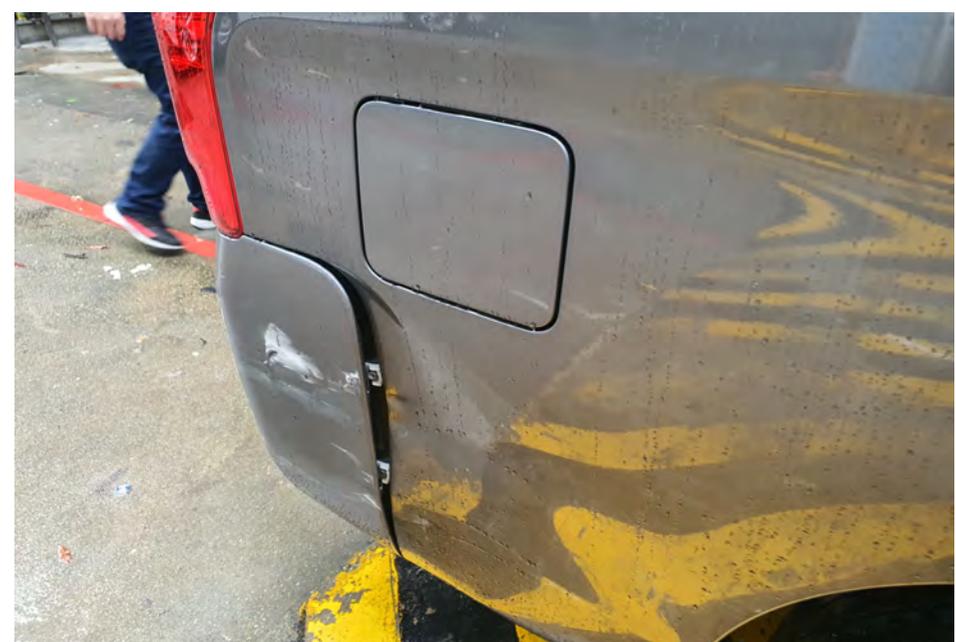

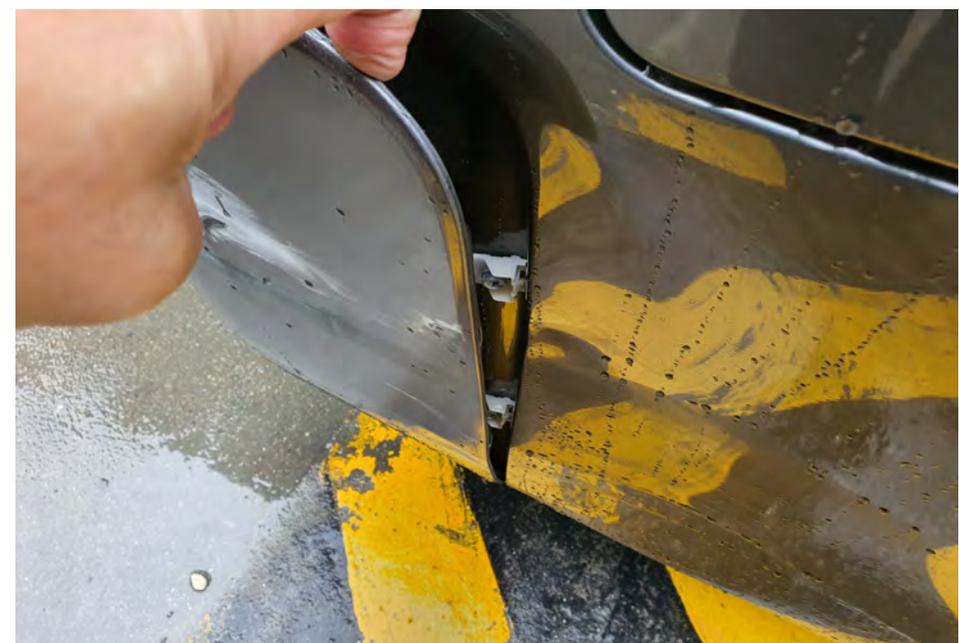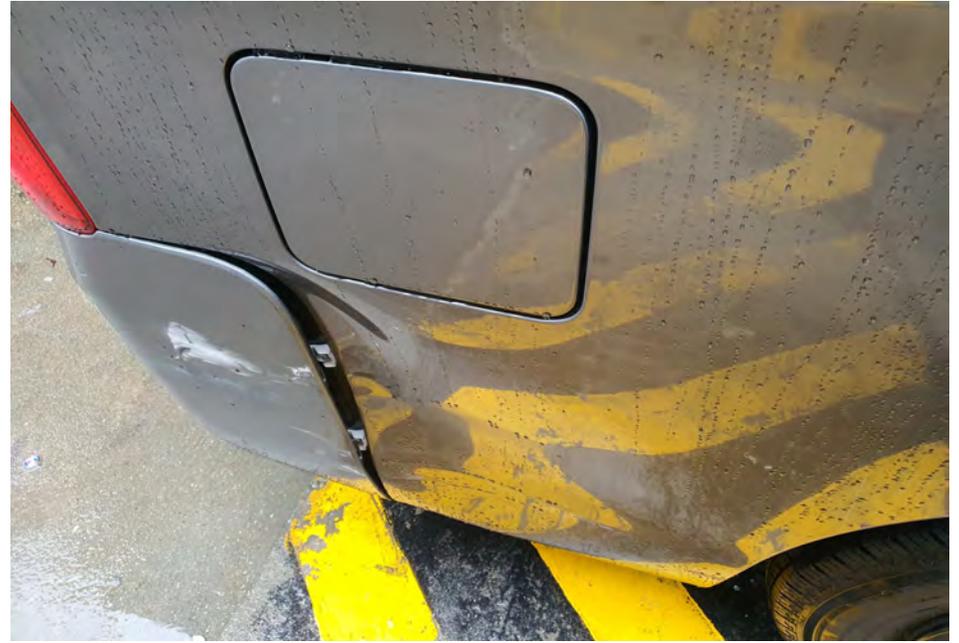



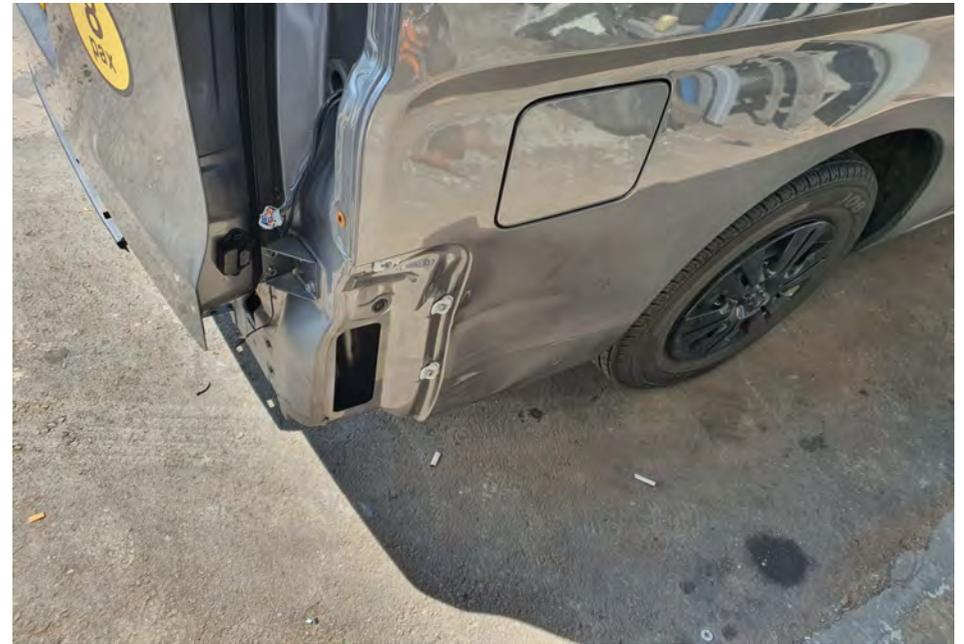



POST REPAIR

Report no: 109M0323.PMG

Vehicle no: GBL7620C



