

21/5422/ARC/jp



**SINCERE APPRAISAL SERVICES PTE LTD** Co.Reg no: 201800639R

420 North Bridge Road, #02-05 North Bridge Centre, Singapore 188727

Tel : 6636 4628 E-mail : office@sincereappraisal.com.sg

## INVOICE

**KSCGP Juris LLP**  
**133 New Bridge Road**  
**17-03 Chinatown Point**  
**Singapore 059413**

**Invoice No:** 241121-225  
**Our ref:** 225/TP/2021  
**Date:** 24/11/2021

<b>Claim Type:</b> Third Party <b>Vehicle Reg No:</b> JQA3386 <b>Vehicle Make/Model:</b> Toyota Camry 2.0	<b>Date of Loss:</b> 9/10/2021 <b>Claimant:</b> Law Wai Keong
Description	Amount (S\$)
1. Professional Fee (including Transport, 46 Photographs and Miscellaneous charges)	626
<b>Total</b>	<b>626</b>
Singapore Dollar: Six hundred and twenty six dollars only.	

Cheques should be crossed A/C PAYEE and made payable to Sincere Appraisal Services Pte Ltd



**Sincere Appraisal Services Pte Ltd**



**SINCERE**  
APPRAISAL SERVICES PTE LTD

## VEHICLE DAMAGE INSPECTION REPORT

Our Ref: 225/TP/2021

Date: 24/11/2021

### REFERENCE

Date of loss: 9/10/2021  
Claimant: Law Wai Keong

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	JQA3386	Make &	Toyota
Reg date:	26/3/2014	Model	Camry 2.0
Colour:	Black	Engine No:	1AZE282417
Type:	Motor Car	Chassis No:	PN153BK5107009011
Type of Claims:	Third Party	Odometer No:	120393km
		Engine Cap:	1998cc

### CONDITION OF VEHICLE AT THE TIME OF SURVEY (STATIC ONLY)

General Condition: Good	Steering: Good	Engine Modification: Nil
Paint work: Good	Handbrake: Good	Pre-accident
	Footbrake: Good	Damage: Nil

### CONDITION OF TYRES

Front Left Size:	Firenza 215/60R16 70%	Front Right Size:	Firenza 215/60R16 70%
Rear Left Size:	Firenza 215/60R16 70%	Rear Right Size:	Firenza 215/60R16 70%

*The above percentages represent the remaining life of the tyre threads*

### COST OF REPAIRS

Parts	Repairer S\$	Adjuster S\$
	\$ 5,757.05	\$ 2,594.70
Labour	\$ 2,410.00	\$ 1,930.00
Calculated Cost (\$\$) :	\$ 8,167.05	\$ 4,524.70

**Recommended Lump Sum Repair Cost (\$\$) : \$ 3,600.00**

Date of Assignment: 11/10/2021  
Date Inspected: 11/10/2021  
Est. repair Period: 08 days


Inspected At: Arc Motorworks Pte Ltd  
10 Kaki Bukit Road 2  
#01-21 First East Center  
Singapore 417868

**SINCERE APPRAISAL SERVICES PTE LTD** Co.Reg no: 201800639R

420 North Bridge Road, #02-05 North Bridge Centre, Singapore 188727

Tel : 6636 4628 E-mail : office@sincereappraisal.com.sg

### POINT OF IMPACT

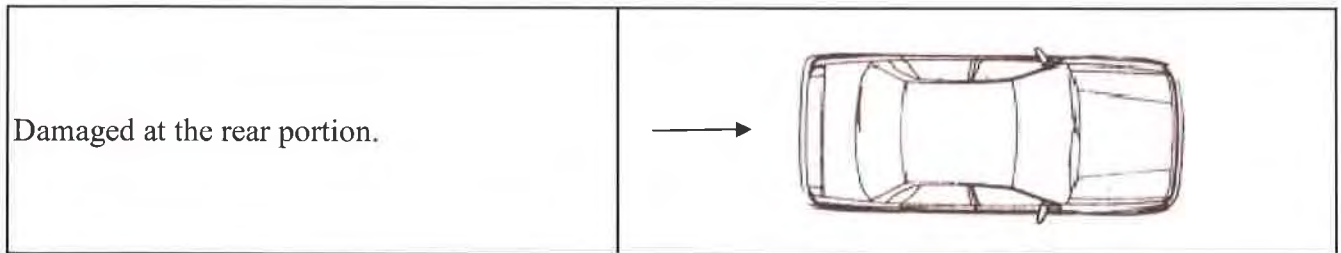

### BRIEF CIRCUMSTANCES OF ACCIDENT

The Insured's vehicle collided onto the Third Party's Vehicle at the slip road of Punggol Way towards TPE Expressway.

### GENERAL DESCRIPTION OF DAMAGES

Our visual inspection of the vehicle revealed that the damages noted are at the rear portion.

### SPECIAL REMARKS

We have inspected the actual damages found on the vehicle and recommend the replacement of parts and repairs accordingly. The estimated repair cost is \$8,167.05. The repairer has agreed to undertake the repairs at our adjusted lump sum amount of \$3,600.00.

We have not authorised the repair. Under normal circumstances, estimated **08** working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.



**Dave Chang**  
Automotive Appraiser  
AUTO. ENG, CAE, CGI  
MIRTE, MSAAA, MTM

Automotive Appraiser: Dave Chang

*Please note that this report is solely based on our findings at the time and place of inspection. This inspection has been carried out to our best knowledge and ability. Any other liability is hereby excluded.*

## ANNEX A

**REPAIR DETAILS**

## Recommended Parts

No	Qty	Description	Condition	Repairer's Amount	Adjuster's Amount
1	1	Rear bumper assy	warped/dented	\$ 1,288.90	\$ 1,288.90
2	2	Rear bumper reflector	bent/necessary	\$ 187.20	\$ 187.20
3	2	Rear bumper retainer	bent/necessary	\$ 172.80	\$ 172.80
4	2	Rear bumper bracket	bent/necessary	\$ 177.40	\$ 177.40
5	1	Rear bumper reinforcement	bent/warped	\$ 393.30	\$ 393.30
6	1	Rear bootlid assy	repair	\$ 1,476.90	\$ -
7	1	Rear left taillamp	reuse	\$ 792.30	\$ -
8	1	Rear right taillamp	reuse	\$ 792.30	\$ -
9	1	Rear end lower panel	repair	\$ 848.30	\$ -
				\$ 6,129.40	\$ 2,219.60
Less 25%				\$ 1,532.35	\$ 554.90
				\$ 4,597.05	\$ 1,664.70
<u>Special Nett Items</u>					
1	10	Rear bumper clips	necessary	\$ 60.00	\$ 50.00
2	4	Rear bumper reverse sensor	malfunction	\$ 1,000.00	\$ 800.00
3	1	Rear no plate with garnish	necessary	\$ 100.00	\$ 80.00
				\$ 1,160.00	\$ 930.00
<b>Total parts</b>				<b>\$ 5,757.05</b>	<b>\$ 2,594.70</b>

## ANNEX B

**REPAIR DETAILS**

## Recommended Labour

No	Description	Repairer's Amount	Adjuster's Amount
1	Labour for panel beating, cut, weld, straighten rear affected area and replace rear damaged parts.	\$ 1,000.00	\$ 800.00
2	To putty and spray painting rear portion.	\$ 1,000.00	\$ 800.00
3	To check rear lighting and wiring.	\$ 50.00	\$ 30.00
4	To remove and install rear inner garnish and trim to facilitate the repair.	\$ 140.00	\$ 120.00
5	To apply anti rust proofing to rear affected area.	\$ 140.00	\$ 120.00
6	To remove and install rear bumper reverse sensor.	\$ 80.00	\$ 60.00
<b>Total labour :</b>		<b>\$ 2,410.00</b>	<b>\$ 1,930.00</b>

## ANNEX C

**REPAIR DETAILS**

## Adjusted Repair Cost


	Repairer's Amount	Adjuster's Amount
<b>Total parts :</b>	<b>\$ 5,757.05</b>	<b>\$ 2,594.70</b>
<b>Total labour :</b>	<b>\$ 2,410.00</b>	<b>\$ 1,930.00</b>
<b>Total repair cost :</b>	<b>\$ 8,167.05</b>	<b>\$ 4,524.70</b>

**Adjusted Repair Cost (Lump Sum Repair)****\$ 3,600.00**







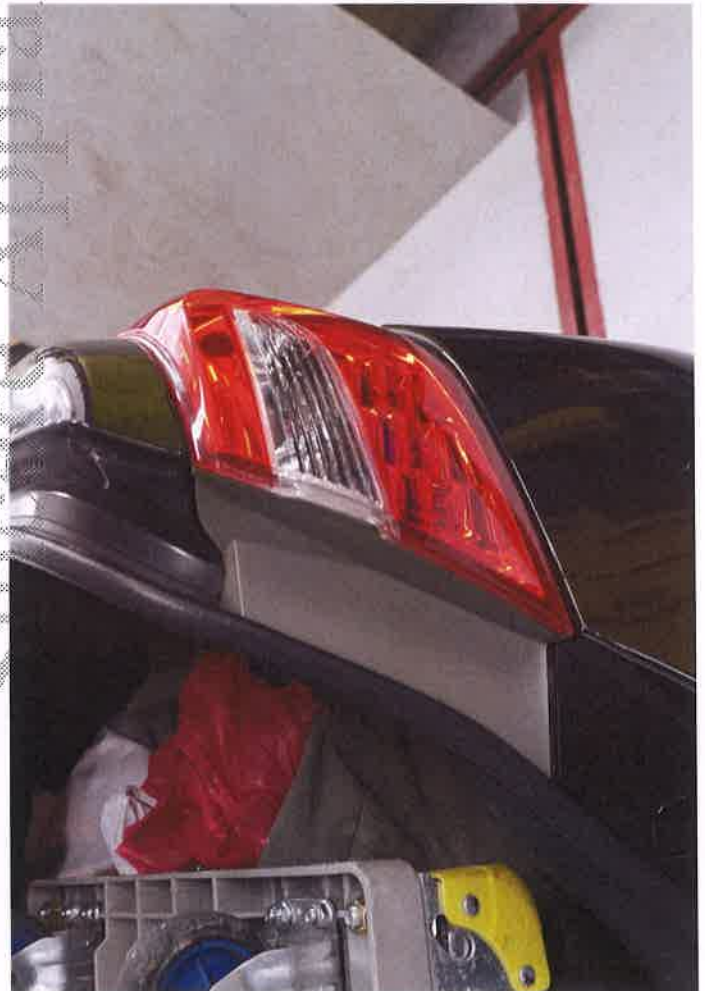
























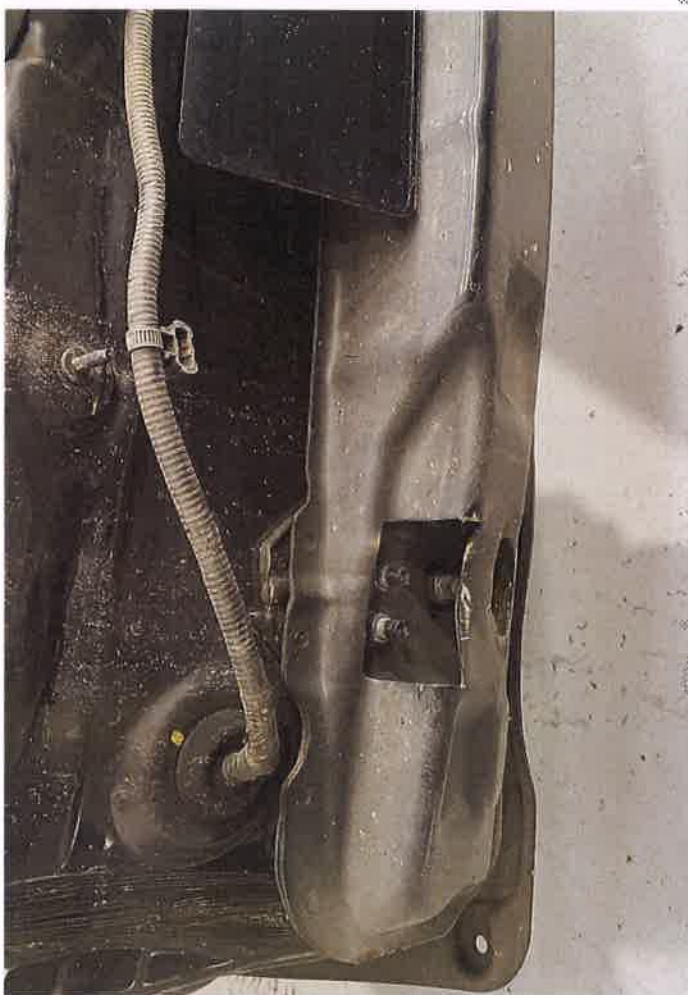













Sincero Appraisal Services ©