



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SNJ 614K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	FRONT BUMPER	DISTORTED	1,517.00	1,517.00
1	FRONT BUMPER CENTRE BLACK	GRAZED	585.00	585.00
1	FRONT BUMPER LOWER BLACK	GRAZED	585.00	585.00
1	FRONT BUMPER PDC SENSOR O/S	MALFUNCTION	185.00	185.00
1	FRONT BUMPER SIDE RETAINER O/S	CRACKED	75.20	75.20
1	FRONT BUMPER SPONGE	TORN	208.10	208.10
1	FRONT BUMPER BEAM	NOT NECESSARY	455.10	-
1	SET FRONT BUMPER CLIPS	NECESSARY	50.00	50.00
1	HEADLAMP O/S	SCRATCHED / CRACKED	3,029.00	3,029.00
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	1,041.20	-
1	FRONT FENDER O/S	TO REPAIR SEE LABOUR	685.10	-
1	FRONT FENDER INNER SHIELD O/S	TORN	225.10	225.10
1	SET FRONT FENDER INNER SHIELD CLIPS O/S	NECESSARY	45.00	45.00
1	WIPER WASHER TANK	DEFORMED	266.00	266.00
1	FRONT HUB CAP O/S	CUT	225.00	225.00
1	FRONT STEEL RIM O/S	TO REPAIR SEE LABOUR	300.00	-
1	FRONT LOWER ARM O/S	NOT NECESSARY	815.10	-
1	FRONT SHOCK ABSORBER O/S	NOT NECESSARY	455.20	-
1	FRONT KNUCKLE ARM O/S	NOT NECESSARY	485.10	-
	LESS 25% DISCOUNT		-2,808.05	-1,748.85
			8,424.15	5,246.55
	<b><u>LABOUR</u></b>			
	TO CHECK WIRING.		50.00	20.00
	TO SPRAY RUST PROOFING.	NOT NECESSARY	50.00	-
	TO DISMANTLE & REPLACED FRONT PDC SENSOR.		50.00	40.00
	TO CONDUCT WHEEL ALIGNMENT.		60.00	60.00
	TO REFILL AIR CON GAS.	NOT NECESSARY	120.00	-

Report Ref No. CS/SMO23005488/Uny3e2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	LABOUR FOR PANEL BEATING & REPLACED PARTS. INCLUSIVE OF THE REPAIR OF FRONT SUPPORT PANEL, FRONT FENDER O/S AND FRONT STEEL RIM O/S. TO PUTTY & SPRAY PAINTING.		750.00	400.00
			750.00	500.00
			1,830.00	1,020.00
GRAND TOTAL			10,254.15	6,266.55
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,000.00

Report Ref No. CS/SMO23005488/Uny3e2

**CHUA KANG SENG**

**Licensed Appraiser**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.