

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/AIS23005694/TNP3E2**Date:** 12/06/2023REFERENCE

Handling Insurer: Allianz Insurance Singapore Pte. Ltd.

Policy No:

Claimant Vehicle No : GBF5501H**Insured Vehicle No :** SNB7910B

Date of Loss: 30/05/2023

Nature of Claim: TP

Claim No: 2023 32009010SL

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **GBF5501H**

Make & Model: TOYOTA DYNA 1.5T, 3.0 (M)

Engine No: 1KD1546968

Reg. Date: 26/12/2006 (Man. Year: 2006)

Chassis No: JTFAT35Y803000149

Colour: Silver

Odometer: 536609 km

Engine Capacity: 2982 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:

Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable):

Yes

Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195 R15

Rear Tyre Size: 195 R15 (D)

Front Left Side: Bridgestone 6 mm

Rear Left Side: Bridgestone 6/6 mm

Front Right Side: Bridgestone 6 mm

Rear Right Side: Bridgestone 6/6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	
Global Sum Settlement (S\$)		0.00		

INSPECTION

Date of Assignment: 05/06/2023

Date Inspected: 08/06/2023

Inspected At:

U E MOTOR (HQ)
3006, Ubi Road 1, #01-334
Singapore 408700

Estimated Period of Repair: 8.0 days

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** HUEY YON*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.

THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$7,000.00
-\$8,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 12 Jun 2023)	
Parts:	N/A	TOYOTA DYNA 1.5T 3.0 (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBF5501H)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >