

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CC3/TMI23005893/KNP3M4**Date:** 03/07/2023**REFERENCE**

Handling Insurer:	Tokio Marine Insurance Singapore Ltd	Policy No:	MD001729
<b>Claimant Vehicle No :</b>	SHD5991R	<b>Insured Vehicle No :</b>	YN1576D
Date of Loss:	07/06/2023	Nature of Claim:	TP
		Claim No:	M2303457

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No:	<b>SHD5991R</b>	Engine No:	2ZR2B79786
Make & Model:	TOYOTA PRIUS, 1.8 5DR HATCHBACK (A)	Chassis No:	JTDKB3FU403077290
Reg. Date:	12/12/2018 (Man. Year: 2018)	Odometer:	269401 km
Colour:	Metallic Pearl White/Red		
Engine Capacity:	1798 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

**CONDITION OF TYRES**

Front Tyre Size:	195/65R15	Rear Tyre Size:	195/65R15
Front Left Side:	Wanli 6 mm	Rear Left Side:	Sailun 8 mm
Front Right Side:	Wanli 6 mm	Rear Right Side:	Sailun 8 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	12,570.76	9,499.25	3,071.51	24.43
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,590.00	1,380.00	2,210.00	61.56
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>16,160.76</b>	<b>10,879.25</b>	<b>5,281.51</b>	<b>32.68</b>
<b>Approved Total (Overridden) (S\$)</b>		<b>8,700.00</b>		
<b>(S\$)</b>	16,160.76	8,700.00	7,460.76	46.17
<b>+ GST 8.00/8.00% (S\$)</b>	1,292.86	696.00	596.86	46.17
<b>Nett Amount (S\$)</b>	<b>17,453.62</b>	<b>9,396.00</b>	<b>8,057.62</b>	<b>46.17</b>

**INSPECTION**

Date of Assignment:	22/06/2023		
Date Inspected:	08/06/2023	Inspected At:	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111
Estimated Period of Repair:	4.0 days		

**Adjuster:** KENNETH KONG**Manager:** HUEY YON*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 03 Jul 2023)
Parts:	144	TOYOTA PRIUS 1.8 5DR HATCHBACK (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SHD5991R)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*COVER, FRONT BUMPER	Jammed	653.31 FL	*653.31 FL
2	1		*ABSORBER, FRONT BUMPER ENERGY	Cracked	100.17 FL	*100.17 FL
3	1		*REINFORCEMENT SUB-ASSY, FRONT BUMPER	Bent	902.16 FL	*902.16 FL
4	1		*EXTENSION, FRONT BUMPER, LH	Repair	151.41 FL	*- FL
5	1		*EMBLEM ASSY, RADIATOR GRILLE	Necessary	114.98 FL	*114.98 FL
6	1		*GRILLE SUB-ASSY, RADIATOR	Serviceable	436.38 FL	*- FL
7	1		*GRILLE, RADIATOR, LOWER NO.1	Serviceable	214.41 FL	*- FL
8	1		*COVER, FRONT BUMPER HOLE, LH	Serviceable	37.07 FL	*- FL
9	1		*STAY SUB-ASSY, FRONT BUMPER, LH	Bent	59.85 FL	*59.85 FL
10	1		*BRACKET, FRONT BUMPER SIDE, LH	Distorted	74.97 FL	*74.97 FL
11	1		*LOUVER SUB-ASSY, COWL TOP VENTILATOR	Dented/Cut	865.83 FL	*865.83 FL
12	1		*PROTECTOR, COWL TOP VENTILATOR LOUVER	Missing	20.58 FL	*20.58 FL
13	1		*PANEL, INSTRUMENT PANEL FINISH, END RH	Serviceable	146.37 FL	*- FL
14	1		*GLASS, WINDSHIELD	Cracked	1,993.53 FL	*1,993.53 FL
15	1		*MOULDING, WINDSHIELD, OUTSIDE RH	Dented	107.73 FL	*107.73 FL
16	1		*HOOD SUB-ASSY	Bent	1,243.20 FL	*1,243.20 FL
17	1		*LOCK ASSY, HOOD	Repair	170.31 FL	*- FL
18	1		*HINGE ASSY, HOOD, LH	Bent	74.34 FL	*74.34 FL
19	1		*HINGE ASSY, HOOD, RH	Bent	74.34 FL	*74.34 FL
20	1		*LAMP ASSY, FOG, LH	Mtg Cracked	1,200.78 FL	*1,200.78 FL
21	1		*UNIT ASSY, HEADLAMP, LH	Broken	3,325.56 FL	*3,325.56 FL
22	1		*COVER SUB-ASSY, FRONT PILLAR, UPR RH	Distorted	126.74 FL	*126.74 FL
23	1		*FENDER SUB-ASSY, FRONT LH	Bent	1,236.69 FL	*1,236.69 FL
24	1		*BRACE SUB-ASSY, FENDER APRON, RH	Repair	368.24 FL	*- FL
25	1		*APRON ASSY, FRONT FENDER, RH	Repair	222.71 FL	*- FL
26	1		*EMBLEM, SIDE PANEL LH	Necessary	68.88 FL	*68.88 FL
27	1		*LINER, FRONT FENDER, LH	Torn	255.36 FL	*255.36 FL
28	1		*RIM	Serviceable	1,995.11 FL	*- FL
29	1		*FRT BUMPER CLIP	Necessary	65.00 FS	*60.00 FS
30	1		*FENDER CLIP	Not Necessary	130.00 FS	*- FS
31	1		*FENDER LINER CLIP	Necessary	130.00 FS	*65.00 FS
32	1		*FRT LH BUMPER RETAINER CLIP	Not Necessary	65.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	16,631.01	12,624.00
- List Item Discount on L Items 25.00/25.00% (S\$)	4,060.25	3,124.75
Total Parts (S\$)	12,570.76	9,499.25

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR	New	380.00	0.00
2	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME	New	1,400.00	500.00
3	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	1,400.00	800.00
4	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS	New	240.00	60.00
5	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	170.00	20.00
<b>Gross Labour Cost (S\$)</b>			<b>3,590.00</b>	<b>1,380.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >