# PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189 Fax: 6315 3298, Mobile: 9061 0543

### **ACCIDENT VEHICLE INSPECTION REPORT**

Report no

: 1226M22.MCS

Vehicle no

: SNB3935G

1 REFERENCE

Date of inspection

: 28 December 2022

Requested by

: Chan Kian Hung, Daniel

Blk 46 Lengkok Bahru

#11-249

Singapore 150046

Type of survey

: Independent

Repairer

: Master Car Spray Service

Blk 40 Toh Guan Road East, #01-67 Enterprise Hub, Singapore 608582

COE Expiry Date:

Date of accident

: 17 December 2022

2 VEHICLE DATA

Make/model

: B.M.W. 640I GRAN COUPE M SPORT LED SR NAV HUD

Chassis no

: WBA6A02080DZ10439

Engine no

: 08588190N55B30A

Date of registration

: 21 August 2012

Engine capacity

: 2979 cc

Odometer reading

: 152905 km

Colour

: Black

#### 3 STATIC CONDITION CHECK

Steering

: Affected

Foot brakes

: Serviceable

Hand brakes

: Serviceable

Paintwork

: Good

General Condition

: Good

4 TIRE CONDITION CHECK

RH/MAKE

LH/MAKE

SIZE

31 May 2031

Front tread

: 6 mm/Michelin

6 mm/Michelin

225/35ZR20

Rear tread

: 6 mm/Michelin

6 mm/Michelin

225/35ZR20

#### 5 BRIEF DESCRIPTION OF DAMAGE

Rear bumper grazed, RH rear door scraped/bent, RH front door scraped/bent, RH front fender scraped/bent, front bumper scraped, RH front door pillar bent, RH rocker panel skirt grazed, etc. Please se e para. 8 of this report for more details.

#### 6 REMARKS

This inspection is carried out on a "WITHOUT PREJUDICE" basis and I have not authorized any repairs.

## 7 RECOMMENDATION

Cost of repairs

\$9,600.00 (lump sum)

Estimated no of days

Three (3)

# **8 ASSESSMENT OF DAMAGE AND COSTS**

 Report no:
 1226M22.MCS

 Vehicle no:
 SNB3935G

A	SPARE PARTS		<u>Assessed</u>	Repairer's	Revised
	Description	Qty	<u>Condition</u>	<u>Amount</u>	<u>Amount</u>
	RH rear door assy	1	scraped/bent	2,430.00	$2,430.00 \times R$
	RH rear fender	1	to repair	1,800.00	$0.00 \times R$
	RH front door assy	1	scraped/bent	2,433.00	2,433.00× R
	Front bumper	1	to repair	1,465.00	$0.00 \times R$
	RH front fender	1	scraped/bent	930.00	930.00 × R
	RH front fender splash shield	1	bent/deformed	140.00	140.00 × nn
	RH front fender splash shield clip	8	necessary	40.00	40.00 <mark>× nn</mark>
	RH front fender sound proof foam	1	squashed/deformed	45.00	45.00 <b>X</b> nn
	Wiper washer tank	1	squashed	128.00	128.00 × nn
	Rear bumper	1	to repair	1,345.00	0.00× R
	RH rocker panel skirt	1	to repair	455.00	0.00 <mark>× nn</mark>
			Subtotal of the above	11,211.00	6,146.00
e e			Discount 10% / 10 <sup>4</sup>	% 1,121.10	614.60
W.	(Special nett)		Subtotal 1:	10,089.90	5,531.40
	Sport rim set	1	Frt & Rear - dented/scraped/cut	4,020.00	4,020.00
			Subtotal 2:	4,020.00	4,020.00
			Total cost of parts:	14,109.90	9,551.40
В	LABOUR To check door wiring and electrical system	n far	condition	60.60	A= 66 /
	To check door wiring and electrical system for condition.			60.00	45.00 🗸
	To remove and transfer rear door glass.			120.00	90.00 ×
	To remove and transfer front door glass.			120.00	90.00×
	<u> </u>				70.007
	To apply anti-rust undercoat.			200.00	90.00×
_	Labour charges to remove and replace, to cut and weld, to panel beating affected and damaged parts.			750.00	500.00 🗸
	Spray painting charges to paint the front fender, front door, rear door, rear fender, rocker panel garnish, rear bumper and necessary areas.			2, <b>1</b> 00.00	1,500.00 250 ✓
	To conduct 4-wheel computerised alignment to check and realign wheels.			90.00	90.00 ✓
			Total cost of labour:	3,440.00	2,405.00
			Total cost of repair:	17,549.90	11,956.40

3 days P/P - 1885

Report no:

1226M22.MCS

Vehicle no:

SNB3935G

#### 9 CONCLUSION

The revised or adjusted cost of repairs to restore the vehicle is

\$11,956.40

(a) However, the recommended cost of repair based on lump sum basis would be

\$9,600.00

(b) The estimated number of days taken to complete the repairs would be

Three (3)

(1st re-inspection conducted on 28 December 2022) (Post Repair Inspection conducted on 30 December 2022)

The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its preaccident condition.

## Note: Lump Sum Repair Basis

This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.

Yours faithfully

Liaw Leong San

Licensed Automotive Appraiser

Dated:

25 January 2023