

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG23006268/APA3Q2**Date:** 20/07/2023**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	7990000064
Claimant Vehicle No :	SNJ7517L	Insured Vehicle No :	GBK3580R
Date of Loss:	01/06/2023	Nature of Claim:	TP
		Claim No:	6610720247SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SNJ7517L		
Make & Model:	NISSAN SYLPHY, 1.6 CVT ABS D/AIRBAG 2WD 4DR (A)	Engine No:	HR16986483B
Reg. Date:	22/04/2016 (Man. Year: 2016)	Chassis No:	MNTBBAB17Z0026903
Colour:	Bronze	Odometer:	133032 km
Engine Capacity:	1598 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Continental 6 mm	Rear Left Side:	Continental 6 mm
Front Right Side:	Continental 6 mm	Rear Right Side:	Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	13,529.37	5,119.82	8,409.55	62.16
Miscellaneous Items	0.00	0.00	0.00	
Labour	7,150.00	2,790.00	4,360.00	60.98
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	20,679.37	7,909.82	12,769.55	61.75
Approved Total (Overridden) (\$\$)		6,300.00		
Nett Amount (\$\$)	20,679.37	6,300.00	14,379.37	69.53
Global Sum Settlement (\$\$)		0.00		

INSPECTION

Date of Assignment:	12/06/2023	
Date Inspected:	12/06/2023	Inspected At: Sm Automotive - Kaki Bukit (HQ) BLOCK C - 1, KAKI BUKIT AVE 6, #01-43 Singapore 417883
Estimated Period of Repair:	7.0 days	

Adjuster: ADRIAN LING**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BOOTLID	Dented	1,259.60 FL	*851.00 FL
2	1		*REAR BOOTLID LOCK	Damaged	212.60 FL	*115.00 FL
3	1		*REAR BOOTLID EMBLEM LOGO	Necessary	55.20 FL	*55.20 FL
4	1		*REAR BOOTLID EMBLEM SYLPHY	Necessary	62.30 FL	*62.30 FL
5	1		*REAR BOOTLID EMBLEM FUEL DRIVE	Necessary	58.20 FL	*58.20 FL
6	1		*REAR BOOTLID LOCK DETECTOR	Damaged	164.20 FL	*164.20 FL
7	1		*REAR BOOTLID TOP CHROME MOULDING	Cracked	325.90 FL	*325.90 FL
8	1		*REAR BOOTLID BOTTOM CHROME MOULDING	Damaged	265.50 FL	*265.50 FL
9	1		*REAR BOOTLID INNER TRIM	Not Necessary	354.20 FL	*- FL
10	2		*REAR BOOTLID LAMP	Cracked	685.60 FL	*435.20 FL
11	1		*REAR BUMPER	Deformed	712.10 FL	*712.10 FL
12	1		*REAR BUMPER BRACKET	N/S Dented	191.60 FL	*95.80 FL
13	2		*REAR BUMPER SIDE SPONGE	Cracked	151.20 FL	*90.00 FL
14	1		*REAR BUMPER CENTER SPONGE	Cracked	88.60 FL	*88.60 FL
15	1		*REAR BUMPER OUTER CHROME MOULDING	Not Necessary	159.60 FL	*- FL
16	2		*REAR BUMPER REFLECTOR	Not Necessary	195.00 FL	*- FL
17	2		*REAR BUMPER SIDE RETAINER	Not Necessary	118.40 FL	*- FL
18	1		*REAR END PANEL	Dented	619.50 FL	*492.00 FL
19	1		*REAR END PANEL TOP GARNISH	Deformed	312.80 FL	*85.00 FL
20	1		*REAR END PANEL KEYLESS SENSOR	Not Necessary	176.20 FL	*- FL
21	1		*REAR WEATHERSTRIPE	Cut	184.60 FL	*184.60 FL
22	2		*REAR TAILLAMP	Cut	1,163.00 FL	*481.00 FL
23	2		*REAR TAILLAMP INNER PANEL	Repair	643.20 FL	*- FL
24	1		*REAR SPARE TYRE COMPARTMENT PANEL	Repair	898.50 FL	*- FL
25	1		*REAR SPARE TYRE COMPARTMENT PANEL TOP BOARD	Not Necessary	495.10 FL	*- FL
26	1		*REAR SPARE TYRE COMPARTMENT SPONGE	Deformed	175.60 FL	*175.60 FL
27	2		*REAR SIDE FLOOR PANEL	Not Necessary	797.20 FL	*- FL
28	2		*REAR FENDER	Repair	1,978.80 FL	*- FL
29	1		*REAR WINDSCREEN GLASS MOULDING	Not Necessary	291.40 FL	*- FL
30	1		*REAR EXHAUST MUFFLER	Not Necessary	798.20 FL	*- FL
31	2		*REAR EXHAUST MUFFLER RUBBER MOUNTING	Not Necessary	42.80 FL	*- FL
32	2		*BOOTLID HINGE	Bent	162.60 FL	*162.60 FL
33	1		*REAR REVERSE CAMERA	Damaged	420.00 FS	*420.00 FS
34	1		*REAR BUMPER CLIPS	Necessary	80.00 FS	*30.00 FS
35	1		*REAR END PANEL SEALANT	Necessary	120.00 FS	*60.00 FS
36	1		*REAR WINDSCREEN GLASS SEALANT	Not Necessary	150.00 FS	*- FS
37	1		*REAR NUMBER PLATE WITH CASING	Not Necessary	60.00 FS	*- FS
38	1		*REAR BUMPER REVERSE SENSOR	Damaged	280.00 FS	*200.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	14,909.30	5,609.80
- List Item Discount on L Items 10.00/10.00% (\$)	1,379.93	489.98
Total Parts (\$)	13,529.37	5,119.82

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR FOR PANEL BEATING	New	2,800.00	1,200.00
2	LABOUR FOR SPRAYPAINTING	New	2,400.00	1,200.00
3	WIRING CHECK	New	80.00	30.00
4	TO APPLY RUST PROOF /TUFF COAT ON ACCIDENT AREAS	New	300.00	100.00
5	LABOUR FOR REMOVE & RENEW REAR EXHAUST MUFFLER /TO REPAIR & STRAIGHTEN REAR EXHAUST PIPE	New	300.00	0.00
6	LABOUR FOR REMOVE & REFIX REAR WINDSCREEN GLASS	New	150.00	0.00
7	TO CONDUCT WATER CHECK LEAKAGE	New	120.00	0.00
8	LABOUR FOR REPAIR & STRAIGHTEN BOTH REAR CHASSIS FRAME	New	500.00	0.00
9	LABOUR FOR REMOVE & RENEW REAR REVERSE SENSOR /CAMERA	New	200.00	100.00
10	LABOUR FOR REMOVE AND REFIT UPHOLSTERY	New	150.00	80.00
11	LABOUR FOR REMOVE AND REFIT BOOTLID FITTINGS	New	150.00	80.00
Gross Labour Cost (S\$)			7,150.00	2,790.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >