

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/HLA22002837/VTY3E2
Date: 11/04/2022

REFERENCE

Handling Insurer:	HL Assurance Pte Ltd	Policy No:	MP319845		
Claimant Vehicle No :	SLR2303B	Insured Vehicle No :	SMP3046K		
Date of Loss:	26/03/2022	Nature of Claim:	TP	Claim No:	MPC03267/GN

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLR2303B		
Make & Model:	TOYOTA LEXUS, 3.5 GS450H CVT LUXURY (A)	Engine No:	2GR8761679
Reg. Date:	29/11/2012 (Man. Year: 2012)	Chassis No:	JTHBS1BL505002599
Colour:	Black	Odometer:	174135 km
Engine Capacity:	3456 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	235/45 R18	Rear Tyre Size:	235/45 R18
Front Left Side:	Yokohama 6 mm	Rear Left Side:	Yokohama 6 mm
Front Right Side:	Yokohama 6 mm	Rear Right Side:	Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	28/03/2022		
Date Inspected:	28/03/2022	Inspected At:	Garage 13 Pte Ltd (HQ) 8 Kaki Bukit Ave 4, Premier @ Kaki Bukit, #03-46 Singapore 415875
Estimated Period of Repair:	4.0 days		

Adjuster: Thevan Thomas Karthikesavan

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000.00 - \$5,000.00

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 06 Apr 2022)

Parts: 143 TOYOTA LEXUS 3.5 GS450H CVT LUXURY (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: **LKK Auto Consultants Pte Ltd/SLR2303B/11/04/2022 09:10**

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

There are no new parts selected.

LKK Auto Consultants Pte Ltd/SLR2303B/11/04/2022 09:10. Not valid without Reference section.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

LKK Auto Consultants Pte Ltd/SLR2303B/11/04/2022 09:10. Not valid without Reference section.

< END OF ESTIMATES >