

Motorcycle Appraisal Service Pte Ltd  
UEN: 202221186K  
Email: MotorcycleAppSvc@gmail.com  
Contact: 96724751

Our Ref : MAS/TP/2023-24  
Invoice Ref : MAS/TP/2023-24  
Vehicle No. : AT22U  
Attn : RWAVE PTE LTD  
Company : RWAVE PTE LTD  
Address : Midview Building  
50 Bukit Batok Street 23  
#02-25  
Singapore 659578

**INVOICE**

\$

Surveyor Fee	550
Re-inspection Fee	120
Transportation Fee	80
Photographs ( @ \$1 per photo, total 77 photos)	77
Total	827

Yours Faithfully  
MOTORCYCLE APPRAISAL SERVICE



---

Jency Chua  
Automotive Appraisal

Motorcycle Appraisal Service Pte Ltd  
UEN: 202221186K  
Email: MotorcycleAppSvc@gmail.com  
Contact: 96724751

**ACCIDENT DAMAGED VEHICLE INSPECTION REPORT**

M/S	: RWAVE PTE LTD	Date	: 19/6/2023
	C/O RWAVE PTE LTD	Our Ref	: MAS/TP/2023-24
	Midview Building		
	50 Bukit Batok Street 23		
	#02-25 Singapore 659578		

**REFERENCE PARTICULARS**

Date of Accident	: 28 April 2023	Type of Inspection	: Third Party Claim
Date of Inspection	: 22 May 2023	Date of Re-Inspection	: 14 June 2023

**VEHICLE PARTICULARS**

Registration No.	: AT22U	Engine No.	: 4D0281411
Make	: YAMAHA	Chassis No.	: 4D0281411
Model	: Fino 115	Odometer	: 2734
Year	: 2008	Colour	: White

**CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)**

Engine Condition	: Working Condition	General Body Work	: Average
Foot Brake	: Serviceable	Steering	: Serviceable
Hand Brake	: Serviceable	Lightings	: Serviceable

**TYRE CONDITION (REMAINING ESTIMATED LIFE OF TYRE IN MM)**

	<u>Make</u>	<u>Size</u>	<u>Thread Balance</u>
Front side	: Shinko	80/80-18	5mm
Rear side	: Corsa	80/80-18	5mm

**GENERAL DESCRIPTION OF DAMAGES**

Damages were located all around the vehicle.

For more accurate details, please refer to the assessment for repairs and photographs attached.

**ASSESSMENT SUMMARY**

Our assessment of the repair costs to pre-accident condition was S\$5462 nett at a lump sum basis.  
(subject to GST if applicable)

Under normal circumstances, estimated period required for repairs is: Ten (10) working days.

Enclosed herewith the 77 photographs depicting damages to the vehicle.

Inspection conducted at: RWAVE PTE LTD  
50 Bukit Batok Street 23, Midview Building, #02-25, Singapore 659578

In accordance to your instruction, we have not authorized repairs and inspection was conducted strictly on a "**WITHOUT PREJUDICE BASIS**".

Motorcycle Appraisal Service Pte Ltd  
UEN: 202221186K  
Email: MotorcycleAppSvc@gmail.com  
Contact: 96724751

Vehicle No. : AT22U  
Model : Yamaha Fino 115

Our Ref. : MAS/TP/2023-24

## ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS

### DESCRIPTION OF PARTS AND NATURE OF REPAIRS

S/N	SPARE PARTS	QUANTITY PC/SET	ASSESSED CONDITION	ORIGINAL QUOTATION (\$)	REVISED QUOTATION (\$)
1	Fender front	1	broken	100	90 ✓
2	Seat front cover	1	clip broken	100	80 ✗
3	Cover side 1	1	broken	120	110 ✓
4	Cover side 2	1	necessary	120	110 ✓
5	Cover side 3	1	clip broken	100	80 ✓
6	Board footrest	1	broken	150	120 ✓
7	Cover 1	1	broken	100	80 ✓
8	Leg shield 1	1	broken	120	110 ✓
9	Leg shield 2	1	broken	120	110 ✓
10	Fender inner	1	broken	100	90 ✓
11	Cover under 1	1	scratches	120	110 ✓
12	Cover under 2	1	necessary	100	90 ✓
13	Panel inner 1	1	broken	110	100 ✓
14	Cover headlight	1	necessary	100	80 ✓
15	Under bracket comp	1	out of shape	360	350 ✗
16	Fork assy L/R	1 set	bent	360	350 ✓
17	Handlebar	1	out of shape	220	200 ✓
18	Cover handlebar upper 1	1	scratches	80	60 ✓
19	Tail cover	1	broken	100	80 ✓
20	Air duct	1	torn	90	80 ✓
21	Crankcase upper cover	1	broken	150	130 ✓
22	Box rack	1	out of shape	220	200 ✗
23	Box	1	cracked	220	200 ✓
24	Mirrors	1 set	dented	100	90 ✓
25	Handlebar grips	1 set	necessary	80	70 ✗
26	Bar balancer	1 set	dented	100	90
27	Brake lever	1	scratches	80	60 ✗
28	Clutch lever	1	scratches	80	60 ✓
			<b>Total</b>	3800	3380
			<b>Less 10%</b>	380	338
			<b>Sub Total</b>	3420	3042

nn

nn

nn

nn

40 ✓

nn

2570  
-10%  
2313

S/N	SPECIAL NETT ITEMS	QUANTITY PC/SET	ASSESSED CONDITION	ORIGINAL QUOTATION (\$)	REVISED QUOTATION (\$)	
1	Front license plate	1	required	60	50	30
2	Steering cone	1	necessary	300	250	85
<b>Total</b>				360	300	105

S/N	LABOUR CHARGES & MISC	QUANTITY PC/SET	ASSESSED CONDITION	ORIGINAL QUOTATION (\$)	REVISED QUOTATION (\$)	
1	Replace, realign and adjust above damaged parts and check wiring and lightning system	1	necessary	1100	1000	200
2	To knock, straighten chassis and body balancing	1	necessary	1100	1000	150
3	To respray on accident affected area			NA	NA	
4	Towing service	1	Necessary	150	120	80
5						
<b>Sub Total</b>				2350	2120	
<b>Total</b>				6130	5462	430

#### **POINT OF IMPACT**

Vehicle was collided with a taxi and rider was injured and brought up to ambulance afterwards. It causes several damages all around the vehicle especially the fairing and coverset.

2848

#### **ADJUSTMENT/ RECOMMENDATIONS**

We have thoroughly inspected each and every item on the repairer's estimates against the actual damaged found on the vehicle. We have listed the breakdown of our findings and recommendations as per assessment above.

L/S - 2278.40  
= 2300

#### **CONCLUSION**

The repairer has agreed to undertake repair the vehicle at a lump sum basis of S\$5462 nett corresponding to the replacement of parts, spray painting and labour charges. We now revert for your decision on the above claim.

3 days

Yours Faithfully  
MOTORCYCLE APPRAISAL SERVICE

*Jency*

Jency Chua  
Automotive Appraisal