



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJT 9846T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	FRT DOOR RH	TO REPAIR SEE LABOUR	784.60	-
1	FRT DOOR LOCK RH	NOT NECESSARY	352.90	-
1	RH DOOR CENTER PILLAR	TO REPAIR SEE LABOUR	685.20	-
1	RR DOOR RH	DENTED	813.20	813.20
2	RR DOOR HINGE RH @\$47.20	BENT	94.40	94.40
1	RR DOOR CHECKER RH	BENT	52.20	52.20
1	RR DOOR GLASS MOULDING RH	DENTED/BENT	128.90	128.90
1	RR DOOR OUTER HANDLE RH	REFIT	186.20	-
1	RR DR.P/WINDOW REGULATOR ASSY RH	REFIT	424.30	-
1	RR DOOR TRIM BOARD RH	DENTED/ LOOP CRACKED	673.70	673.70
1	RR DOOR LOCK RH	DENTED/DAMAGED	320.40	320.40
1	DOOR CENTER PILLAR RH (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 20% DISCOUNT		-903.20	-416.56
			3,612.80	1,666.24
	<b><u>LABOUR</u></b>			
	TO REMOVE AND REINSTALL AFFECTED ELECTRICAL WIRING SYSTEM FOR NECESSARY REPAIRS. TO CHECK AFFECTED ELECTRICAL WIRING SYSTEM.		50.00	30.00
	TO TRANSFER RHF DOOR COMPONENT PARTS TO NEW DOOR.	NOT NECESSARY	100.00	-
	TO TRANSFER RHR DOOR COMPONENT PARTS TO NEW DOOR.		100.00	50.00
	TO REMOVE AND REINSTALL RHS INTERIOR TRIMS, GARNISHES, SEATS, ETC. FOR NECESSARY REPAIRS.	NOT NECESSARY	80.00	-
	TO STRAIGHTEN, REPAIR, REALIGN ON AFFECTED AREA AND REPLACE DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF FRT DOOR RH, RH DOOR CENTER PILLAR AND DOOR CENTER PILLAR RH.		800.00	300.00
	TO SPRAY PAINTING, BLENDING ON AFFECTED AND ADJACENT AREA.		800.00	500.00



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SPRAY ANTI-RUST COATING ON NEW AND AFFECTED PANELS.		60.00	30.00
			1,990.00	910.00
<b>GRAND TOTAL</b>			<b>5,602.80</b>	<b>2,576.24</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>2,050.00</b>

Report Ref No. CS3/CTI22008610/Dqp3m4-1

**ANG BRYAN TANI**

**Automotive Assessor / Investigator**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.