



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10140/5014/TP/09.22

Date : 28 September 2022

Vehicle no : SMR 5014D

To: 365 Renewable Energy Pte Ltd
c/o 25 Kaki Bukit Road 4
#01-55, Synergy @ Kaki Bukit
Singapore 417800

INVOICE

PARTICULARS

AMOUNT

Registration No. : SMR 5014D
Date of accident : 24 September 2022
Make / Model : Toyota Voxy Hybrid 1.8X CVT
Invoice No. : 10140

Being work done and services rendered as follows:

- ✓ Inspection of Vehicle
- ✓ Re-Inspection
- ✓ Appraisal Report
- ✓ 102 Colored Photographs
- ✓ Transport Charges

SGD 922.00

TOTAL SGD 922.00

Dollars: Nine Hundred and Twenty-Two Only

(Cheque should be crossed and make payable to "TY5 CONSULTANCY")

TY5 CONSULTANCY



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10140/5014/TP/09.22

Date : 28 September 2022

Vehicle no : SMR 5014D

To: 365 Renewable Energy Pte Ltd
c/o 25 Kaki Bukit Road 4
#01-55, Synergy @ Kaki Bukit
Singapore 417800

VEHICLE INSPECTION REPORT

Name of Workshop : 365 Renewable Energy Pte Ltd
Place of inspection : 25 Kaki Bukit Road 4 #01-55, Synergy @ Kaki Bukit, Singapore 417800
Date of Accident : 24 September 2022
Date of Inspection : 24 September 2022

VEHICLE PARTICULAR

Registration No.	: SMR 5014D	Chassis Frame No.	: ZWR80-0279650
Make / Model	: Toyota Voxy Hybrid 1.8X CVT	Engine No.	: 2ZR8228681
Year of Registration	: 2018	Odometer Reading	: 71,539 KM
Class / Type	: MPV	Colour	: Silver

VEHICLE CONDITION

General Condition	: Very Good	Steering	: Serviceable
Paintwork	: Very Good	Foot/ Parking Brake	: Serviceable

TYRE CONDITION

	<u>Size</u>	<u>Thread Balance</u>
Front L/H :	KAPSEN 195 / 65 R15	8mm
Front R/H :	KAPSEN 195 / 65 R15	8mm
Rear L/H :	FIRENZA 195 / 65 R15	8mm
Rear R/H :	FIRENZA 195 / 65 R15	8mm

* The above is an estimate of the remaining life of the tyre thread in percentages

COST OF REPAIR

	Repairer S\$	Adjuster S\$
Parts	\$ 17,903.67	\$ 13,227.35
Labour	\$ 5,035.00	\$ 4,430.00
	<u>\$ 22,938.67</u>	<u>\$ 17,657.35</u>

TY5 Recommendation

Lump Sum Repair :
\$ 14,150.00

Estimated Repair Duration :

8

working days (excluding Sat, Sun & Public Holidays)

NOTE : The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited.



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation

Reference : TY5/TA/10140/5014/TP/09.22
Date : 28 September 2022
Vehicle no : SMR 5014D

ASSESSMENT SCHEDULE

<u>SN</u>	<u>Qty</u>	<u>Descriptions</u>	<u>Conditions</u>	<u>Repairer's Estimate</u>	<u>Surveyor's Revised</u>
<u>LIST ITEMS:-</u>					
1	1 pc	front bumper	deformed	\$ 1,352.37	\$ 1,352.37
2	1 pc	front bumper sponge	deformed	\$ 179.00	\$ 179.00
3	1 pc	front bumper reinforcement	buckled	\$ 457.00	\$ 457.00
4	1 pc	front bumper l/h side garnish	deformed	\$ 197.00	\$ 197.00
5	2 pcs	front bumper side retainer @S\$121.00	necessary	\$ 242.00	\$ 242.00
6	1 set	front bumper clips	necessary	\$ 35.00	\$ 35.00
7	1 pc	front grille	cracked	\$ 312.20	\$ 312.20
8	1 pc	bonnet	buckled	\$ 852.70	\$ 852.70
9	1 pc	bonnet chrome garnish	unconfirmed	\$ 397.20	not affected
10	1 pc	bonnet inner lock	jammed	\$ 98.20	\$ 98.20
11	2 pcs	bonnet hinge @S\$65.70	bent	\$ 131.40	\$ 131.40
12	1 pc	l/h headlamp w/ garnish	broken	\$ 2,257.20	\$ 2,257.20
13	1 pc	front support panel	buckled	\$ 1,724.90	\$ 1,724.90
14	1 pc	front wiper panel l/h side garnish	missing	\$ 76.80	\$ 76.80
15	1 pc	fuse box	deformed	\$ 594.00	\$ 594.00
16	1 pc	water pump	leaked	\$ 427.00	\$ 427.00
17	1 pc	r/h front fender	buckled	\$ 955.70	\$ 955.70
18	1 pc	l/h front fender	buckled	\$ 955.70	\$ 955.70
19	1 pc	l/h front fender housing panel	buckled	repair	repair
20	1 pc	l/h front fender qtr glass w/ moulding	necessary	\$ 372.00	\$ 372.00
21	1 pc	l/h front fender inner shield	torn	\$ 185.70	\$ 185.70
22	2 pcs	front fender " hybrid " emblem @S\$42.50	necessary	\$ 85.00	\$ 85.00
23	1 pc	l/h side skirt	deformed	\$ 857.00	\$ 857.00
24	1 pc	l/h front door	buckled	\$ 1,601.70	\$ 1,601.70
25	1 pc	l/h front shock absorber	bent	\$ 456.70	\$ 456.70
26	1 pc	l/h front lower arm	bent	\$ 1,003.40	\$ 1,003.40
27	1 pc	l/h front wheel hub w/ bearing	damaged	\$ 431.60	\$ 431.60
28	1 pc	l/h front knuckle arm	distorted	\$ 555.20	\$ 555.20
				\$ 16,793.67	\$ 16,396.47
Less 25%					\$ 4,099.12
				\$ 16,793.67	\$ 12,297.35
<u>SPECIAL NETT ITEMS:-</u>					
29	1 pc	l/h front sports rim	distorted	\$ 750.00	\$ 750.00
30	1 pc	l/h front tyre @50% depreciation	scratched	\$ 360.00	\$ 180.00
				\$ 1,110.00	\$ 930.00
Total				\$ 17,903.67	\$ 13,227.35



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10140/5014/TP/09.22
Date : 28 September 2022
Vehicle no : SMR 5014D

ASSESSMENT SCHEDULE

<u>SN</u>	<u>Qty</u>	<u>Descriptions</u>	<u>Conditions</u>	<u>Repairer's Estimate</u>	<u>Surveyor's Revised</u>
		B/F		\$ 17,903.67	\$ 13,227.35
1		To panel beat and renewal of all necessary damaged body parts		\$ 2,200.00	\$ 2,000.00
2		To realign headlamp focus		\$ 35.00	\$ 20.00
3		To check wiring and rewire		\$ 60.00	\$ 50.00
4		To remove and reinstall radiator and a/c condenser		\$ 160.00	\$ 120.00
5		To vacuum and refill a/c refrigerant		\$ 120.00	\$ 100.00
6		To perform 4 wheel alignment		\$ 120.00	\$ 100.00
7		To remove and reinstall front undercarriage		\$ 240.00	\$ 200.00
8		To remove and reinstall front door components		\$ 80.00	\$ 60.00
9		To remove and reinstall l/h front quarter glass		\$ 100.00	\$ 80.00
10		To apply anti-rust		\$ 120.00	\$ 100.00
11		To putty and spray-paint of affected areas		\$ 1,800.00	\$ 1,600.00
				\$ 5,035.00	\$ 4,430.00

Total \$ 22,938.67 \$ 17,657.35



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation


Reference : TY5/TA/10140/5014/TP/09.22

Date : 28 September 2022

Vehicle no : SMR 5014D

ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact of the collision was delivered Diagonally to the LH Side from rear to front; left to right; portion of the vehicle.

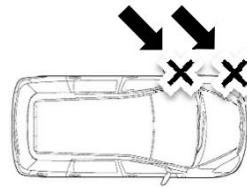

(Please refer to the list and survey photographs as attached for more information)

ASSESSMENT RECOMMENDATIONS

COST OF REPAIR

	Repairer S\$	Adjuster S\$
Parts	\$ 17,903.67	\$ 13,227.35
Labour	\$ 5,035.00	\$ 4,430.00
	<u>\$ 22,938.67</u>	<u>\$ 17,657.35</u>

TY5 Recommendation

Contract Lump Sum of \$ 14,150.00

Estimated Repair Duration : 8 working days
(excluding Sat, Sun & Public Holidays)

Enclosed No. Of Photograph : 102
(at the time of static inspection)

Our attached assessment schedule has been checked thoroughly by us against the actual damages sustained on the vehicle, and we recommend the replacement of parts and repair accordingly. We have adjusted the cost and the repairer has agreed to undertake the repair at the recommended sum to a acceptable quality and standards. We have not given authorization and instruction to the repairer to proceed with the repairs.

The survey was done on a **Without Prejudice Basis** and we are reverting the matter to you for a decision.

We thank you for engaging our services and we enclosed herewith our invoice no. 10140

TY5 CONSULTANCY

TERRENCE HONG
AUTOMOTIVE SURVEYOR

NOTE : This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company via email only and follow up with a phone call, within Fourteen (14) days from the date hereof. Otherwise this revised amount shall be treated as valid.

