



SINCERE APPRAISAL SERVICES PTE LTD Co.Reg no: 201800639R

60 Paya Lebar Road #07-41 Paya Lebar Square Singapore 409051

Tel : 6636 4628 Fax : 6636 4638 E-mail : office@sincereappraisal.com.sg

INVOICE

CrossBorders LLC
133 New Bridge Road
#23-03/04/05 Chinatown Point
Singapore 059413

Invoice No: 060120-686

Our ref: 686/TP/2019

Date: 6/1/2020

Claim Type: Third Party
Vehicle Reg No: SKA9789M
Vehicle Make/Model: Chevrolet Cruze 1.6 L Auto

Date of Loss: 11/12/2019
Claimant: Yeoh Kian Boon

Description	Amount (S\$)
1. Professional Fee (including Transport, 76 Photographs and Miscellaneous charges)	876
Total	876

Singapore Dollar: Eight hundred and seventy six dollars only.

Cheques should be crossed A/C PAYEE and made payable to Sincere Appraisal Services Pte Ltd



Sincere Appraisal Services Pte Ltd



SINCERE
APPRAISAL SERVICES PTE LTD

VEHICLE DAMAGE INSPECTION REPORT

Our Ref: 686/TP/2019

Date: 6/1/2020

REFERENCE

Date of loss: 11/12/2019
Claimant: Yeoh Kian Boon

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKA9789M	Make &	Chevrolet
Reg date:	19/11/2011	Model	Cruze 1.6L Auto
Colour:	Red	Engine No:	F16D4242888KA
Type:	Motor Car	Chassis No:	KL1JA69E9BK128501
Type of Claims:	Third Party	Odometer No:	243795km
		Engine Cap:	1598cc

CONDITION OF VEHICLE AT THE TIME OF SURVEY (STATIC ONLY)

General Condition:	Good	Steering:	Good	Engine Modification:	Nil
Paint work:	Good	Handbrake:	Good	Pre-accident	
		Footbrake:	Good	Damage:	Nil

CONDITION OF TYRES

Front Left Size:	Radar 215/50ZR17 70%	Front Right Size:	Radar 215/50ZR17 70%
Rear Left Size:	Radar 215/50ZR17 70%	Rear Right Size:	Radar 215/50ZR17 70%

The above percentages represent the remaining life of the tyre threads

COST OF REPAIRS

	Repairer S\$	Adjuster S\$
Parts	\$ 13,462.30	\$ 11,279.80
Labour	\$ 4,930.00	\$ 3,920.00
Calculated Cost (S\$) :	<u>\$ 18,392.30</u>	<u>\$ 15,199.80</u>

Recommended Lump Sum Repair Cost (S\$) : \$ 12,200.00

Date of Assignment: 16/12/2019
Date Inspected: 16/12/2019
Est. repair Period: 08 days


Inspected At: EM Solution Pte Ltd
160 Sin Ming Dr
#03-18/19 Sin Ming Autocity
Singapore 575722

SINCERE APPRAISAL SERVICES PTE LTD Co.Reg no: 201800639R

60 Paya Lebar Road #07-41 Paya Lebar Square Singapore 409051

Tel : 6636 4628 Fax : 6636 4638 E-mail : office@sincereappraisal.com.sg

POINT OF IMPACT

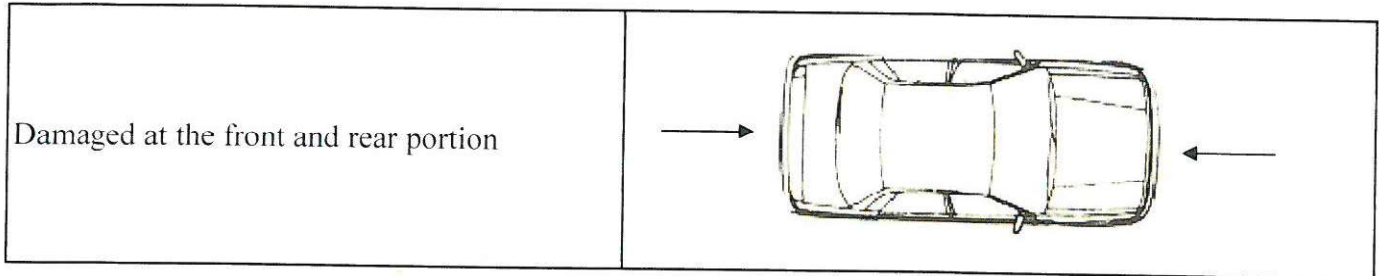

BRIEF CIRCUMSTANCES OF ACCIDENT

The Insured's vehicle collided onto the Third Party's vehicle along AYE Expressway towards City.

GENERAL DESCRIPTION OF DAMAGES

Our visual inspection of the vehicle revealed that the damages noted are at the front and rear portion.

SPECIAL REMARKS

We have inspected the actual damages found on the vehicle and recommend the replacement of parts and repairs accordingly. The estimated repair cost is \$18,392.30. The repairer has agreed to undertake the repairs at our adjusted lump sum amount of \$12,200.00.

We have not authorised the repair. Under normal circumstances, estimated **08** working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.



Dave Chang
Automotive Appraiser
AUTO. ENG, CAE, CGI
MIRTE, MSAAA, MTM

Automotive Appraiser: Dave Chang

Please note that this report is solely based on our findings at the time and place of inspection. This inspection has been carried out to our best knowledge and ability. Any other liability is hereby excluded.

ANNEX A

REPAIR DETAILS

Recommended Parts

No	Qty	Description	Condition	Repairer's Amount	Adjuster's Amount
1	1	Front bumper assy	warped	\$ 1,245.00	\$ 1,245.00
2	2	Front bumper bracket	bent/necessary	\$ 96.00	\$ 96.00
3	2	Front bumper side retainer	bent/necessary	\$ 96.00	\$ 96.00
4	1	Front bumper reinforcement	bent	\$ 452.00	\$ 452.00
5	1	Front bumper sponge	cracked	\$ 192.00	\$ 192.00
6	1	Front grille assy	bent/dented	\$ 288.00	\$ 288.00
7	1	Front grille emblem	necessary	\$ 88.00	\$ 88.00
8	1	Front bonnet assy	dented	\$ 1,250.00	\$ 1,250.00
9	1	Front air con condenser assy	bent/dented	\$ 1,198.00	\$ 1,198.00
10	1	Front left headlamp	bent/cut	\$ 1,420.00	\$ 1,420.00
11	1	Front right headlamp	bent/cut	\$ 1,420.00	\$ 1,420.00
12	1	Front air duct	bent	\$ 118.00	\$ 118.00
13	1	Front lock mechanism	bent	\$ 175.00	\$ 175.00
14	1	Front support panel inner garnish	cracked	\$ 129.00	\$ 129.00
				<hr/>	<hr/>
				\$ 8,167.00	\$ 8,167.00
Less 10%				\$ 816.70	\$ 816.70
				<hr/>	<hr/>
				\$ 7,350.30	\$ 7,350.30

Special Nett Items

1	10	Front bumper clips	necessary	\$ 50.00	\$ 50.00
2	4	Front grille clips	necessary	\$ 20.00	\$ 20.00
3	1	Front no plate with garnish	necessary	\$ 80.00	\$ 80.00
4	1	Front air con gas	necessary	\$ 80.00	\$ 80.00
				<hr/>	<hr/>
				\$ 230.00	\$ 230.00

Total Parts

\$ 7,580.30 \$ 7,580.30

ANNEX A

REPAIR DETAILS

Recommended Parts

No	Qty	Description	Condition	Repairer's Amount	Adjuster's Amount
1	1	Rear bumper assy	dented/warped	\$ 1,100.00	\$ 1,100.00
2	2	Rear bumper bracket	bent/necessary	\$ 86.00	\$ 86.00
3	2	Rear bumper side retainer	bent/necessary	\$ 86.00	\$ 86.00
4	1	Rear bumper reinforcement	dented/bent	\$ 450.00	\$ 450.00
5	1	Rear bumper tow cover	warped	\$ 76.00	\$ 76.00
6	1	Rear bootlid assy	repair	\$ 1,600.00	\$ -
7	1	Rear bootlid lock	bent	\$ 175.00	\$ 175.00
8	1	Rear right taillamp	cracked	\$ 694.00	\$ 694.00
9	1	Rear end lower panel	repair	\$ 825.00	\$ -
10	1	Rear bootlid weatherstrip	necessary	\$ 188.00	\$ 188.00
				\$ 5,280.00	\$ 2,855.00
Less 10%				\$ 528.00	\$ 285.50
				\$ 4,752.00	\$ 2,569.50

Special Nett Items

1	10	Rear bumper clips	necessary	\$ 50.00	\$ 50.00
2	4	Rear bumper reverse sensor	malfunction	\$ 1,000.00	\$ 1,000.00
3	1	Rear no plate with garnish	necessary	\$ 80.00	\$ 80.00
				\$ 1,130.00	\$ 1,130.00

Total Parts

\$ 5,882.00 \$ 3,699.50

ANNEX B

REPAIR DETAILS

Recommended Labour

No	Description	Repairer's Amount	Adjuster's Amount
1	Labour for panel beating, cut, weld, straighten front affected area and replace front damaged parts.	\$ 1,000.00	\$ 800.00
2	To putty and spray painting front portion.	\$ 1,000.00	\$ 800.00
3	To check wiring and focus front headlamp.	\$ 50.00	\$ 30.00
4	To apply anti rust proofing to front affected area.	\$ 100.00	\$ 80.00
5	Labour for panel beating, cut, weld, straighten rear affected area and replace rear damaged parts.	\$ 1,000.00	\$ 800.00
6	To putty and spray painting rear portion.	\$ 1,000.00	\$ 800.00
7	To check rear lighting and wiring.	\$ 50.00	\$ 30.00
8	To remove and install rear bootlid lock mechanism.	\$ 80.00	\$ 60.00
9	To remove and install rear inner garnish and trim to facilitate the repair.	\$ 140.00	\$ 120.00
10	To apply anti rust proofing to rear affected area.	\$ 100.00	\$ 80.00
11	To remove and install rear bumper reverse sensor.	\$ 80.00	\$ 60.00
12	Towing service.	\$ 100.00	\$ 80.00
13	To remove and install front lock mechanism.	\$ 80.00	\$ 60.00
14	To remove and install air con system to facilitate the repair.	\$ 150.00	\$ 120.00
Total labour :		\$ 4,930.00	\$ 3,920.00

ANNEX C

REPAIR DETAILS

Adjusted Repair Cost

	Repairer's Amount	Adjuster's Amount
Total parts :	\$ 13,462.30	\$ 11,279.80
Total labour :	\$ 4,930.00	\$ 3,920.00
Total repair cost :	\$ 18,392.30	\$ 15,199.80

Adjusted Repair Cost (Lump Sum Repair)

\$ 12,200.00

