

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS3/AIS23007486/RVP3E2**Date:** 03/08/2023REFERENCE

Handling Insurer:	Allianz Insurance Singapore Pte. Ltd.	Policy No:	SP2006469263-01
<b>Claimant Vehicle No :</b>	SNG6994P	<b>Insured Vehicle No :</b>	SJY9032Z
Date of Loss:	19/07/2023	Nature of Claim:	TP
		Claim No:	2023 32010942JK

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	<b>SNG6994P</b>	Engine No:	FB16YC07063
Make & Model:	SUBARU XV, 1.6 I-S AWD CVT (A)	Chassis No:	JF1GT3KC5JG026170
Reg. Date:	18/12/2017 (Man. Year: 2017)	Odometer:	114321 km
Colour:	White		
Engine Capacity:	1600 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	<b>Market Value/New Car Price</b>		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/50 R17	Rear Tyre Size:	225/50 R17
Front Left Side:	COMPETUS 6 mm	Rear Left Side:	COMPETUS 6 mm
Front Right Side:	COMPETUS 6 mm	Rear Right Side:	COMPETUS 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (\$\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

INSPECTION

Date of Assignment:	24/07/2023	Gold Autoworks Pte Ltd (HQ)
Date Inspected:	25/07/2023 Inspected At:	48 TOH GUAN ROAD EAST, #01-119 ENTERPRISE HUB
Estimated Period of Repair:	3.0 days	Singapore 608586

**Adjuster:** MOHD RASUL**Manager:** VERON CHEN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.

THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$2,000.00  
-\$3,000.00

# REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 03 Aug 2023)
Parts:	144	SUBARU XV 1.6 I-S AWD CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SNG6994P)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

## Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >