



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
STRIDES AUTOMOTIVE SERVICES PTE LTD			Ref:	CS3/SMR23000142/Kny3m4-1
60 WOODLANDS INDUSTRIAL PARK E4SINGAPORE 757705			Date:	02/08/2023
			Code:	SMR
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>				
	<b>Insured Veh.</b>	SHB 5123R	<b>Veh. Inspected</b>	SJQ 7067D
	<b>Policy No.</b>		<b>Coverage (\$)</b>	0.00
	<b>Claim No.</b>	TAX/12/22/2082	<b>Excess (\$)</b>	0.00
	<b>Assign From</b>	ASHLENE LEE	<b>Assign Date</b>	25/07/2023
<b>2. Vehicle Particulars &amp; Condition</b>				
	<b>Make &amp; Model</b>	HONDA AIRWAVE (A)	<b>c.c</b>	1496
	<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2009
	<b>Chassis No.</b>	GJ11304060	<b>Colour</b>	METALLIC GREY
	<b>Odometer</b>	243783 KM	<b>Steering</b>	IN ORDER
	<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
	<b>General</b>	GOOD		
<b>3. Conditions of Tyres</b>				
		<b>Size</b>	<b>Make</b>	<b>Balance</b>
	<b>R/H Front Tyre</b>	175/65 R15	DUNLOP	8 mm
	<b>L/H Front Tyre</b>	175/65 R15	DUNLOP	8 mm
	<b>R/H Rear Tyre</b>	175/65 R15	DUNLOP	8 mm
	<b>L/H Rear Tyre</b>	175/65 R15	DUNLOP	8 mm
<b>4. Description of Damages</b>				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.			
<b>5. General Information</b>				
	<b>Accident Date</b>	31/12/2022	<b>Inspection Date</b>	09/01/2023
	<b>Survey held at</b>	YAP MOTOR SERVICE PTE LTD BLK 7 SIN MING IND EST SEC C #01-80 & 82 SINGAPORE 575642		
<b>5a. Remarks</b>				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
<b>5b. Estimate Days of Repair</b>				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		<b>3 Working Days</b>	

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

**ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJQ 7067D**

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	FRONT BUMPER	DEFORMED / HOLDER BROKEN	1,225.00	1,151.00
1	FRONT BUMPER SIDE RETAINER RH	CRACKED	48.00	48.00
1	HEAD LAMP RH	CRACKED	779.60	779.60
1	HEAD LAMP LOWER BRACKET RH	CRACKED	72.50	72.50
1	FRONT FENDER RH	TO REPAIR SEE LABOUR	645.00	-
1	FRONT FENDER INNER SHIELD RH	SERVICEABLE	157.00	-
	LESS 20% DISCOUNT		-585.42	-410.22
			2,341.68	1,640.88
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	50.00
1	SET FRONT FENDER INNER SHIELD CLIP (SN)	NOT NECESSARY	40.00	-
			90.00	50.00
	<b><u>LABOUR</u></b>			
	TO DISMANTLE, REPLACE, CUT, WELD, KNOCK OUT DENTS TO STRAIGHTEN ACCIDENT DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF FRONT FENDER RH.		600.00	300.00
	TO PUTTY & SPRAY PAINT ACCIDENT DAMAGED PARTS AND ADJACENT PANELS.		600.00	400.00
	TO APPLY RUST PROOFING ON ACCIDENT DAMAGED PARTS AND ADJACENT PANELS.	NOT NECESSARY	40.00	-
	WIRING /BULB CHECKING/FOCUSING.		40.00	20.00
			1,280.00	720.00
	<b>GRAND TOTAL</b>		<b>3,711.68</b>	<b>2,410.88</b>
	<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>1,900.00</b>

Report Ref No. CS3/SMR23000142/Kny3m4-1

**KONG SENG CHEONG**

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.